

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG20011116/KQD3E2

Date: 29/12/2021

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.

Policy No: 28845214MKC

Claimant Vehicle No : YN651B

Insured Vehicle No : XE2381B

Date of Loss: 28/09/2020

Nature of Claim: TP

Claim No: 629257

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **YN651B**

Make & Model: ISUZU NPR75UH5A, 5.2 D (M)

Engine No: 4HK1746253

Reg. Date: 10/10/2009 (Man. Year: 2009)

Chassis No: JAANPR75H97101904

Colour: White

Odometer: 0 km

Engine Capacity: 5193 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/75 R17.5

Rear Tyre Size:

215/75 R17.5 (D)

Front Left Side: Inning 6 mm

Rear Left Side:

Firenza 9/9 mm

Front Right Side: Inning 9 mm

Rear Right Side:

Firenza 9/9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	19,223.00	16,311.00	2,912.00	15.15
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,950.00	6,270.00	680.00	9.78
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	26,173.00	22,581.00	3,592.00	13.72
+ GST 7.00/7.00% (S\$)	1,832.11	1,580.67	251.44	13.72
Nett Amount (S\$)	28,005.11	24,161.67	3,843.44	13.72

INSPECTION

Date of Assignment: 14/10/2020

Date Inspected: 15/10/2020 Inspected At:

Cheng Hoe Motor Pte Ltd (Woodlands)

38 Woodlands Industrial Park E1, #05-04/05

Singapore 757700

Estimated Period of Repair: 24.0 days

Adjuster: KENNETH KONG

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

(REPAIR COST NOT CONCLUDE)

(EXCLUDE CHECK ITEMS S\$2,627.00 NETT)

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 29 Dec 2021)	
Parts:	N/A	ISUZU NPR75UH5A 5.2 D (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for YN651B)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT WINDSCREEN GLASS	Shattered	750.00 F	*750.00 F
2	1		*FRONT WINDSCREEN GLASS OUTER MOULDING	Torn	150.00 F	*150.00 F
3	1		*FRONT WINDSCREEN GLASS INNER SHIELD	Necessary	50.00 F	*50.00 F
4	1		*FRONT WINDSCREEN GLASS LOWER MOULDING	Necessary	80.00 F	*80.00 F
5	1		*TOP ROOF PANEL	Bent	710.00 F	*710.00 F
6	1		*TOP ROOF PANEL FRT INNER REINFORCEMENT	Bent	75.00 F	*75.00 F
7	2		*TOP ROOF PANEL SIDE INNER BEAMS	Bent	160.00 F	*160.00 F
8	1		*CABIN REAR PANEL	Bent	826.00 F	*826.00 F
9	1		*CABIN REAR WINDSCREEN GLASS	Shattered	145.00 F	*145.00 F
10	1		*CABIN REAR WINDSCREEN GLASS RUBBER	Missing	70.00 F	*70.00 F
11	2		*FRONT WINDSCREEN PILLAR OUTERS	Bent	1,960.00 F	*1,960.00 F
12	1		*FRONT LH WINDSCREEN PILLAR INNER	Bent	120.00 F	*120.00 F
13	1		*TOP ROOF LINING	Torn	788.00 F	*788.00 F
14	2		*SUN VISOR	Distorted	270.00 F	*270.00 F
15	1		*FRONT INNER PANEL	Bent	539.00 F	*539.00 F
16	1		*FRONT WIPER PANEL	Bent	290.00 F	*290.00 F
17	1		*FRONT GRILLE	Mtg Cracked	252.00 F	*252.00 F
18	1		*SET FRONT GRILLE CLIP	Necessary	12.00 F	*12.00 F
19	1		*FRONT PANEL EMBLEM (ISUZU)	Necessary	88.00 F	*88.00 F
20	1		*FRONT LH CORNAL GARNISH	Bent	118.00 F	*118.00 F
21	1		*DASHBOARD	Deformed / Cracked	480.00 F	*480.00 F
22	1		*DASHBOARD REINFORCEMENT	Bent	450.00 F	*450.00 F
23	1		*DASHBOARD LH GLOVE BOX	Distorted	143.00 F	*143.00 F
24	1		*DASHBOARD LH GLOVE BOX COVER	Dented	58.00 F	*58.00 F
25	1		*DASHBOARD CENTRE LOWER	Distorted	123.00 F	*123.00 F
26	1		*DASHBOARD CENTRE TOP GARNISH	Buckled	199.00 F	*199.00 F
27	1		*FRONT LH SIDE MIRROR STAY	Missing	189.00 F	*189.00 F
28	1		*LH SIDE MIRROR SQUARE	Missing	80.00 F	*80.00 F
29	1		*LH SIDE MIRROR ROUND	Missing	32.00 F	*32.00 F
30	1		*FRONT LH SEAT	Bent	900.00 F	*900.00 F
31	1		*FRONT LH SAFETY BELT	Jammed	235.00 F	*235.00 F
32	1		*FRONT LH STEP TRAY	Cracked	74.00 F	*74.00 F
33	1		*AIR-CON BLOWER	Cracked	350.00 F	*350.00 F
34	1		*AIRCON EVAPORATOR	Cracked	1,150.00 F	*1,150.00 F
35	2		*AIRCON EVAPORATOR BRACKETS	Distorted	84.00 F	*84.00 F
36	1		*AIR-CON CONDENSER	Serviceable	285.00 F	*- F
37	1		*HEADLAMP LH	Broken	228.00 F	*228.00 F
38	1		*LH SIGNAL LAMP	Broken	70.00 F	*70.00 F
39	1		*FRONT INNER AIRCON DUCTING	Dented	108.00 F	*108.00 F
40	2		*FRONT INNER SIDE AIRCON DUCTING	* Check	90.00 F	*- F
41	1		*SPEED METER	* Check	680.00 F	*- F
42	1		*METER OUTER GARNISH	Distorted	210.00 F	*210.00 F
43	1		*FUSES BOX ASSY	* Check	490.00 F	*- F
44	1		*FUSES BOX OUTER COVER	* Check	29.00 F	*- F
45	1		*ECU	* Check	650.00 F	*- F
46	1		*FRONT WASHER TANK	Dented	85.00 F	*85.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
47	1	*HEATER DELAY	Dented	195.00 F	*195.00 F
48	1	*SIGNAL DELAY	Dented	48.00 F	*48.00 F
49	2	*FRONT WINDSCREEN PILLAR TOP GARNISHS	Distorted / Cracked	126.00 F	*126.00 F
50	1	*STEERING WHEEL	Warped	310.00 F	*310.00 F
51	1	*STEERING SHAFT	* Check	490.00 F	*- F
52	2	*FRONT DOORS	O/S Buckled / N/S Missing	1,056.00 F	*1,056.00 F
53	1	*FRONT LH DOOR GLASS	Missing	204.00 F	*204.00 F
54	1	*FRONT LH DOOR REGULATOR	Missing	104.00 F	*104.00 F
55	1	*FRONT LH DOOR REGULATOR MOTOR	Missing	140.00 F	*140.00 F
56	1	*FRONT LH DOOR CHANNEL	Missing	47.00 F	*47.00 F
57	2	*FRONT LH DOOR HINGE	Bent	130.00 F	*130.00 F
58	1	*FRONT LH DOOR RUBBER	Missing	45.00 F	*45.00 F
59	1	*FRONT LH DOOR INNER LOCK	Missing	99.00 F	*99.00 F
60	1	*FRONT LH DOOR LOWER RUBBER	Missing	68.00 F	*68.00 F
61	1	*CABIN REAR LH MOUNTING	* Check	198.00 F	*- F
62	1	*FRONT WINDSCREEN GLASS GUM	Necessary	40.00 FS	*40.00 FS
63	1	*ERP BRACKET	Necessary	18.00 FS	*18.00 FS
64	1	*TRUCK FRONT GATE	Broken	580.00 FS	*580.00 FS
65	1	*TRUCK FRONT WOODEN RAILING	Broken	400.00 FS	*400.00 FS

F=Franchise part. S=SpcNett.

Total Parts (S\$) 19,223.00 16,311.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TOWING	New	80.00	80.00
2	REMOVE AND REFIX FRONT WINDSCREEN GLASS	New	100.00	100.00
3	REMOVE AND REFIX REAR WINDSCREEN GLASS	New	50.00	50.00
4	REMOVE & REFIX SEAT, CARPET, GARNISH, TOP ROOF LINING, ETC	New	120.00	120.00
5	REMOVE & REFIX STEERING WHEEL, SHAFT, CLUTCH, BRAKE PEDAL, FUEL PIPE ASSY, GEAR HANDLE ASSY & REALIGN STEERING WHEEL	New	150.00	150.00
6	REMOVE AND REFIX AIRCON, CHECK, VACUUM & REFILL GAS	New	100.00	100.00
7	REMOVE & REFIX DASHBOARD, METER ASSY & CHECK WIRING	New	250.00	250.00
8	REMOVE & REFIX FRT GRILLE ASSY, HEADLAMPS, FRT PANEL, SIDE MIRROR ASSY, FRT WIPER ASSY, FRT BOTH DOORS, TRANSFER DOOR ASSY, CUT, WELD & RENEW FRT BOTH W/SCREEN PILLARS, FRT INNER PANEL, TOP ROOF PANEL, REINFORCEMENT & BEAM, CABIN REAR PANEL, TO BE CONTINUED (NPA)	New	0.00	0.00
9	KNOCK & REPAIR FRT FLOORBOARD PANEL, REALIGN CABIN STRUCTURE INCLUDING REMOVE & REFIX, STRAIGHTEN, REPAIR & REALIGN FRT CHASSIS & CABIN POSITION	New	3,800.00	3,500.00
10	REMOVE & REFIX REAR TRUCK FRT GATE & RAILING, REPAIR & REALIGN REAR STRUCTURE	New	400.00	320.00
11	REMOVE & REFIX FRT BOTH DOORS GLASS (\$50X2)	New	100.00	100.00
12	PUTTY & RESPRAY ON TOP ROOF PANEL, REAR PANEL, FRT BOTH DOORS, FRT PANEL & INNER PANEL, FLOORBOARD PANEL, BOTH W/SCREEN PILLARS & ALL AFFECTED AREAS	New	1,800.00	1,500.00
Gross Labour Cost (\$\$)			6,950.00	6,270.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >