

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG20011218/KGA3Q2
Date: 17/12/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1800028371
Claimant Vehicle No :	SMM2732K	Insured Vehicle No :	GBH9689M
Date of Loss:	13/10/2020	Nature of Claim:	TP
		Claim No:	0089546172SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMM2732K	Engine No:	L13B14100918
Make & Model:	HONDA JAZZ, 1.3 CVT (A)	Chassis No:	JHMGK3850KS213734
Reg. Date:	24/06/2019 (Man. Year: 2019)	Odometer:	29027 km
Colour:	Metallic Silver		
Engine Capacity:	1318 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	175/65 R15	Rear Tyre Size:	175/65 R15
Front Left Side:	Yokohama 8 mm	Rear Left Side:	Yokohama 8 mm
Front Right Side:	Yokohama 8 mm	Rear Right Side:	Yokohama 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,011.68	5,233.60	2,778.08	34.68
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,970.00	2,640.00	1,330.00	33.50
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	11,981.68	7,873.60	4,108.08	34.29
+ GST 7.00/7.00% (S\$)	838.72	551.15	287.57	34.29

Nett Amount (S\$)	12,820.40	8,424.75	4,395.65	34.29
+ Loss of Use (12.0 x S\$150.00/day) (S\$)		1,800.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		10,232.20		
Global Sum Settlement (S\$)		10,000.00		

INSPECTION

Date of Assignment: 15/10/2020

Date Inspected: 16/10/2020

Estimated Period of Repair: 8.0 days

Inspected At:

K.kim Hin Auto Pte Ltd (Autocity)
 160 Sin Ming Drive, #02-18/19/20/21, Sin Ming Autocity
 Singapore 575722

Adjuster: KENNETH KONG**Manager:** Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Bent / Cracked	504.60 FL	*504.60 FL
2	1		*N/S FRONT BUMPER SIDE RETAINER	Distorted	10.40 FL	*10.40 FL
3	1		*N/S FRONT BUMPER FOG COVER	Dented / Cut	29.00 FL	*29.00 FL
4	1		*FRONT BUMPER REINFORCEMENT	Bent	213.00 FL	*213.00 FL
5	1		*FRONT BUMPER LOWER CENTRE GRILLE	Distorted	137.90 FL	*137.90 FL
6	1		*N/S FRONT BUMPER LOWER CENTRE GRILLE SIDE GARNISH	Serviceable	8.50 FL	*- FL
7	10		*FRONT BUMPER CLIPS	Necessary	35.00 FL	*35.00 FL
8	1		*N/S HEADLAMP ASSY	Cracked	558.60 FL	*558.60 FL
9	1		*N/S HEADLAMP LOWER BRACKET	Cracked	27.70 FL	*27.70 FL
10	2		*REAR NUMBER PLATE LAMP (LH/RH)	Serviceable	65.60 FL	*- FL
11	1		*REAR BUMPER	Bent	492.60 FL	*492.60 FL
12	2		*REAR BUMPER SIDE RETAINER (LH/RH)	Distorted	33.80 FL	*33.80 FL
13	10		*REAR BUMPER CLIPS	Necessary	35.00 FL	*35.00 FL
14	1		*REAR BUMPER LOWER CENTRE GARNISH	Warped	65.00 FL	*65.00 FL
15	2		*REAR BUMPER LOWER SIDE GARNISH (LH/RH)	Serviceable	42.40 FL	*- FL
16	1		*TAILGATE	Bent	830.60 FL	*830.60 FL
17	1		*TAILGATE GLASS	Shattered	626.60 FL	*626.60 FL
18	1		*SET TAILGATE GLASS MOULDING	Necessary	95.60 FL	*95.60 FL
19	1		*TAILGATE LOCK	Dented	78.90 FL	*78.90 FL
20	1		*TAILGATE LOCK CATCH	Repair	24.70 FL	*- FL
21	1		*TAILGATE OUTER GARNISH	Cracked	105.50 FL	*105.50 FL
22	1		*TAILGATE OUTER HANDLE	Serviceable	58.30 FL	*- FL
23	2		*TAILGATE HINGES (LH/RH)	Repair	66.40 FL	*- FL
24	2		*TAILGATE DAMPER (LH/RH)	Serviceable	188.00 FL	*- FL
25	1		*TAILGATE WIPER ARM	Serviceable	58.00 FL	*- FL
26	1		*TAILGATE WIPER ARM SCREW CAP	Cracked	8.00 FL	*8.00 FL
27	1		*TAILGATE WIPER MOTOR	Serviceable	81.00 FL	*- FL
28	2		*TAILGATE LAMP (LH/RH)	Serviceable	178.40 FL	*- FL
29	1		*TAILGATE INNER POCKET HANDLE	Serviceable	8.50 FL	*- FL
30	1		*TAILGATE INNER TRIM BOARD	Mtg Cracked	53.70 FL	*53.70 FL
31	12		*TAILGATE INNER TRIM BOARD CLIPS	Necessary	42.00 FL	*42.00 FL
32	1		*TAILGATE WEATHERSTRIP	Distorted	92.30 FL	*92.30 FL
33	1		*TAILGATE LOGO	Necessary	15.70 FL	*15.70 FL
34	1		*TAILGATE JAZZ EMBLEM	Necessary	18.90 FL	*18.90 FL
35	1		*TAILGATE WIPER BLADE	Serviceable	41.10 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
36	2		*TAILLAMP ASSY (LH/RH)	Cracked	489.20 FL	*489.20 FL
37	2		*TAILLAMP PANEL (LH/RH)	Repair	153.60 FL	*- FL
38	2		*TAILLAMP CLIPS	Necessary	7.00 FL	*7.00 FL
39	1		*REAR END PANEL	Bent	328.60 FL	*328.60 FL
40	1		*REAR END PANEL TOP GARNISH	Dented	60.80 FL	*60.80 FL
41	1		*O/S REAR FNER	Repair	570.50 FL	*- FL
42	1		*O/S REAR FNER 1/4 GLASS MOULDING	Not Necessary	20.60 FL	*- FL
43	1		*O/S REAR FNER INNER TRIM LINING	Serviceable	169.00 FL	*- FL
44	11		*O/S REAR FENDER INNER TRIM LINING CLIPS	Not Necessary	38.50 FL	*- FL
45	1		*SPARE TYRE PANEL	Repair	683.30 FL	*- FL
46	1		*SPARE TYRE PANEL SPONGE COMPARTMENT	Cracked	117.40 FL	*117.40 FL
47	1		*SPARE TYRE PANEL TOP LID	Serviceable	189.90 FL	*- FL
48	1		*O/S SPARE TYRE PANEL SIDE PANEL	Repair	92.30 FL	*- FL
49	1		*REAR EXHAUST BOX	Repair	430.10 FL	*- FL
50	1		*REVERSE CAMERA	Mtg Cracked	1,041.10 FL	*1,041.10 FL
51	1		*REAR SHELF COVER	Serviceable	228.90 FL	*- FL
52	1		*REAR NUMBER PLATE	Dented	40.00 FS	*40.00 FS
53	1		*REAR BUMPER L BRACKET	Necessary	30.00 FS	*30.00 FS
54	1		*TAILGATE GLASS SEALANT	Necessary	40.00 FS	*40.00 FS
55	1		*TAILGATE GLASS DAMPING SEAL	Necessary	20.00 FS	*20.00 FS
56	3		*TAILGATE 1 AND 9 STICKER	Necessary	30.00 FS	*30.00 FS
57	1		*TAILGATE THANK YOU FOR YOUR PATIENCE STICKER	Necessary	150.00 FS	*150.00 FS
58	1		*O/S REAR FENDER 1/4 GLASS SEALANT	Not Necessary	40.00 FS	*- FS
59	1		*O/S REAR FENDER 1/4 GLASS DAMPING SEAL	Not Necessary	20.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	9,922.10	6,464.50
- List Item Discount on L Items 20.00/20.00% (\$)	1,910.42	1,230.90
Total Parts (\$)	8,011.68	5,233.60

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REMOVE ,CUT OUT DAMAGED PARTS,PANEL BEATING ,WELDING ,ALIGN,REFIX AND TO RENEW AFFECTED PARTS	New	1,600.00	1,000.00
2	TO REMOVE AND RENEW REAR WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST	New	120.00	120.00
3	TO REMOVE AND REFIT RIGHT REAR FENDER 1/4 GLASS AND CONDUCT WATER LEAK TEST	New	120.00	0.00
4	TO REMOVE AND REFIT REAR UPHOLSTERY TRIMMING ,ROOF LINING ,SEATS,SPEAKER BOARD IN ORDER TO FAICLITATE REPAIRING WORKS	New	120.00	100.00
5	TO APPLY UNDERSEALING	New	160.00	60.00
6	TO REMOVE AND RENEW EXHAUST SILENCER BOX	New	60.00	60.00
7	TO TRANSFER TAILGATES FITTINGS	New	80.00	60.00
8	TO PUTTY AND RESPRAY ON AFFECTED PORTIONS	New	1,650.00	1,200.00
9	TO FOCUS HEADLAMPS AND TAILLAMPS (NPA)	New	0.00	0.00
10	TO CHECK FRONT AND REAR LIGHTING OPERATION AND REWIRING	New	60.00	40.00
Gross Labour Cost (S\$)			3,970.00	2,640.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >