

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)
 51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
 Singapore 408933
 Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG20011236/EYD3E2
Date: 10/11/2020

REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2070094340
Claimant Vehicle No :	SMM6617J	Insured Vehicle No :	GY1123H
Date of Loss:	14/10/2020	Nature of Claim:	TP
		Claim No:	3332014788SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMM6617J	Engine No:	L15B4025696
Make & Model:	HONDA VEZEL, 1.5 X CVT (A)	Chassis No:	RU11105694
Reg. Date:	12/01/2016 (Man. Year: 2015)	Odometer:	89994 km
Colour:	White		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/65 R16	Rear Tyre Size:	215/65 R16
Front Left Side:	Bridgestone 5 mm	Rear Left Side:	Bridgestone 5 mm
Front Right Side:	Bridgestone 5 mm	Rear Right Side:	Bridgestone 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	16/10/2020	
Date Inspected:	04/11/2020	Inspected At: Garage 13 Pte. Ltd. (HQ) 8 Kaki Bukit Avenue 4, #03-46 Premier Singapore 415875
Estimated Period of Repair:	4.0 days	

Adjuster: CHEN TSUE YEE

Manager: YVONNE WONG YIN CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER	Broken	0.00 F	*- F
2	1		*FRT BUMPER CLIPS	Necessary	0.00 F	*- F
3	2		*FRT BUMPER SIDE RETAINER	Broken	0.00 F	*- F
4	1		*FRT BUMPER REINFORCEMENT	Bent	0.00 F	*- F
5	1		*FRT LH BUMPER FOG LAMP COVER	Crushed	0.00 F	*- F
6	1		*FRT LH BUMPER FOG LAMP	* Check	0.00 F	*- F
7	1		*FRT GRILLE	Broken	0.00 F	*- F
8	1		*FRT GRILLE EMBLEM	Necessary	0.00 F	*- F
9	1		*FRT SUPPORT PANEL	Repair	0.00 F	*- F
10	1		*FRT SUPPORT PANEL TOP GARNISH COVER	* Check	0.00 F	*- F
11	1		*FRT LH HEADLAMP ASSY	Broken	0.00 F	*- F
12	1		*BONNET	Dented	0.00 F	*- F
13	1		*BONNET LOCK	Bent	0.00 F	*- F
14	2		*BONNET HINGE	Bent	0.00 F	*- F
15	1		*RADIATOR DEFLECTOR LH	Crushed	0.00 F	*- F
F=Franchise part.						
					Total Parts (S\$)	0.00 0.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >