

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI20011386/UVF3Q2

Date: 03/11/2020

REFERENCE

Handling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMCVSNA00006852002

**Claimant
Vehicle No :** SLJ8788M

**Insured
Vehicle No :** GBF9999D

Date of Loss: 17/10/2020

Nature of
Claim: TP

Claim
No: SNM20D203931/C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SLJ8788M**

Make & Model: TOYOTA COROLLA ALTIS, 1.6 CVT (A)

Engine No: 1ZRX574436

Reg. Date: 01/12/2016 (Man. Year: 2016)

Chassis No: MR053REH104551148

Colour: Silver

Odometer: 105230 km

Engine Capacity: 1598 cc

Market Value/New Car

Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/45ZR17

Rear Tyre Size: 215/45ZR17

Front Left Side: Michelin 6 mm

Rear Left Side: Michelin 6 mm

Front Right Side: Michelin 6 mm

Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,855.97	3,309.75	2,546.22	43.48
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,210.00	1,860.00	350.00	15.84
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	8,065.97	5,169.75	2,896.22	35.91
Approved Total (Overridden) (\$\$)		4,100.00		
(\$\$)	8,065.97	4,100.00	3,965.97	49.17
+ GST 7.00/7.00% (\$\$)	564.62	287.00	277.62	49.17
Nett Amount (\$\$)	8,630.59	4,387.00	4,243.59	49.17

INSPECTION

Date of Assignment: 20/10/2020

Date Inspected: 21/10/2020 Inspected At:

Progressive Car Care Pte Ltd (HQ)
Blk 3022A Ubi Road 1, #01-45/46
Singapore 408716

Estimated Period of Repair: 5.0 days

Adjuster: MARCUS CHUA

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 03 Nov 2020)
Parts:	143	TOYOTA COROLLA ALTIS 1.6 CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLJ8788M)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BOOT	Badly Dented	793.20 FL	*793.20 FL
2	1		*REAR BOOT RUBBER	Twisted	175.80 FL	*175.80 FL
3	1		*REAR BUMPER LOCK SENSOR	Not Necessary	192.20 FL	*- FL
4	1		*REAR BOOT TOP LOCK	Twisted	399.50 FL	*399.50 FL
5	1		*REAR BOOT BOTTOM LOCK	Not Necessary	65.40 FL	*- FL
6	1		*REAR BOOT TOYOTA LOGO	Necessary	61.50 FL	*61.50 FL
7	1		*REAR BOOT COROLLA WORDING	Necessary	62.40 FL	*62.40 FL
8	1		*REAR BOOT ALTIS WORDING	Necessary	59.60 FL	*59.60 FL
9	12		*REAR BOOT INSULATOR CLIP	Not Necessary	66.00 FL	*- FL
10	1		*REAR BOOT OUTER CHROME	Not Necessary	243.70 FL	*- FL
11	1		*REAR BOOT REFLECTOR-LH	Not Necessary	353.40 FL	*- FL
12	1		*REAR BOOT REFLECTOR-RH	Not Necessary	353.40 FL	*- FL
13	1		*REAR BUMPER	Distorted	556.40 FL	*556.40 FL
14	1		*SET REAR BUMPER CLIPS	Necessary	55.00 FL	*55.00 FL
15	1		*REAR BUMPER SIDE HOLDER-LH	Not Necessary	109.30 FL	*- FL
16	1		*REAR BUMPER SIDE HOLDER-RH	Bent	109.30 FL	*109.30 FL
17	1		*REAR BUMPER CENTRE RETAINER-LH	Not Necessary	70.40 FL	*- FL
18	1		*REAR BUMPER CENTRE RETAINER-RH	Bent	70.40 FL	*70.40 FL
19	1		*REAR BUMPER CENTER BRACKET-LH	Not Necessary	68.20 FL	*- FL
20	1		*REAR BUMPER CENTER BRACKET-RH	Dented	68.20 FL	*68.20 FL
21	1		*REAR BUMPER REINFORCEMENT	Distorted	399.50 FL	*399.50 FL
22	1		*SET REAR BUMPER SENSOR-LH,RH	Shorted	380.40 FL	*380.40 FL
23	1		*REAR PANEL	Badly Dented	670.00 FL	*600.10 FL
24	1		*REAR PANEL TOP GARNISH	Twisted	241.90 FL	*241.90 FL
25	1		*TAIL LAMP ASSY-LH	Not Necessary	379.80 FL	*- FL
26	1		*TAIL LAMP ASSY-RH	Cracked	379.80 FL	*379.80 FL
27	1		*REAR EXHAUST PIPE	Not Necessary	1,124.90 FL	*- FL
28	1		*REAR EXHAUST PIPE TOP PLATE	Not Necessary	105.60 FL	*- FL
29	3		*REAR EXHAUST PIPE MOUNTING	Not Necessary	146.10 FL	*- FL
30	1		*SET REAR NUMBER PLATE WITH CASING	Not Necessary	35.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	7,796.30	4,413.00
- List Item Discount on L Items 25.00/25.00% (\$)	1,940.33	1,103.25
Total Parts (\$)	5,855.97	3,309.75

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO KNOCK OUT DENTS,CUT/WELD REAR PANEL,REMOVE,REPLACE ACCIDENT PARTS	New	900.00	800.00
2	TO RESPRAY PAINT ON ACCIDENT PORTIONS	New	900.00	850.00
3	TO CHECK WIRING	New	50.00	20.00
4	TO TRANSFER REAR BUMPER SENSOR	New	100.00	50.00
5	TO TUFF-KOTE	New	60.00	60.00
6	TO REMOVE,REFIX REAR GARNISH	New	100.00	80.00
7	TO REMOVE,REPLACE REAR EXHAUST PIPE	New	100.00	0.00
Gross Labour Cost (\$\$)			2,210.00	1,860.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >