




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
VFIX AUTO SERVICE PTE LTD 26 CHIA PING ROAD SINGAPORE 619977 ON BEHALF OF LLMS LOGISTICS PTE LTD			Ref : CC4/TP19005999/Epa3q2-1 Date : 23/11/2020 Code : TP469	
				
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.		Veh. Inspected		YP 6624E
Policy No.		Coverage (\$)		0.00
Claim No.		Excess (\$)		0.00
Assign From		Assign Date		15/04/2019
2. Vehicle Particulars & Condition				
Make & Model	MERCEDES BENZ ATEGO 1524	c.c	6374	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	WDB97007820113880	Colour	WHITE	
Odometer	72883	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	275/70 R22.5	GOODYEAR	7 mm	
L/H Front Tyre	275/70 R22.5	GOODYEAR	7 mm	
R/H Rear Tyre	275/70 R22.5 (D)	GOODYEAR	7/7 mm	
L/H Rear Tyre	275/70 R22.5 (D)	GOODYEAR	7/7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	03/04/2019	Inspection Date	15/04/2019	
Survey held at	VFIX AUTO SERVICE PTE LTD 60 KAKI BUKIT AVE 6, ARK@KB, 417892 KAKI BUKIT SINGAPORE 417892			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. YP 6624E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BONNET (CONSISTENT)	BROKEN	4,225.00	4,225.00
1	FRONT BONNET HINGE LH (CONSISTENT)	NOT NECESSARY	198.00	-
1	FRONT BONNET LOGO (CONSISTENT)	NECESSARY	155.00	155.00
1	FRONT BONNET EMBLEM (ATECO) (CONSISTENT)	NECESSARY	221.00	221.00
1	FRONT BONNET LOCK (CONSISTENT)	NOT NECESSARY	355.00	-
1	PULL HANDLE LH (CONSISTENT)	NOT NECESSARY	314.00	-
1	FRONT GRILLE TOP (CONSISTENT)	BROKEN	522.00	522.00
1	FRONT GRILLE LOWER (CONSISTENT)	NOT NECESSARY	588.00	-
1	FRONT GRILLE LOGO (CONSISTENT)	BROKEN	314.00	314.00
1	FRONT GRILLE PANEL (CONSISTENT)	BROKEN	652.00	652.00
1	CORNER PANEL LH (CONSISTENT)	NOT NECESSARY	1,102.00	-
1	SIGNAL LAMP LH (CONSISTENT)	NOT NECESSARY	452.00	-
1	FRONT BUMPER CENTER (CONSISTENT)	CUT	1,851.00	1,851.00
1	FRONT BUMPER SIDE LH (CONSISTENT)	CUT	755.00	755.00
1	FRONT AIR CLEANER BOX (OUTER) (CONSISTENT) (ADDITIONAL)	BROKEN	570.00	570.00
1	FRONT AIR CLEANER BOX (INNER) (CONSISTENT) (ADDITIONAL)	BROKEN	890.00	890.00
			13,164.00	10,155.00
<u>LABOUR</u>				
TO REMOVE DAMAGED BODY PANESL WITH ALL NECESSARY COMPONENTS /ATTACHMENTS APPLY HOT-WORKS WHERE NECESSARY STRAIGHTEN FRONT PANEL REPAIR /RESHAPE DENTED PANELS IN ACCORDANCE WITH FACTORY SPECIFICATIONS ,REPLACE NEW PARTS REFIT ALIGN INTO POSITION REFIT ALL NECESSARY COMPONENTS/ATTACHMENTS.			1,600.00	600.00
TO SPRAY PAINT REPLACED/ REPAIRED BODY PANELS INCLUSIVE OF PREPARATORY WORKS AND PAINTING MATERIALS.			1,200.00	300.00
TO CONDUCT HEADLAMP ALIGNMENT.			30.00	30.00
			2,830.00	930.00



GRAND TOTAL		15,994.00	11,085.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,850.00

Report Ref No. CC4/TP19005999/Epa3q2-1

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.