

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG20011680/AVF3E2

Date: 27/04/2021

REFERENCE

Insured/Claimant: LIM WEISHENG, VINCENT (LIN WEISHENG) Policy No: 2070135123
Date of Loss: 21/10/2020 Nature of Claim: OD Claim No: 4130270803SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SBN7318R**
Make & Model: AUDI Q3, 1.4 TFSI (A) Engine No: CZDC04066
Reg. Date: 18/09/2020 (Man. Year: 2020) Chassis No: WAUZZZF32M1000646
Colour: White Odometer: 2190 km
Engine Capacity: 1395 cc
Market Value/New Car Price: S\$150,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/65 R17 Rear Tyre Size: 215/65 R17
Front Left Side: Continental 6 mm Rear Left Side: Continental 6 mm
Front Right Side: Continental 6 mm Rear Right Side: Continental 6 mm

The above values represent the remaining tyre tread depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,138.00	7,823.20	3,314.80	29.76
Miscellaneous Items	0.00	0.00	0.00	
Labour	20,162.00	11,147.00	9,015.00	44.71
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	31,300.00	18,970.20	12,329.80	39.39
- Excess (S\$)	400.00	400.00	0.00	0.00
(S\$)	30,900.00	18,570.20	12,329.80	39.90
+ GST 7.00/7.00% (S\$)	2,163.00	1,299.91	863.09	39.90
Nett Amount (S\$)	33,063.00	19,870.11	13,192.89	39.90

INSPECTION

Date of Assignment: 27/10/2020
Date Inspected: 27/10/2020 Inspected At: Premium Automobiles Pte Ltd (UBI)
55 Ubi Road 1
Singapore 408699
Estimated Period of Repair: 13.0 days

Adjuster: ADRIAN LING

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR FENDER - RH	Dented	3,431.00 FS	*2,744.80 FS
2	1		*REAR CROSS PANEL	Necessary	417.00 FS	*333.60 FS
3	1		*SIDE WINDOW - RH	Necessary	607.00 FS	*485.20 FS
4	1		*REAR BUMPER GUIDE SECTION - RH	Not Necessary	63.00 FS	*- FS
5	1		*REAR WHEEL HOUSING LINER - RH	Not Necessary	239.00 FS	*- FS
6	1		*WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	100.00 FS	*- FS
7	1		*REAR DOOR - RH	Dented	2,553.00 FS	*2,042.40 FS
8	1		*REAR OUTER DOOR SEAL	Necessary	134.00 FS	*106.80 FS
9	1		*REAR DOOR CATCH	Damaged	119.00 FS	*94.80 FS
10	1		*SILL PANEL SEAL - RH	Not Necessary	134.00 FS	*- FS
11	1		*REAR DOOR COVER - RH	Necessary	345.00 FS	*276.00 FS
12	2		*REAR WHEEL COVER - LH / RH	Necessary	1,060.00 FS	*848.00 FS
13	1		*REAR ALUMINIUM RIM - RH	Not Necessary	756.00 FS	*- FS
14	1		*1/4 GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
15	1		*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
16	1		*STONE CHIP	Necessary	180.00 FS	*180.00 FS
17	1		*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
18	1		*ACRYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
19	1		*SUNDRIES	Necessary	300.00 FS	*11.60 FS
F=Franchise part. S=SpcNett.						
					Total Parts (S\$)	11,138.00 7,823.20

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND REINSTALL REAR PARKING AID AND REAR LID KICK SENSOR. CHECK FUNCTION AND RENEW ACCORDING TO DAMAGE	New	360.00	0.00
2	TO REMOVE AND TRANSFER RHS REAR DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES	New	280.00	280.00
3	TO RENEW RHS REAR 1/4 GLASS TO FACILITATE FENDER RENEWAL	New	300.00	300.00
4	TO INSTALL SOLAR FILM FOR RHS REAR 1/4 GLASS	New	400.00	0.00
5	TO CARRY OUT WATER SEEPAGE TEST FOR RHS REAR 1/4 GLASS	New	200.00	150.00
6	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT	New	1,400.00	1,400.00
7	TO REMOVE AND REINSTALL REAR SEAT, BACK REST, HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENT TRIMS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC	New	1,400.00	1,400.00
8	TO DISMANTLE REAR BUMPER, REAR LID AND RHS REAR DOOR. TO RENEW RHS REAR DOOR. CUT OUT AND WELD RHS REAR FENDER AND REAR OUTER END PANELLING. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	9,600.00	4,250.00
9	TO RESPRAY RHS REAR FENDER, RHS REAR DOOR, DOOR COVER, BOTH REAR WHEEL ARCH TRIMS, DOOR ENTRANCES, RHS SILL PANEL, ROOF CHANNEL. DRAIN PANEL AND END PANELLING. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS	New	5,750.00	3,175.00
10	TO RENEW RHS REAR RIM AND CARRY OUT WHEEL ALIGNMENT	New	280.00	0.00
11	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
Gross Labour Cost (\$\$)			20,162.00	11,147.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >