



FALCON - AIR AUTO SERVICES PTE LTD
CO. REG. No.: 1995-01140-D

INSURER: Lonpac Insurance Bhd (HQ)

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	
Policy No:	Z/20/VC06/107022	Date of Loss:	26/10/2020
Vehicle Reg. No.:	YP1980J	Driveable?	
Driver Age/Info:	40 / MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES

Insured/Claimant: H P CONSTRUCTION & ENGINEERING PTE LTD

Driver: RAMASAMY VENKATESAN

Make/Model: MITSUBISHI CANTER, 3.0 D FEB21ER4SDEB (CBU) (M) Vehicle Reg. Date: 08/04/2016

Vehicle Colour: WHITE

Engine No: 4P10C05638

Odometer: 1 KM

Chassis No: FEB21EA20365

Paint Type:

Total Loss?

Est. Duration of Repair (day)

NO

12 Days

*Not Withheld
C11mp & 10,550h
Penalty After Paint*

Description of Accident/Loss: REFER TO POLICE REPORT.

Remarks:

VEHICLE IS IN W/SHP. PLEASE ARRANGE FOR VEHICLE SURVEY.

THANK YOU.

fax: 62564315

Present Location: FALCON-AIR AUTO SERVICES PTE LTD (SIN MING)

COST OF CLAIMS

	Amount
Parts	21,548.50
Miscellaneous Items	0.00
Labour	7,780.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (S\$)	29,328.50
+ GST 7.00% (S\$)	2,053.00
Nett Amount (S\$)	31,381.50

This claim is handled by: JOSHUA NG

Generated using Merimen e-Claims Internet Estimation & Adjusting System

R DETAILS

ence

ce: (Last Synchronised: 28 Oct 2020)

N/A MITSUBISHI CANTER 3.0 D FEB21ER4SDEB (CBU) (M) (Model not available in database)

Repairer's (Price-denominated Standard List)

le: Falcon-Air Auto Services Pte Ltd/YP1980J/28/10/2020 12:53

These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Info: Items/values not in reference catalogue are prefixed with an asterisk *.

ates on Parts

Part No.	Particulars	%Disc	%Depr	Amount	
	*Front Windscreen Glass Rubber	0.00	0.00	*250.00 F	✓
	*Front Wiper Garnish	0.00	0.00	*390.00 F	✓
	*Front Wiper Garnish Clip	0	0.00	*40.00 FS	✓
	*Front Wing Mirror Garnish	0.00	0.00	*620.00 F	✓
	*LH Front Wing Mirror (Small)	0.00	0.00	*52.00 F	✓
	*Front Panel	0.00	0.00	*1,350.00 F	✓
	*Front Panel Emblem (FUSO)	0.00	0.00	*105.00 F	✓
	*Front Panel Body Sealant	0	0.00	*80.00 FS	X
	*Radiator Grille	0.00	0.00	*750.00 F	✓
	*Radiator Grille Logo	0.00	0.00	*68.00 F	✓
	*Radiator Grille Clip	0	0.00	*40.00 FS	✓
	*Headlamp	0.00	0.00	*840.00 F	✓
	*Front Side Lamp	0.00	0.00	*400.00 F	✓
	*Front Signal Lamp	0.00	0.00	*560.00 F	✓
	*Front Bumper	0.00	0.00	*750.00 F	✓
	*Front Bumper Bracket	0.00	0.00	*330.00 F	✓
	*Front Bumper Side Garnish	0.00	0.00	*580.00 F	✓
	*Front Number Plate	0	0.00	*45.00 FS	25/2
	*Front Cabin Crossmember	0.00	0.00	*750.00 F	✓
	*Front Cabin Crossmember Bush	0.00	0.00	*360.00 F	✓
	*Dashboard	0.00	0.00	*1,900.00 F	X
	*LH Front Dashboard Lower Cover	0.00	0.00	*530.00 F	X
	*Air Con Condenser Assembly (small) w/fan	0.00	0.00	*1,050.00 F	X
	*Air Con Evaporator Unit	0.00	0.00	*2,500.00 F	✓
	*Air Con Blower Unit	0.00	0.00	*2,450.00 F	✓
	*Air Con Suction Hose	0.00	0.00	*380.00 F	✓
	*Air Con Discharge Hose	0.00	0.00	*370.00 F	✓
	*Air Con Liquid Pipe	0.00	0.00	*380.00 F	✓
	*Brake Pipe	0.00	0.00	*525.00 F	X
	*Brake Fluid	0	0.00	*80.00 FS	X
	*Horn	0.00	0.00	*250.00 F	✓

nise part. S=SpcNett.

Sub Total (\$\$) 18,775.00
 + Margin on L,N Items 15.00% (\$\$) 2,773.50

Total Parts (\$\$) 21,548.50

Falcon-Air Auto Services Pte Ltd/YP1980J/28/10/2020 12:53. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Labour Items</u>			
1	To focus headlamp	New	50.00
2	To check wiring	New	50.00
3	To remove/refix front windscreen	New	120.00
4	To remove/refix dashboard to facilitate repairs	New	480.00
5	To remove/refix air con condenser, pipe, etc, to vacuum and top up air con gas	New	150.00
6	To remove/replace evaporator and blower unit	New	400.00
7	To remove/refix inner trims, seats, garnish, etc to facilitate repairs	New	350.00
8	To replace brake pipe and to bleed air	New	300.00
9	To crane cabin to facilitate repairs and to fix back	New	800.00
10	To straighten chassis frame	New	600.00
11	To scan and clear fault code	New	280.00
12	To remove necessary parts to cut-out outer panel, repair inner panel, re-weld outer panel and replacement of parts	New	2,400.00
13	To putty and spray paint on accident d/mage area	New	1,800.00
Gross Labour Cost (S\$)			7,780.00

Falcon-Air Auto Services Pte Ltd/YP1980J/28/10/2020 12:53. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

FALCON-AIR AUTO SERVICES PTE LTD
(a subsidiary of Falcon-Air Holdings Pte Ltd)

Head Office : Blk 176 Sin Ming Drive #01-06/07/13, #05-17 Sin Ming Autocare S(575721) Tel: 6452-0880 / 6458-0880 Fax: 6454-7862
Branches : Tampines St 93 Blk 9006 #01-200 S(528840) Tel: 6789-7997 Fax: 6785-7997 • No 8 Pandan Loop S(128226) Tel: 6779-5665 Fax: 6779-1110
Website: www.falconair.com.sg Email: email@falconair.com.sg

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: