

APPRAISAL VP PTE LTD

Company Reg No. 201403586G

50 PlayFair Road #04-01 Noel Building Singapore 387995 | Tel: +65 98511914 | Email: mat@vpappraisal.com

ANNEX A

VEHICLE DAMAGE ASSESSMENT REPORT


Reference No : VPA-2020/00423
Vehicle No : SLR5195B
Workshop : Excel Motor

List of Damaged Parts

S/N	Qty	Description	Condition	Repairer's Amount (\$)	Adjuster's Amount (\$)	
1	1	Rear bumper	Dented	777.90	777.90	X
2	8	Rear bumper clips	Necessary	13.80	13.80	X
3	1	Rear bumper side retainer lh	Necessary	17.20	17.20	X
4	1	Rear bumper side retainer rh	Necessary	17.20	17.20	X
5	1	Rear bumper corner rh	Not necessary	94.10	0.00	X
6	1	Rear fender rh	Dented	460.72	460.72	X
7	1	Rear fender wheel arch	Scratches	175.50	175.50	
8	1	Rear fender wheel arch clips	Necessary	76.80	76.80	
9	1	Rear wheel bearing rh	Malfunction	320.40	320.40	X
10	1	Wheel aluminium	Scratches	721.60	721.60	
Sub Total				2,875.22	2,581.12	
Less 25%				668.81	645.28	
Total				2,006.42	1,935.84	

Special Nett Items

S/N	Qty	Description	Condition	Repairer's Amount (\$)	Adjuster's Amount (\$)	
1	1	Tyre 215/60R16	Not necessary	180.00	0.00	X
2	1 set	Reverse sensor	Malfunction	250.00	200.00	X
3	1	Windscreen sealant	Necessary	60.00	60.00	
Sub Total				490.00	260.00	
Total				490.00	260.00	
FINAL TOTAL				2,496.42	2,195.84	

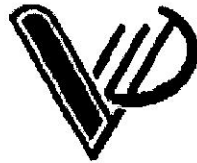

APPRAISAL VP PTE LTD

Company Reg No: 201403586G

50 PlayFair Road #04-01 Noel Building Singapore 367985 | Tel: +65 98511914 | Email: mail@vpappraisal.com

ANNEX B

VEHICLE DAMAGE ASSESSMENT REPORT

Reference No : VPA-2020/00423

Vehicle No : SLR5195B

Workshop : Excel Motor

Labour Details

S/N	Description	Repair Amount (\$)	Adjusted Amount (\$)
1	Sundries	50.00	nn 20.00
2	To spray paint on affected area	1,200.00	800.00
3	To check wiring	60.00	40.00
4	To apply undercoating for rust proofing	100.00	nn 60.00
5	To disassemble, replace and / or repair reverse sensor & testing	150.00	nn 60.00
6	To remove and refit rear windscreen	150.00	nn 120.00
7	To remove and refit undercarriage	400.00	nn 200.00
8	X4 Wheel alignment	180.00	nn 180.00
9	Cut & renew rear fender, straighten inner panel	1,200.00	800.00
Total Labour		3,490.00	2,280.00

X
500.
20.
X
X
X
X
X
X
400

ANNEX C

Repair Cost

S/N	Description	Repair Amount (\$)	Adjusted Amount (\$)
1	Total Part Cost	2,496.42	2,195.84
2	Total Repair and Labour Cost	3,490.00	2,280.00
Total Repair Cost		5,986.42	4,475.84

Adjusted Repair Cost
(Lump Sum Repair)

\$3,500.00



APPRAISAL VP PTE LTD

Company Reg No: 201403586G

50 Playfair Road #04-01 Nesi Building Singapore 367996 | Tel: +65 98611914 | Email: mail@vpappraisal.com

VEHICLE DAMAGE ASSESSMENT REPORT

Reference No : VPA-2020/00423
Vehicle No : SLR5195B

ACCIDENT BRIEF

From documents sighted, the Insured's vehicle and Third Party's vehicle were involved in a change/cross collision.

On site survey inspection revealed that the damage noted are consistent with the accident as reported.

Damage at the rear bumper, rear fender rh, rear wheel bearing rh, and etc

ADVICE

Excel motor submitted the estimate report cost of \$5,986.42, we have adjusted the repair cost to \$4,475.84. We recommend the repair cost on a Lump sum basis of \$3,600.00.

The repairs would require a period of 05 working days.

4

We are pleased to submit our inspection survey report and photographs for your kind attention.
All survey and inspection work was carried out to the best of our ability, knowledge and experience.

Jaclyn Loh
Appraiser
Appraisal VP Pte Ltd

Disclaimer:

This survey was conducted by Appraisal VP Pte Ltd without inspection fees and we do not warrant/repair. Report by Appraisal VP Pte Ltd is prepared as confidential and intended for the use of clients and appointed agent. We have inspected thoroughly each and every item on the repairer's estimate against the actual damages found on the vehicle. All findings and recommendations are made accordingly and final decision of settlement is your good advice. Any disclosure or participation of a third party shall be the responsibility of such person. No liability shall be attached to Appraisal VP Pte Ltd (if) therefore.