

# *Appraisal Services*

## **Insurance Loss Adjusters & Licensed Appraisers**

### **Insurance Claim Investigator**

Business Address: 60 Arab Street Singapore 199757

Tel: 66523352 / 98586761; Fax: 62970270

Mailing Address : 161 Alexandra Post Office Singapore 911506

Date : 14<sup>th</sup> Oct 2020

Our Ref : TP / TJCC SGS8228A/ 10.03/20

Your Ref :

Mr Lau Kay Keong  
136 Tanjong Rhu Road  
#04-07 Pebble Bay  
Singapore 436921

## **DAMAGED VEHICLE (SGS 8228 A) INSPECTION REPORT (WITHOUT PREJUDICE)**

Detailed accounts of our inspection are as follows:-

### **(A) Reference**

Name of Claimant	: Mr Lau Kay Keong	Date of Request	: 9 <sup>th</sup> Oct 2020
		Referred By	: Owner
Policy No.	: Please Advice	Date of Inspection	: 9 <sup>th</sup> Oct 2020
Claim No.	: Please Advice	Date of Re-inspection	:
Accident Date	: 3 <sup>rd</sup> Oct 2020	Sum Insured	: NA
Repairer	: M/s TJ Car Care Services	Excess Amount	: NA
	Blk 1010 Bukit Merah Lane 3	3 <sup>rd</sup> Party Vehicle	: Please Advice
	#01-115 Singapore 159724	3 <sup>rd</sup> Party Insurer	: Please Advice

### **(B) Particulars of Vehicle**

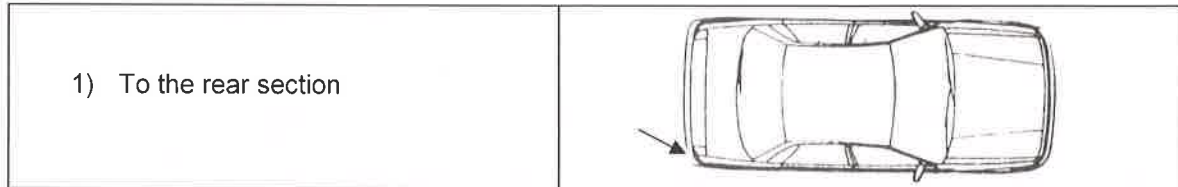
Registration No	: SGS 8228 A	Mileage	: 48672 Km
Make & Model	: MERCEDES BENZ S400	Engine No	: 27696030683360
Date of Registration	: 2 <sup>nd</sup> Oct 2014	Chassis No.	: WDD2221572A081823
Colour	: Silver	Engine Capacity	: 3,498 cc

### **(C) Pre-Accident Condition (Static Test Only)**

Steering	: Serviceable	Paint Work	: Good
Foot-brake	: Serviceable	Modification	: NIL
Hand-brake	: Serviceable	General Condition	: Good

**(D) Tyre Condition**

	Tread Depth	Make	Size
Front Left	70 %	CONTINENTAL	245/50 R18
Front Right	70 %	CONTINENTAL	245/50 R18
Rear Left	70 %	CONTINENTAL	245/50 R18
Rear Right	70 %	CONTINENTAL	245/50 R18

**(E) Point of Impact****(F) General Description of Damages**

The impact of the collision has damaged/affected the rear bumper, rear bumper sensor, tail pipe cover and etc.

Please refer to the Annex for a detailed account of the damages and photographs taken.

**(G) Recommendation**

We have inspected thoroughly the actual damages found on the vehicle, before we arrived at our recommendation as to whether the parts needed replacement or repairs.

Our adjusted cost of lump sum repair is **\$3,750.00** and an estimated **3** days is required to repair the vehicle. Please refer to the Annex for a detailed account of the cost estimates.

**(H) Remarks**

We have not authorised the repairs. However for information, under normal circumstances, the repairs should not exceed **3** days.

This inspection was conducted on a “**without prejudice**” basis.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Appraisal Report, which includes evidence photographs.

ST Appraisal Services



T T RAJAN  
MVI, ITC (Mechanical), NTC (Motor Vehicle)  
ASIET, MSAAA, Assessor/Appraiser  
AD041-2007532D

**ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS FOR VEHICLE NO: SGS 8228 A****Adjustment of Spare Parts Costs for Repairs**

Item	Qty	Vehicle parts description	Condition / Remark	Estimated by workshop	Disc. (%)	Adjusted cost
1	1	Rear bumper	cut/deformed	2150.54	10	1935.49
2	1	Rear bumper reflector	damaged	82.26	10	74.03
3	1	Rear bumper side chrome	affected	118.48	10	106.63
4	1	Rear bumper reinforcement	serviceable	1180.82	100	0.00
5	2	Rear bumper distance sensor	malfunction	357.50	10	321.75
6	2	Rear bumper distance sensor spacer	necessary	14.82	10	13.34
7	1	Rear bumper side mount	damaged	72.86	10	65.57
8	1	Tail pipe cover	damaged	790.22	10	711.20
9	1	Tail pipe cover bracket	damaged	79.82	10	71.84
10	1	Taillamp RH	serviceable	1034.20	100	0.00
<b>Total parts</b>				<b>5881.52</b>		<b>3299.85</b>

**Adjustment of Labour Costs for Repairs**

To remove and replaced damaged parts including straightening and repositioning replacement parts.	720.00	540.00
Supply paint material and to respray replaced and affected panels.	700.00	600.00
To check electrical components for proper function	80.00	50.00
Diagnostic test, to check and reset memory to specifications.	250.00	200.00
<b>Total labour</b>	<b>1750.00</b>	<b>1390.00</b>

**Adjustment Parts and Labour Costs of Repairs**

	Estimated by workshop	Adjusted cost
TOTAL PARTS COSTS	5881.52	3299.85
TOTAL LABOUR COSTS	1750.00	1390.00
TOTAL REPAIR COSTS	7631.52	4689.85

<b>ADJUSTED REPAIR COST</b>	<b>3750.00</b>
-----------------------------	----------------

















