

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/ICS20011936/AQF3E2**Date:** 17/01/2022REFERENCE

Handling Insurer:	ECICS Limited	Policy No:	MPC20P00065200
Claimant Vehicle No :	SMF5577J	Insured Vehicle No :	SKM1047K
Date of Loss:	31/10/2020	Nature of Claim:	TP
		Claim No:	DMPC2000189H

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMF5577J	Engine No:	002670
Make & Model:	PORSCHE PANAMERA G2, 3.0 PDK E6 (A)	Chassis No:	WP0ZZZ97ZHL101479
Reg. Date:	29/05/2017 (Man. Year: 2017)	Odometer:	38160 km
Colour:	White		
Engine Capacity:	2995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	315/30 R21	Rear Tyre Size:	315/30 R21
Front Left Side:	Pirelli 6 mm	Rear Left Side:	Pirelli 6 mm
Front Right Side:	Pirelli 6 mm	Rear Right Side:	Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	02/11/2020	
Date Inspected:	03/11/2020 Inspected At:	N-51 Automotive Pte Ltd (kaki Bukit Autohub) (HQ) KAKI BUKIT AUTOHUB 2 KAKI BVUKIT AVE 2 #01-18 Singapore 417921
Estimated Period of Repair:	8.0 days	

Adjuster: ADRIAN LING**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$28,000.00
-\$33,000.00

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 17 Jan 2022)

Parts: 144 PORSCHE PANAMERA G2 3.0 PDK E6 (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SMF5577J)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >