



SINCERE
APPRAISAL SERVICES PTE LTD

VEHICLE DAMAGE INSPECTION REPORT

Our Ref: 677/TP/2019

Date: 8/4/2020

REFERENCE

Date of loss: 5/12/2019
Claimant: Rigging and Marine Services Pte Ltd

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	YN2935U	Make &	Mitsubishi
Reg date:	15/3/2012	Model	FE83BE6SRDEA
Colour:	White	Engine No:	4M42A88976
Type:	Lorry	Chassis No:	FE83BEA20776
Type of Claims:	Third Party	Odometer No:	337861km
		Engine Cap.:	2977cc

CONDITION OF VEHICLE AT THE TIME OF SURVEY

(STATIC ONLY)

General Condition:	Good	Steering:	Good	Engine Modification:	Nil
Paint work:	Good	Handbrake:	Good	Pre-accident	
		Footbrake:	Good	Damage:	Nil

CONDITION OF TYRES

Front Left Size:	Continental 7.00R16 70%	Front Right Size:	Continental 7.00R16 70%
Rear Left Size:	Continental 7.00R16 70%	Rear Right Size:	Continental 7.00R16 70%

The above percentages represent the remaining life of the tyre threads.

COST OF REPAIRS

Parts	Repairer S\$	Adjuster S\$
	\$ 19,841.50	\$ 17,001.50
Labour	\$ 4,350.00	\$ 3,600.00
Calculated Cost (S\$):	\$ 24,191.50	\$ 20,601.50

Recommended Lump Sum Repair Cost (S\$): S 16,500.00

Date of Assignment: 10/12/2019
Date Inspected: 10/12/2019
Est. repair Period: 10 days


Inspected At: A-Tec Automotive Pte Ltd
8 Kaki Bukit Avenue 4
#04-20 Premier
Singapore 415875

SINCERE APPRAISAL SERVICES PTE LTD Co.Reg no: 201800639R

60 Paya Lebar Road #07-41 Paya Lebar Square Singapore 409051

Tel : 6636 4628 Fax : 6636 4638 E-mail : office@sincereappraisal.com.sg

POINT OF IMPACT

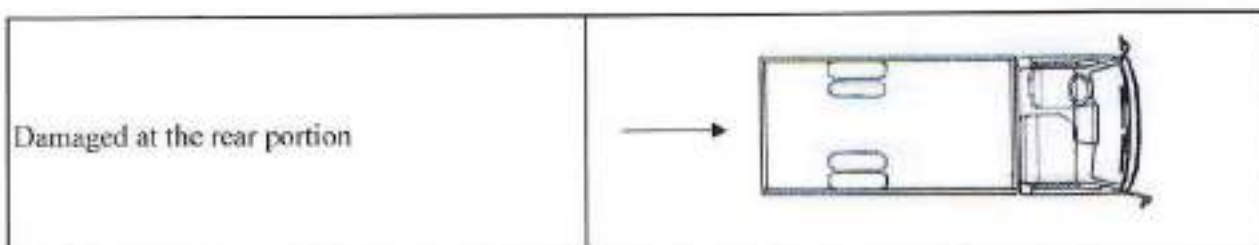

BRIEF CIRCUMSTANCES OF ACCIDENT

The Insured's vehicle collided onto the Third Party's vehicle along Tuas Road.

GENERAL DESCRIPTION OF DAMAGES

Our visual inspection of the vehicle revealed that the damages noted are at the rear portion.

SPECIAL REMARKS

We have inspected the actual damages found on the vehicle and recommend the replacement of parts and repairs accordingly. The estimated repair cost is \$24,191.50. The repairer has agreed to undertake the repairs at our adjusted lump sum amount of \$16,500.00.

We have not authorised the repair. Under normal circumstances, estimated 10 working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.



Dave Chang
Automotive Appraiser
AUTO. ENG, CAE, CGI
MIRTE, MSAAA, MTM

Automotive Appraiser: Dave Chang

Please note that this report is solely based on our findings at the time and place of inspection. This inspection has been carried out to our best knowledge and ability. Any other liability is hereby excluded.

ANNEX A

Recommended Parts

1	1	Rear left taillamp	bent/cut	\$ 778.00	\$ 778.00
2	1	Rear right taillamp	bent/cut	\$ 778.00	\$ 778.00
3	1	Rear taillamp left bracket	bent	\$ 163.00	\$ 163.00
4	1	Rear taillamp right bracket	bent	\$ 163.00	\$ 163.00
				\$ 1,882.00	\$ 1,882.00
Less 25%				\$ 470.50	\$ 470.50
				\$ 1,411.50	\$ 1,411.50
Special Nett Items					
1	1	Rear no plate lamp	cracked	\$ 80.00	\$ 80.00
2	1	Rear aluminium platform	buckled	\$ 2,500.00	\$ 1,800.00
3	1	Rear '60km/h' sticker	necessary	\$ 30.00	\$ 30.00
4	1	Rear 22pax sticker	necessary	\$ 30.00	\$ 30.00
5	1	Rear no plate	bent	\$ 80.00	\$ 80.00
6	1	Rear right chassis wooden frame assy	cracked/bent	\$ 4,000.00	\$ 3,500.00
7	1	Rear left chassis wooden frame assy	cracked/bent	\$ 4,000.00	\$ 3,500.00
8	1	Rear lower aluminium step panel	bent/necessary	\$ 1,800.00	\$ 1,600.00
9	2 set	Rear chassis frame locking bracket	necessary/bent	\$ 650.00	\$ 450.00
10	1	Rear left fender garnish	warped	\$ 480.00	\$ 400.00
11	1	Rear right fender garnish	warped	\$ 480.00	\$ 400.00
12	1	Rear lower wooden step panel	cracked	\$ 800.00	\$ 600.00
13	1	Rear tailgate assy	bent/warped	\$ 1,800.00	\$ 1,600.00
14	4	Rear tailgate assy hinges	necessary/bent	\$ 450.00	\$ 350.00
15	1	Rear left lock	bent	\$ 180.00	\$ 180.00
16	1	Rear right lock	bent	\$ 180.00	\$ 180.00
17	1	Rear cabin box inner glass	shattered	\$ 650.00	\$ 650.00
18	1	Rear cabin box inner glass moulding	necessary	\$ 180.00	\$ 120.00
19	1	Rear cabin box inner glass sealant	necessary	\$ 60.00	\$ 40.00
				\$ 18,430.00	\$ 15,590.00
Total parts				\$ 19,841.50	\$ 17,001.50

ANNEX B

Recommended Labour

1	Labour for panel beating, cut, weld, straighten rear affected area and replace rear damaged parts.	\$ 1,400.00	\$ 1,200.00
2	To putty and spray painting rear portion.	\$ 1,400.00	\$ 1,200.00
3	To check rear lighting and wiring.	\$ 50.00	\$ 30.00
4	To remove and install rear complete cabin box assy to facilitate the repair.	\$ 400.00	\$ 300.00
5	To repair, straighten and re-align rear complete cabin box assy.	\$ 600.00	\$ 450.00
6	To apply anti rust proofing to rear affected area.	\$ 150.00	\$ 120.00
7	To conduct chassis alignment.	\$ 350.00	\$ 300.00
Total labour :		\$ 4,350.00	\$ 3,600.00

ANNEX C

Adjusted Repair Cost

Total parts :	\$ 19,841.50	\$ 17,001.50
Total labour :	\$ 4,350.00	\$ 3,600.00
Total repair cost :	\$ 24,191.50	\$ 20,601.50

Adjusted Repair Cost (Lump Sum Repair)

\$ 16,500.00































