Page 1 of 3 Adjuster Report

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG20012051/GVF3E2

Date: 17/11/2020

REFERENCE

No:

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100480420 Claimant Vehicle SMR1608S Insured Vehicle No: SFB887B

Date of Loss: 03/11/2020 Nature of Claim: TP Claim No: 7983114540SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMR1608S**

Make & Model: MERCEDES-BENZ B180, 1.6 (R16 BI) (A) Engine No: 27091030395274 Reg. Date: 04/09/2014 (Man. Year: 2014) Chassis No: WDD2462422J261505

Colour: Odometer: 86520 km White

Engine Capacity: 1595 cc Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Footbrake (Serviceable): Yes

Handbrake (Serviceable): Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

205/55 R16 Front Tyre Size: 205/55 R16 Rear Tyre Size: Front Left Side: Rear Left Side: Nexen 6 mm Nexen 6 mm Rear Right Side: Front Right Side: Nexen 6 mm Nexen 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 04/11/2020

JP Conceptz Pte Ltd (HQ) Date Inspected: 05/11/2020 Inspected At:

160 Sin Ming Drive #07-07, AutoCity

Singapore 575722

Estimated Period of Repair: 4.0 days

Adjuster: XING GUO QIANG Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Adjuster Report Page 2 of 3

REPAIR DETAILS

Recommended Parts

No.	Qty Part No.	Particulars	Condition	Repairer's	Amount
1	1	*FRT BUMPER	Cut	0.00 F	*- F
2	1	*FRT BUMPER CLIPS	Necessary	0.00 F	*- F
3	1	*FRT RH FENDER	Repair	0.00 F	*- F
4	1	*FRT RH WHEEL RIM	Cut	0.00 F	*- F
F=Fra	anchise part.		Total Parts (S\$)	0.00	0.00
		Report was unsul	omitted during this print-out.		

Adjuster Report Page 3 of 3

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >