

# CHARTERED AUTO ASSESSORS

17 Joo Seng Road #08-129 Joo Seng Heights Singapore 360017 Reg No. 26910200X  
Tel: +65 9631 7008 Fax: +65 6281 9989 Email: charteredauto@gmail.com

Lim Wei Lie, Valerie  
Block 99 Commonwealth Crescent #01-58  
Singapore 140099

Your Ref : SLE 7377 Z  
Our Ref : 2006027/CA  
Date : 19 August, 2020  
Survey : Third Party

## SURVEY REPORT

### PARTICULARS OF VEHICLE

Vehicle No.	: SLE 7377 Z	Propellant	: Petrol, Auto
Make	: Honda	Capacity	: 1500 cc
Type of Body	: 4 Doors Saloon	Mileage	: 36661
Year & Model	: 2018, Civic Turbo VTIS SR	Engine No	: L15B7-3631204
Colour	: White	Chassis No	: MRHFC1660JT000035
Passenger-cap	: 4	Road Tax	: May, 2021

### TYRES CONDITIONS

Front Left	: Yokohama	Worn	: 20%	Size	: 255/30 R19
Front Right	: Yokohama	Worn	: 20%	Size	: 255/30 R19
Rear Left	: Yokohama	Worn	: 20%	Size	: 255/30 R19
Rear Right	: Yokohama	Worn	: 20%	Size	: 255/30 R19

### PRE-ACCIDENT CONDITION (Static Test Only)

Handbrake	: Serviceable	Steering	: Serviceable
Footbrake	: Serviceable	Paintwork	: Good

### QUANTUM

Repair Estimate : \$ 27,056.10  
Revised Amount : \$ 19,800.00 (Lump-sum Without Prejudice)

Under normal circumstances, the repair period would be: fifteen ( 15 ) days.  
We have not authorised repairs.

Survey Done At : Precise Auto Service  
1 Kaki Bukit Avenue 6, #02-34/36  
Autobay @ Kaki Bukit  
Singapore, 417883

Assignment Date : 26 June, 2020  
Survey Date : 26 June, 2020  
Accident Date : 23 June, 2020  
Assignment Given By : Lim Wei Lie, Valerie

Our Ref: 2006027/CA

Vehicle No. SLE 7377 Z

Description	Qty	Repair Estimate	Revised Amount	Remarks
Rear bumper fascia ( Tyre R )	1	1,987.20	1,987.20	Torn/Deformed
Rear bumper reinforcement	1	246.40	246.40	Bent
Rear bumper side retainer o/s & n/s	2	50.80	50.80	To replace
Rear bumper side attachment o/s & n/s	2	59.60	59.60	To replace
Rear bumper lower air-grille gamish -centre	1	201.40	201.40	Broken
Rear bumper lower side gamish - o/s & n/s	2	480.40	480.40	Torn/Deformed
Rear bumper lower side reflector - o/s & n/s	2	110.40	110.40	Holder broken
Rear bumper Lower diffuser - centre	1	550.40	550.40	Torn/Deformed
Rear bumper lower side diffuser - o/s & n/s	2	171.00	171.00	Holder Broken
Rear bumper PDC sensor	4	613.60	613.60	Damaged
Rear bumper PDC sensor holder	4	68.80	68.80	Damaged
Rear bumper PDC sensor wire harness	1	147.20	147.20	Socket Broken
Rear bumper clip	18	99.00	99.00	To replace
Rear bootlid assy	1	531.20	531.20	Badly Bent
Rear bootlid hinge o/s & n/s	2	97.00	97.00	Distorted
Rear bootlid rubber stopper	2	25.00	25.00	To replace
Rear bootlid upper lock	1	298.10	298.10	Bent
Rear bootlid lower lock striker	1	46.90	46.90	Bent
Rear bootlid weatherstrip	1	170.90	170.90	Torn/Deformed
Rear bootlid outer gamish	1	210.90	210.90	Broken
Rear bootlid outer gamish clip	6	33.00	33.00	To replace
Rear bootlid outer gamish CIVIC emblem	1	31.50	31.50	To replace
Rear bootlid outer garnish TYPE-R emblem	1	75.20	75.20	To replace
Rear bootlid upper spoiler clip	4	62.00	62.00	To replace
Rear bootlid outer opening switch	1	45.20	45.20	Holder Damaged
Rear bootlid insulation board	1	158.20	158.20	Torn/Deformed
Rear bootlid insulation board clip	8	44.00	44.00	To replace
Taillamp clip o/s & n/s	4	22.00	22.00	To replace
Taillamp base panel o/s & n/s	2	194.40	194.40	Distorted
Rear keyless antenna	1	168.10	168.10	Broken
Rear end panel - centre	1	398.80	398.80	Badly Bent
Rear end panel side extension - o/s & n/s	2	170.20	170.20	To replace
Rear end panel top trim	1	90.40	90.40	Torn/Deformed
Rear end panel top trim clip	4	22.00	22.00	To replace
Rear trunk panel	1	465.80	465.80	Crumpled
Rear trunk panel insulation pad	1 set	168.10	168.10	To replace
Rear trunk panel board	1	295.20	295.20	Torn/Deformed
Rear sub-frame member o/s & n/s	2	1,311.80	1,311.80	Distorted

Materials Cost :

9,922.10

9,922.10

Our Ref: 2006027/CA

Vehicle No. SLE 7377 Z

Description	Qty	Repair Estimate	Revised Amount	Remarks
Balance brought forward		9,922.10	9,922.10	
Rear fender o/s	1	759.20	759.20	Buckled
Rear fender inner trimboard o/s & n/s	2	478.80	478.80	Torn/Defromed
Rear fender inner trimboard clip o/s & n/s	16	88.00	88.00	To replace
Rear fender lower air louver o/s & n/s	2	56.80	56.80	Holder Broken
Rear windscreen glass moulding	1	92.40	92.40	To replace
Rear windscreen glass inner seal	1	48.10	48.10	To replace
Rear windscreen glass clip	14	91.00	91.00	To replace
Rear exhaust silencer n/s	1	599.60	599.60	Bent
Rear exhaust silencer with centre pipe o/s	1	744.20	744.20	Bent
Rear exhaust hook	5	132.50	132.50	To replace
Rear exhaust heat shield o/s	1	59.40	59.40	Crumpled

13,072.10

13,072.10

-

2,614.42 Less 20%

13,072.10

10,457.68

#### SPECIAL NETT

Rear bootlid LOGO emblem ( Aftermarket )	1	120.00	120.00	To replace
Rear bootlid upper spoiler	1	2,250.00	2,250.00	Broken
Rear bootlid upper spoiler lamp set	1	180.00		C/w spoiler
Rear bootlid reflector o/s & n/s ( LED )	2	1,160.00	1,160.00	Broken
Taillamp o/s & n/s ( LED )	2	1,500.00	1,500.00	Broken
Rear reverse camera set	1 set	680.00	680.00	Holder Damaged
Rear windscreen sealant	1	60.00	60.00	To replace
Rear number plate	1	45.00	45.00	Grazed
Rear number plate holder	1	29.00	29.00	Broken

Total Materials Cost :

19,096.10

16,301.68

Our Ref: 2006027/CA

Vehicle No. SLE 7377 Z

Description	Qty	Repair Estimate	Revised Amount	Remarks
Balance brought forward		19,096.10	16,301.68	
<u>Labour &amp; Miscellaneous Charges</u>				
To provide towing service using "King Dolly		120.00	110.00	
To remove/refit wire harness, all related connectors. Reconnect snapped wire harness and replace damaged socket and adapter. Check for proper function.		250.00	220.00	
To remove/refit boot garnishes, speakers, interior garnishes, carpets where necessary.		180.00	150.00	
To remove/refit roof lining. To remove/refit seats, carpets and interior garnishes to enable repairs.		250.00	220.00	
To apply underseal and rust-proofing on the affected areas.		280.00	220.00	
To remove/refit rear windscreen glass.		280.00	180.00	
To transfer trunklid mechanisms and all attachments. To install rear trunklid spoiler.		280.00	250.00	
To install reverse camera, control unit. Re-connect wires harness. Check function.		180.00	150.00	
To remove/refit offside and nearside exhaust assembly with all attachments, brackets and holders.		280.00	250.00	
To remove/refit fuel tank assembly with all attachments, pipes and hoses to facilitate the repair works.		180.00	150.00	
Page Total:		21,376.10	18,201.68	

Our Ref: 2006027/CA

Vehicle No. SLE 7377 Z

Description	Qty	Repair Estimate	Revised Amount	Remarks
Balance brought forward		21,376.10	18,201.68	
<b><u>Labour &amp; Miscellaneous Charges</u></b>				
To install rear PDC sensors and wire harness. Re-connect wires harness. Check function.		220.00	180.00	
To perform diagnostic checks on control units. Reset to factory specifications		380.00	320.00	
To set vehicle on chassis alignment bench, inclusive of all necessary preparatory works.		380.00	320.00	
To putty and spray paint rear bumper, rear end panel, rear end extension panels, rear trunk panel, rear bootlid, rear spoiler, rear bootlid outer garnish, n/s rear fender, o/s rear fender, both taillamp base panels and etcs., inclusive of preparatory works and painting materials.		2,200.00	2,000.00	
To remove all damaged parts with all necessary components/attachments. To apply hot-works where necessary, straighten chassis members, repair/reshape dented body panels, in accordance with factory specifications. Replace damaged parts, refit and align into position. Refit all necessary components/attachments.		2,500.00	2,250.00	
<b>Grand Total:</b>		<b>27,056.10</b>	<b>23,271.68</b>	

---

**Summary**

Total Material	19,096.10	16,301.68
Total Labour/Painting	7,960.00	6,970.00
Grand Total	27,056.10	23,271.68
<b>Lump-sum Amount</b>		<b><u>19,800.00</u></b>

Our Ref: 2006027/CA

Vehicle No. SLE 7377 Z

### CAUSE OF DAMAGE

The vehicle sustained severe impact to the rear.


### REMARKS

Having checked the scope of repair works we were satisfied that it was in accordance with the damage sustained. We also checked each item and have indicated its nature of damage. It was our opinion that these items were found damaged beyond repair and require replacement.

We checked the damage carefully and were of the opinion that the vehicle could be repaired.  
We would therefore recommend repairs to be carried out at: **\$ 19,800.00** on a lump-sum basis.

The survey was conducted on a without prejudice basis and we submit this report for your consideration.

CHARTERED AUTO ASSESSORS

  
\_\_\_\_\_  
Tan Chin Suan (Licensed Appraiser)  
A.M.I.M.I., T Eng (CEI) A.I.L.M. (U.K)