## CHARTERED AUTO ASSESSORS

17 Joo Seng Road #08-129 Joo Seng Heights Singapore 360017 Reg No. 26910200X Tel: +65 9631 7008 Fax: +65 6281 9989 Email: charteredauto@gmail.com

Lim Wei Lie, Valerie

Block 99 Commonwealth Cresent #01-58

Singapore 140099

Your Ref Our Ref : SLE 7377 Z

Date

: 2006027/CA : 19 August, 2020

Survey

: Third Party

## SURVEY REPORT

PARTICULARS OF VEHICLE

Vehicle No.

: SLE 7377 Z

Propellant

: Petrol, Auto

Make Type of Body : Honda

Capacity

: 1500 cc : 36661

Year & Model

: 4 Doors Saloon

Mileage

: L15B7-3631204

Year & Mode

: 2018, Civic Turbo VTIS SR

Engine No Chassis No

: MRHFC1660JT000035

Passenger-cap

: White

Road Tax

: May, 2021

TYRES CONDITIONS

.

Wom : 20%

Size : 255/30 R19

Front Left Front Right Rear Left YokohamaYokohamaYokohama

Wom : 20% Wom : 20%

Size : 255/30 R19 Size : 255/30 R19

Rear Right

: Yokohama

Wom : 20%

Size : 255/30 R19

PRE-ACCIDENT CONDITION (Static Test Only)

Handbrake Footbrake

: Serviceable : Serviceable Steering Paintwork : Serviceable : Good

QUANTUM

Repair Estimate

54

Revised Amount

: \$ 27,056.10 : \$ 19,800.00

(Lump-sum Without Prejudice)

Under normal circumstances, the repair period would be:

fifteen (15)

days.

Survey Done At

We have not authorised repairs.

: Precise Auto Service

1 Kaki Bukit Avenue 6, #02-34/36

Autobay @ Kaki Bukit Singapore, 417883

Assignment Date

: 26 June, 2020

Survey Date Accident Date : 26 June, 2020 : 23 June, 2020

Assignment Given By

: Lim Wei Lie, Valerie

		Repair	Revised	
Description	Qty	Estimate	Amount	Remarks
Rear bumper fascia ( Tyre R )	1	1,987.20	1,987.20	Torn/Deformed ✓
Rear bumper reinforcement	1	246.40	245.40	Bent ✓
Rear bumper side retainer o/s & n/s	2	50,80	50.80	To replace ✓ BR
Rear bumper side attachment o/s & n/s	2	59,60		To replace V BK
Rear bumper lower air-grille garnish -centre	1	201.40		Broken V
Rear bumper lower side garnish - o/s & n/s	2	480.40	480.40	Torn/Deformed ✓
Rear bumper lower side reflector - o/s & r/s	2	110.40	110.40	Holder broken ✓
Rear bumper Lower diffuser - centre	1	550.40	550.40	Torn/Deformed ✓
Rear bumper lower side diffuser - o/s & n/s	2	171.00	171.00	Holder Broken 🗸
Rear bumper PDC sensor	4 2	613.60		Damaged ✓
Rear bumper PDC sensor holder	4	68.80	=306-80 68.80	Damaged ✓
Rear bumper PDC sensor wire harness	1	147.20	147.20	Socket Broken X SVC
Rear bumper clip	18	99.00		To replace 30 V NEC
Rear bootlid assy	1	531.20	531,20	Badly Bent 🗸
Rear bootlid hinge o/s & n/s	2	97.00	97.00	Distorted 🗸
Rear bootlid rubber stopper	2	25.00	25.00	To replace X SVC
Rear bootlid upper lock	1	298.10	298.10	Bent 🗸
Rear bootlid lower lock striker	1	46.90	. 46.90	Bent X SVC
Rear bootlid weatherstrip	1	170.90	170.90	Torn/Deformed 🗸
Rear boottid outer garnish	1	210.90	210.90	Broken 🗸
Rear bootlid outer garnish clip	6	33.00	33.00	To replace 10 VNEC
Rear bootlid outer garnish CIVIC emblem	1	31.50	31.50	To replace ✓ NEC
Rear bootlid outer garnish TYPE-R emblem	1	75.20	75,20	To replace / NEC
Rear bootlid upper spoiler clip	4	62.00	62.00	To replace 10 VNEC
Rear bootlid outer opening switch	1	45.20	45.20	Holder Damaged 🗸
Rear bootlid insulation board	1	158.20		Torn/Deformed X SVC
Rear bootlid insulation board clip	8	44.00	44.00	To replace X SVC
Taillamp clip o/s & n/s	4	22.00	22.00	To replace X SVC
Taillamp base panel o/s & n/s	2	194.40		Distorted /
Rear keyless anntena	1	168.10	168.10	Broken 🗸
Rear end panel - centre	1	398.80	398.80	Badly Bent 🗸
Rear end panel side extension - o/s & r/s	2	170.20	170.20	To replace X SVC
Rear end panel top trim	1	90.40		T /D-(/
Rear end panel top trim clip	4	22.00		To replace 10 V
Rear trunk panel	1	465.80		Crumpled <
Rear trunk panel insulation pad	1 set	168.10	168.10	To replace V NEC
Rear trunk panel board	1	295.20	295.20	Torn/Deformed X SVC
Rear sub-frame member o/s & n/s	2	1,311.80	1,311.80	Distorted X SVC

(CONTRACTOR OF THE PERSON	
9,922.10	9,922.10

Description	Qty	Repair Estimate	Revised Amount	Remarks
Balance brought forward		9,922.10	9,922.10	
Rear fender ols	1	759.20	759.20	Buckled X Repair
Rear fender inner trimboard o/s & n/s	2	478.80		Torn/Deframed X SVC
Rear fender inner trimboard clip o/s & n/s	16	88.00		To replace X SVC
Rear fender lower air lourver o/s & n/s	2	56,80		Holder Broken X SVC
Rear windscreen glass moulding	1	92.40		To replace / NFC
Rear windscreen glass inner seal	1	48.10		To replace V NEC
Rear windscreen glass clip	14	91.00	91,00	To replace 20 V NEC
Rear exhaust silencer n/s	1	599.60		Bent X SVC
Rear exhaust silencer with centre pipe o/s	1	744.20		Bent X SVC
Rear exhaust hook	5	132.50		To replace X SVC
Rear exhaust heat shield o/s	1	59.40		Crumpled 🗸
		13,072.10	13,072.10	
		127	.2,614.42	Less 20%
		13,072.10	10,457.68	
SPECIAL NETT				
Rear bootlid LOGO emblem ( Aftermarket )	1	120.00	120.00	To replace ✓ NEC:
Rear bootlid upper spoiler	1	2,250.00	2,250.00	Broken 800 ✓
Rear bootlid upper spoiler lamp set	1	180.00		C/w spoiler
Rear bootlid reflector o/s & n/s ( LED )	2	1,160.00	1,160.00	Broken 991.60 ✓
Taillamp o/s & rt/s ( LED )	2	1,500.00	1,500.00	Broken 1450.40 ✓
Rear reverse camera set	1 set	680.00	680.00	Holder Damaged 400 ✓
Rear windscreen sealant	1	60.00	60.00	To replace X SVC
Rear number plate	1	45.00	45,00	Grazed 🗸
Rear number plate holder	1	29.00	29.00	Broken 🗸
Total Materia	als Cost :	19,096.10	16,301.68	

Our Ref: 2006027/CA

Vehicle No. SLE 7377 Z

				Edition stand
Description	Qty	Repair Estimate	Revised Amount	Remarks
Balance brought forward		19,096.10	16,301.68	
Labour & Miscellaneous Charges				
To provide towing service using "King Dolly		120.00	110.00	60
To remove/refit wire harness, all related conn Reconnect snapped wire harness and replace				
socket and adapter. Check for proper function	1.	250.00	220.00	30
To remove/refit boot garnishes, speakers, interior garnishes, carpets where necessary.		180.00	150,00	50
To remove/refit roof linning. To remove/refit so carpets and interior garnishes to enable repair		250.00	220.00	100
To apply underseal and rust-proofing on the a areas.	iffected	280.00	220.00	30
To remove/refit rear windscreen glass.		280.00	180.00	120
To transfer trunklid mechanisms and all attact To install rear trunklid spoiler.	hments.	280.00	250.00	100
To install reverse camera, control unit. Re-connect wires harness. Check function.		180.00	150.00	50
To remove/refit offside and nearside exhaust with all attachments, brackets and holders.	assembly	280.00	250.00	100
To remove/refit fuel tank assembly with all att pipes and hoses to facilitate the repair works.		180.00	150.00	80
Page Tota	l:	21,376.10	18,201.68	

Our Ref: 2006027/CA

Vehicle No. SLE 7377 Z

Description	Qty	Repair Estimate	Revised Amount	Remarks
Balance brought forward		21,376.10	18,201.68	
Labour & Miscellaneous	Charges			
To install rear PDC sensors Re-connect wires harness.		220.00	180.00	30
To perform diagnostic check Reset to factory specificatio		380.00	320.00	×
To set vehicle on chassis al of all necessary preparatory		380.00	320.00	150
To putty and spray paint rearear end extension panels, rear spoiler, rear bootlid out o/s rear fender, both taillam inclusive of preparatory wor	rear trunk panel, rear bootlid, er garnish, n/s rear fender, p base panels and etcs.,	2,200.00	2,000.00	1400
dented body panels, in acco specifications. Replace dam	o apply hot-works where ordance with factory	2,500.00	2,250.00	1200
	Grand Total:	27,056.10	23,271.68	12 repair da
	Summary			
	Total Material Total Labour/Painting	19,096.10 7,960.00	16,301.68 6,970.00	
	Grand Total	27,056.10	23,271.68	
	Lump-sum Amount		19,800.00	

Our Ref: 2006027/CA

Vehicle No. SLE 7377 Z

## CAUSE OF DAMAGE

The vehicle sustained severe impact to the rear.

## REMARKS

Having checked the scope of repair works we were satisfied that it was in accordance with the damage sustained. We also checked each item and have indicated its nature of damage. It was our opinion that these items were found damaged beyond repair and require replacement.

We checked the damage carefully and were of the opinion that the vehicle could be repaired. We would therefore recommend repairs to be carried out at: \$ 19,800.00 on a lump-sum basis.

The survey was conducted on a without prejudice basis and we submit this report for your consideration.

CHARTERED AUTO ASSESSORS

Tan Chin Suan (Licensed Appraiser)