

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CS/AIG20012432/GCF3Q2

Date: 10/03/2021

REFERENCE

Insured/Claimant: LEE JUNMING, MARTIN

Policy No: 1800113328

Date of Loss: 12/11/2020

Nature of Claim: OD

Claim No: 3604697911SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SME2403C**

Make & Model: SUBARU FORESTER, 2.0 I-L CVT AWD SR (A)

Engine No: FB20YE53786

Reg. Date: 24/09/2018 (Man. Year: 2018)

Chassis No: JF1SJ5KC5JG112768

Colour: Blue

Odometer: 43537 km

Engine Capacity: 1995 cc

Market Value/New Car Price: S\$82,000.00

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable):

Yes

Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/60R17

Rear Tyre Size:

225/60R17

Front Left Side: Yokohama 6 mm

Rear Left Side:

Yokohama 6 mm

Front Right Side: Yokohama 6 mm

Rear Right Side:

Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,928.20	7,660.28	4,267.92	35.78
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,893.00	3,072.00	1,821.00	37.22
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	16,821.20	10,732.28	6,088.92	36.20
- Excess (S\$)	400.00	400.00	0.00	0.00
(S\$)	16,421.20	10,332.28	6,088.92	37.08
+ GST 7.00/7.00% (S\$)	1,149.48	723.26	426.22	37.08
Nett Amount (S\$)	17,570.68	11,055.54	6,515.14	37.08

INSPECTION

Date of Assignment: 12/11/2020

Date Inspected: 13/11/2020 Inspected At:

Motor Image Enterprises Pte Ltd (Toa Payoh)
19 Lorong 8 Toa Payoh
Singapore 319255

Estimated Period of Repair: 10.0 days

Adjuster: XING GUO QIANG

Manager: CELINE FONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER FACE-FRONT	Deformed	594.00 F	*594.00 FL
2	1		*BACK BEAM COMPLETE-FRONT	Bent	288.00 F	*288.00 FL
3	1		*ENERGY ABSORBER-FRONT BUMPER	Bent	126.00 F	*126.00 FL
4	1		*COVER-FRONT BUMPER	Scratched	5.40 F	*5.40 FL
5	1		*PACKING-BUMPER,RIGHT	Necessary	9.00 F	*9.00 FL
6	1		*PACKING-BUMPER,LEFT	Necessary	9.00 F	*9.00 FL
7	1		*BRACKET-FRONT BUMPER CORNER,RIGHT	Deformed	36.00 F	*36.00 FL
8	1		*BRACKET-FRONT BUMPER CORNER,LEFT	Deformed	36.00 F	*36.00 FL
9	1		*BRACKET-FRONT BUMPER SIDE,RIGHT	Not Necessary	12.60 F	*- FL
10	1		*BRACKET-FRONT BUMPER SIDE,LEFT	Not Necessary	12.60 F	*- FL
11	1		*FRH FOG LAMP COVER	Not Necessary	43.20 F	*- FL
12	1		*FLH FOG LAMP COVER	Not Necessary	43.20 F	*- FL
13	1		*PANEL COMPLETE-RADIATOR	Buckled	360.00 F	*360.00 FL
14	1		*FRH BUMPER SD COVER	Not Necessary	12.60 F	*- FL
15	1		*FLH BUMPER SD COVER	Not Necessary	12.60 F	*- FL
16	1		*FRT BUMPER UNDER SPOILER	Cut	1,398.00 F	*1,398.00 FL
17	1		*FRONT GRILLE ASSEMBLY-LOWER	Cracked	316.80 F	*316.80 FL
18	1		*FRONT GRILLE ASSEMBLY-CENTER	Cracked	180.00 F	*180.00 FL
19	1		*FRONT GRILLE ASSEMBLY-UPPER	Cracked	150.90 F	*150.90 FL
20	1		*BRACKET-GRILL LOWER	Deformed	21.60 F	*21.60 FL
21	1		*LAMP ASSEMBLY-HEAD RIGHT	Cracked	2,380.00 F	*2,380.00 FL
22	1		*LAMP ASSEMBLY-HEAD LEFT	Cracked	2,380.00 F	*2,380.00 FL
23	2		*FOG LIGHT ASSEMBLY-FRONT	Not Necessary	544.00 F	*- FL
24	1		*HOOD COMPLETE-FRONT	Buckled	882.00 F	*882.00 FL
25	1		*LOCK ASSEMBLY-FRONT HOOD	Bent	72.00 F	*72.00 FL
26	1		*STRIKER-FRONT HOOD	Bent	36.00 F	*36.00 FL
27	1		*HINGE COMPLETE-FRONT HOOD,RIGHT	Bent	43.20 F	*43.20 FL
28	1		*HINGE COMPLETE-FRONT HOOD,LEFT	Bent	43.20 F	*43.20 FL
29	1		*COVER-FRONT FENDER,RIGHT	Not Necessary	18.00 F	*- FL
30	1		*COVER-FRONT FENDER,LEFT	Not Necessary	18.00 F	*- FL
31	1		*INSULATOR-FRONT HOOD	Crumpled	79.20 F	*79.20 FL
32	1		*FENDER COMPLETE-FRONT,RIGHT	Buckled	270.00 F	*270.00 FL
33	1		*FENDER COMPLETE-FRONT,LEFT	Buckled	270.00 F	*270.00 FL
34	1		*MUD GUARD FRONT RIGHT	Not Necessary	108.00 F	*- FL
35	1		*MUD GUARD FRONT LEFT	Not Necessary	108.00 F	*- FL
36	1		*SUNDRIES	Necessary	100.00 FS	*20.00 FS
37	1		*FRONT NO PLATE	Cut	45.00 FS	*45.00 FS
38	1		*PACKING RAD LHS	Deformed	18.00 F	*18.00 FL
39	1		*BRACKET GRILLE UPR	Deformed	10.80 F	*10.80 FL
40	1		*PACKING RADIATOR RHS	Deformed	18.00 F	*18.00 FL
41	1		*CONDENSER ASSY	Cut	579.30 F	*579.30 FL
42	1		*SEAL O RING	Necessary	3.60 F	*3.60 FL
43	1		*SEAL O RING	Necessary	3.60 F	*3.60 FL
44	1		*BRACKET RADIATOR UPPER	Bent	14.40 F	*14.40 FL
45	1		*RESERVE TANK ASSEMBLY-RADIATOR	Deformed	61.20 F	*61.20 FL
46	1		*COWL PANEL SIDE-LEFT	Broken	7.20 F	*7.20 FL
47	1		* RADIATOR LOWER PANEL	Bent	112.00 F	*112.00 FL
48	1		*HOSE RADIATOR INLET	Cut	36.00 F	*36.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	11,928.20	10,915.40
- List Item Discount on L Items 0.00/30.00% (\$)	0.00	3,255.12
Total Parts (\$)	11,928.20	7,660.28

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	*OD/TP Case (Insurer)	-	0.00
Sub Total (\$\$)			0.00	0.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REPAIR/REPLACE FRT BUMPER,FRT BONNET,FRT SUPPORT PANEL,RIGHT FENDER,LEFT FENDER,LEFT DOOR & RIGHT DOOR	New	2,250.00	1,000.00
2	RESPRAY FRT BUMPER,FRT BONNET,FRT SUPPORT PANEL,RIGHT FENDER,LEFT FENDER,LEFT DOOR & RIGHT DOOR	New	1,600.00	1,200.00
3	REMOVE & REFIX AIR CON CONDENSOR & RADIATOR TO FACILITATE REPAIRS	New	171.00	171.00
4	MECHANICAL REPAIRS-ALTERNATOR,COMPRESSOR,STEERING PUMP	New	171.00	0.00
5	REMOVE & REFIX WIRE HARNESS	New	228.00	228.00
6	FAULT DIAGNOSTIC AND RESET SYSTEMS	New	235.00	235.00
7	COOLING SYSTEM PRESSURE TEST	New	85.00	85.00
8	TO CONDUCT FRONT LIGHTING TEST	New	28.00	28.00
9	REMOVE/REFIX FRT HEADLAMP WASHER & PIPING	New	125.00	125.00
Gross Labour Cost (\$\$)			4,893.00	3,072.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >