

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CS/AIG20012595/NVF3E2

Date: 12/04/2021

REFERENCE

Insured/Claimant:	JAGAN S/O PONUSAMY	Policy No:	1900082981		
Date of Loss:	06/11/2020	Nature of Claim:	OD	Claim No:	3832325108SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBK5719X		
Make & Model:	HONDA CB400, 399cc Super Four	Engine No:	NC42E1202752
Reg. Date:	30/10/2015 (Man. Year: 2014)	Chassis No:	NC421602752
Colour:	Blue	Odometer:	113805 km
Engine Capacity:	399 cc		
Market Value/New Car Price:	S\$14,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	120/60 R17	Rear Tyre Size:	160/60 R17
Front Left Side:	Timsun 4 mm	Rear Left Side:	Timsun 4 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,561.90	8,752.10	2,809.80	24.30
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,100.00	950.00	1,150.00	54.76
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	13,661.90	9,702.10	3,959.80	28.98
Approved Total (Overridden) (S\$)		7,750.00		
- Excess (S\$)	500.00	500.00	0.00	0.00
(S\$)	13,161.90	7,250.00	5,911.90	44.92
+ GST 7.00/7.00% (S\$)	921.33	507.50	413.83	44.92
Nett Amount (S\$)	14,083.23	7,757.50	6,325.73	44.92

INSPECTION

Date of Assignment:	16/11/2020		
Date Inspected:	04/02/2021	Inspected At:	Bike Production (HQ) No 610 Serangoon Road Singapore 218216
Estimated Period of Repair:	3.0 days		

Adjuster: Muhammad Nazril Bin Abdullah

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT FENDER	Cracked	195.00 FL	*195.00 FL
2	1		*BRACKET COMP FRONT FENDER	O/S Bent / N/S Serviceable	118.00 FL	*59.00 FL
3	1		*FRONT WHEEL AXLE	Bent	115.00 FL	*115.00 FL
4	1		*FRONT LEFT FORK ASSY	Scratched	1,088.00 FL	*900.00 FL
5	1		*FRONT RIGHT FORK ASSY	Scratched	1,088.00 FL	*900.00 FL
6	1		*FRONT LEFT BRAKE DISK	Serviceable	350.00 FL	*- FL
7	1		*FRONT RIGHT BRAKE DISK	Serviceable	350.00 FL	*- FL
8	1		*FRONT FORK STEERING HEAD CROWN	Serviceable	428.00 FL	*- FL
9	1		*FRONT FORK STEERING STEM	Bent	450.00 FL	*350.00 FL
10	2		*STEERING STEM BEARING	Necessary	90.00 FL	*90.00 FL
11	1		*HEADLAMP ASSEMBLY	Scratched	325.00 FL	*325.00 FL
12	1		*HEADLAMP BRACKET	Bent	225.00 FL	*225.00 FL
13	1		*HEADLAMP LEFT HOLDER	Serviceable	85.00 FL	*- FL
14	1		*HEADLAMP RIGHT HOLDER	Serviceable	85.00 FL	*- FL
15	1		*STEERING HANDLE	Bent	180.00 FL	*180.00 FL
16	1		*HEAD FAIRING	Cracked	155.00 FL	*155.00 FL
17	1		*METER ASSY	Cracked	1,199.00 FL	*900.00 FL
18	1		*BRAKE LEVER	Scratched	95.00 FL	*95.00 FL
19	1		*RIGHT VIEW MIRROR	Scratched	140.00 FL	*140.00 FL
20	1		*RIGHT BALANCER	Scratched	45.00 FL	*45.00 FL
21	1		*FRONT RIGHT SIGNAL	Scratched	125.00 FL	*125.00 FL
22	1		*BRAKE PEDAL	Serviceable	115.00 FL	*- FL
23	1		*RIGHT REAR SIGNAL	Broken	125.00 FL	*125.00 FL
24	1		*FRONT RIGHT FOOTREST	Scratched	85.00 FL	*85.00 FL
25	4		*EXHAUST SLIDER	Broken	85.00 FL	*85.00 FL
26	1		*EXHAUST ASSEMBLY	Dented	1,880.00 FL	*1,600.00 FL
27	1		*FRONT SPORT RIM	Grazed	800.00 FS	*600.00 FS
28	1		*BOX RACK	Serviceable	195.00 FS	*- FS
29	1		*TOP CASE	Broken	480.00 FS	*380.00 FS
30	1		*IU	Scratched	157.00 FS	*157.00 FS
31	1		*FRONT NUMBER PLATE	Missing	20.00 FS	*20.00 FS
32	1		*SET CRASH BAR	Deformed	280.00 FL	*280.00 FL
33	1		*FRONT LEFT SIGNAL	Deformed	125.00 FL	*125.00 FL
			(Supplementary)			
34	1		*METER BRACKET	Bent	175.00 FL	*175.00 FL
			(Supplementary)			
35	1		*RIGHT SWITCH ASSY	Deformed	215.00 FL	*215.00 FL
			(Supplementary)			
36	1		*RIGHT ENGINE COVER	Grazed	395.00 FL	*350.00 FL
			(Supplementary)			
37	1		*RIGHT ENGINE COVER GASKET	Necessary	65.00 FL	*65.00 FL
			(Supplementary)			
38	1		*REAR RIGHT TAIL COVER	Scratched	295.00 FL	*295.00 FL
			(Supplementary)			
39	1		*REAR RIGHT FOOTREST	Scratched	95.00 FL	*95.00 FL
			(Supplementary)			
40	1		*SET THROTTLE CABLE	Scratched	145.00 FL	*145.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	12,663.00	9,596.00
- List Item Discount on L Items 10.00/10.00% (S\$)	1,101.10	843.90
Total Parts (S\$)	11,561.90	8,752.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TOWING CHARGES	New	100.00	0.00
2	REPLACE, REALIGN AND ADJUST ABOVE DAMAGED PARTS, CHECK WIRING AND LIGHTING SYSTEM	New	700.00	450.00
3	TO REPLACE AND BALANCE FRONT AND REAR WHEEL RIM	New	150.00	70.00
4	TO KNOCK, STRAIGHTEN CHASSIS & BODY REPAIR	New	450.00	0.00
5	SPRAY PAINTING	New	300.00	150.00
6	RESET METER	New	120.00	50.00
7	TO REMOVE / REFIT, REPLACE (IF DAMAGE) CHECK AND STRAIGHTEN FRONT FORK TUBES	New	180.00	180.00
8	LABOUR FOR DISMANTLE AND FIXING OF SUPPL ITEMS (Supplementary)	New	100.00	50.00
Gross Labour Cost (\$\$)			2,100.00	950.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >