

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)
 51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
 Singapore 408933
 Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/AIG20012608/R1GS3Q2
Date: 30/03/2021

REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1800132171-01
Claimant Vehicle No :	SGD83G	Insured Vehicle No :	SGT918P
Date of Loss:	14/11/2020	Nature of Claim:	TP
		Claim No:	5406228044SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SGD83G		
Make & Model:	BMW 640I, 3.0 GRAN COUPE 4DR SR LED DSC NAV HUD (A)	Engine No:	02908557N55B30A
Reg. Date:	17/10/2014 (Man. Year: 2014)	Chassis No:	WBA6A02010DZ11822
Colour:	Black	Odometer:	83037 km
Engine Capacity:	2979 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	275/35Z R19	Rear Tyre Size:	275/35Z R19
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	9,248.10	6,757.75	2,490.35	26.93
Miscellaneous Items	0.00	0.00	0.00	
Labour	8,082.00	5,327.00	2,755.00	34.09
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	17,330.10	12,084.75	5,245.35	30.27
+ GST 7.00/7.00% (S\$)	1,213.11	845.93	367.18	30.27
Nett Amount (S\$)	18,543.21	12,930.68	5,612.53	30.27
+ Car Rental (4.0 x S\$150.00/day + 7.00% GST) (S\$)		642.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		13,574.68		

INSPECTION

Date of Assignment:	24/11/2020		
Date Inspected:	24/11/2020 Inspected At:	Performance Motors Limited (Alexandra) 303 Alexandra Road, Sime Darby Performance Centre Singapore 159941	
Estimated Period of Repair:	6.0 days		

Adjuster: MOHD RASUL

Manager: Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SUNDRIES	Necessary	150.00 FS	*150.00 FS
2	1		*BONNET	Bent	2,844.20 FS	*2,844.20 FS
3	1		*SET OF MOUNT	Serviceable	33.55 FS	*- FS
4	1		*FRT BUMPER SPOILER	Serviceable	87.90 FS	*- FS
5	1		*FRT BUMPER TRIM PRIMED (PDC)	Deformed	1,565.90 FS	*1,565.90 FS
6	1		*FRT LH GRILLE	Scratched	166.10 FS	*166.10 FS
7	1		*FRT RH GRILLE	Scratched	166.10 FS	*166.10 FS
8	1		*BMW EMBLEM	Necessary	71.60 FS	*71.60 FS
9	1		*LH SUPPORT	Serviceable	30.80 FS	*- FS
10	1		*RH SUPPORT	Serviceable	30.80 FS	*- FS
11	1		*FRT AIR DUCT	Cracked	350.45 FS	*350.45 FS
12	1		*JOINT UPPER FRONT	Serviceable	175.75 FS	*- FS
13	1		*SEAL ENGINE BONNET FRT	Necessary	33.20 FS	*33.20 FS
14	1		*SUPPORT SEAL REAR LH	Serviceable	255.10 FS	*- FS
15	1		*SUPPORT SEAL REAR RH	Deformed	255.10 FS	*255.10 FS
16	1		*LED LIGHT MODULE	Serviceable	983.30 FS	*- FS
17	1		*HEADLIGHT CONTROL MODULE LED	Serviceable	840.10 FS	*- FS
18	1		*(DG/SL) ADHESIVE SET K6	Not Necessary	53.05 FS	*- FS
19	2		*BLIND RIVET	Necessary	2.70 FS	*2.70 FS
20	1		*GRILLE AIR INTAKE CENTER	Cracked	118.80 FS	*118.80 FS
21	1		*CONDENSER AIR CONDITIONING	Bent	1,033.60 FS	*1,033.60 FS

F=Franchise part. S=SpcNett.

Total Parts (S\$)	9,248.10	6,757.75
--------------------------	-----------------	-----------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REPLACE AIR CON CONDENSOR AND CARRY OUT REPAIR JOB INCLUDING TO VACUUM SYSTEM ,TOP UP GAS AND CHECK FOR LEAK	New	850.00	850.00
2	TO REPLACE FRONT BUMPER ,FRONT CENTER AIR DUCT AND BONNET INCLUDING TO KNOCK OUT DENTED AREA A CAUSED BY THE ACCIDENT	New	2,975.00	2,125.00
3	TO RESPRAY FRONT BUMPER AND BONNET	New	2,336.00	2,102.00
4	TO CARRY OUT BODY CAVITYPRESER VATION (PER PANEL)	New	118.00	100.00
5	TO REMOVE AND INSTALL LEFT HEADLIGHT IN ORDER TO CHECK DIP BEAM FAILURE	New	481.00	0.00
6	TO CHECK ELECTRICAL WIRING SYSTEM AT THE FRONT SECTION FOR PROPER FUNCTION INCLUDING ADJUST TMENT OF HEADLIGHTS	New	177.00	150.00
7	CUSTOMER COMMENT ,RECEIVED FEEDBACK FROM CUST TODAY 18/11 AT ABOUT 08.14 HRS THAT THE RIGHT HEADLIGHT HAS FLICKERED ON AND OFF OVER THE PAST 2 DAYS AND BRAKES ARE TAKING LONGER TIME TO REACT -TO CHECK AND DIGNOSE RIGHT HEADLIGHT HAS FLICKER & BRAKES ARE TAKING LONGER TIME TO REACT	New	850.00	0.00
8	CUSTOMER COMMENT :OWNER CALL IN 19/11 AT ABOUT 13.52 HRS THAT THE CENTRAL LOCKING FAULT UNABLE TO LOCK AND UNLOCK TO CHECK AND DIANOSE CENTRAL LOCKING FAULTY (UNABLE TO LOCK AND UNLOCK)	New	295.00	0.00
Gross Labour Cost (\$\$)			8,082.00	5,327.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >