



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLJ 9580M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR BUMPER	TORN	865.80	865.80
8	REAR BUMPER CLIP	NECESSARY	30.00	30.00
1	REAR RH SIDE BUMPER	TO REPAIR SEE LABOUR	195.00	-
4	REAR RH SIDE BUMPER CLIP	NOT NECESSARY	10.00	-
1	REAR RH FENDER	TO REPAIR SEE LABOUR	931.40	-
1	REAR RH FENDER ARC GARNISH	CUT	198.20	198.20
11	REAR RH FENDER ARC GARNISH CLIP	NECESSARY	20.00	20.00
1	REAR RH DOOR	DENTED	995.30	995.30
2	REAR RH DOOR RUBBER	NOT NECESSARY	187.60	-
1	REAR RH DOOR LOCK	NOT NECESSARY	296.50	-
1	REAR RH DOOR POWER WINDOW GEAR & MOTOR	DAMAGED	358.40	358.40
1	RH SIDE SKIRT	CUT	466.80	466.80
13	RH SIDE SKIRT CLIP	NECESSARY	30.00	30.00
1	REAR R/H TYRE	NOT NECESSARY	350.00	-
1	REAR R/H FENDER INNER SHIELD	DEFORMED	252.10	252.10
1	REAR AXLE	NOT NECESSARY	1,583.60	-
1	REAR R/H SHOCK ABSORBER	NOT NECESSARY	385.00	-
1	REAR R/H WHEEL HUP & BEARING	NOT NECESSARY	378.60	-
1	CENTRE R/H DOOR PILLAR	NOT NECESSARY	845.90	-
	LESS 20% DISCOUNT		-	-643.32
			8,380.20	2,573.28
<b><u>SPECIAL NETT ITEMS</u></b>				
1	REAR R/H SPORT RIM (SN)	CUT	600.00	480.00
			600.00	480.00
<b><u>LABOUR</u></b>				
	TO CHECK WIRING.		50.00	30.00
	TO SPRAY PAINTING.		1,200.00	600.00
	TO REMOVE & REFIX REAR UNDERCARRIAGE.	NOT NECESSARY	250.00	-
	TO REMOVE & REFIX INTERIOR UPHOSLY & CUSHION.		150.00	50.00

Report Ref No. CS/AGI20012631/Atf3n2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO MEASURE,DRILL THE REPLACED REAR BUMPER,POSITION & REINSTALL REVERSE SENSOR,CONTROL UNIT & TEST FOR FUNCTIONING. TO CONDUCT COMPUTER WHEEL ALIGNMENT. LABOUR CHARGE FOR PANEL BEATING,REMOVING ALL DAMAGE PARTS & REPLACING OF THE NEW PARTS ETC.INCLUSIVE OF THE REPAIR OF REAR RH SIDE BUMPER AND REAR RH FENDER.		80.00 90.00 900.00  2,720.00	50.00 80.00 650.00  1,460.00
<b>GRAND TOTAL</b>			<b>11,700.20</b>	<b>4,513.28</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>3,600.00</b>

Report Ref No. CS/AGI20012631/Atf3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.