No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 417800 Hotline: **6385 1171**

Approved Training Organisation (ATO) of Workforce Singapore

Our reference:

19-10-8596

Date:

5/11/2019

INVOICE NO.

8596

Hui Wang Enterprise Pte Ltd

c/o Hui Wang Enterprise Pte Ltd Blk 5 Defu Lane 10 #01-576 Singapore 539186

Registration No.

GBG7126P

We enclose our fee note for your kind attention, which remains payable irrespective of the outcome of this case.

S/No.	Description of Services Provided	Qty	Amount
1	Being vehicle damage assessment report, inspection, photographs, transport and miscellaneous.	1	\$ 527.00
		Total amount	\$ 527.00

Please kindly cross all cheques made payable to "Impact Analysis Consultant".

We thank you in anticipation for your prompt payment.

0

L. L. Tan (Ms)
Principal Consultant



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

Our reference:

19-10-8596

Date:

5/11/2019

c/o Hui Wang Enterprise Pte Ltd Blk 5 Defu Lane 10 #01-576 Singapore 539186

Dear Sirs

RE:

Road Traffic Accident on 11/10/2019

Hui Wang Enterprise Pte Ltd

In accordance with your instructions received in this office on

14/10/2019

, we made arrangements to

examine the vehicle on

14/10/2019

at above-mentioned address. The following data was

recorded:

Vehicle details

Make	Toyota	Registration	GBG7126P
Model	Hiace	Chassis	JTFHT02P500234551
Colour	Silver	Gearbox	Manual
Odometer	88346km	Paintwork	Good
Steering	In order	Brakes	In order
Condition	Good		

Tyre Depths

Front left	195R15C	90% Delium
Front right	195R15C	90% Delium
Rear left	195R15C	85% Bearway
Rear right	195R15C	85% Bearway

Status	REPAIRABLE Medium		
Magnitude			
Legal status	Unroadworthy		

Impact Direction & Area of Damage:



Following our examination of the accident damage, we have calculated repair times and method, which are detailed on page 2 & 3. We would recommend a sum of \$4,700.00 and 7 working days for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and physically reliable proposition.

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd Impact Analysis Academy Pte Ltd IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd
 Infoknights International Services (Philippines)
 IABN Pte Ltd
 www.iaconsultingsg.com

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: **6385 1171**

Our reference

19-10-8596

Date

5/11/2019

Page

2

Section A: Damaged Parts Assessment

Section A	: Damaged	Parts Assessmen	nt	
Part's Description	Qty	Condition As inspected	Repairer's Estimate	Our Adjustment
<u>List Items:</u>				
Tail gate	1	bent	2154.00	2154.00
Tail gate inner trim	1	intact	325.80	0.00
Tail gate inner lock	1	damaged	341.20	341.20
Tail gate outer garnish	1	intact	185.90	0.00
Tail gate logo	1	necessary	63.70	63.70
Tail gate weatherstrip	1	ripped	215.80	215.80
Tail gate emblem 'HIACE'	1	necessary	48.90	48.90
Rear bumper	1	deformed	498.50	498.50
Rear bumper side retainer @\$65.20	2	Ih necessary rh reuse	130.40	65.20
Rear tail lamp lh	1	damaged	265.50	265.50
Rear tail lamp lower garnish @\$115.80	1	Ih bent	115.80	115.80
Rear tail lamp lower garnish bracket lh	1	bent	41.90	41.90
Rear end panel outer	1	repair	750.60	0.00
Rear end panel inner	1	repair	445.80	0.00
Rear spare tyre bracket	1	distorted	398.50	398.50
	Sub- Tot	al cost	5982.30	4209.00
Percel	ntage discount	: 25%	1495.58	1052.25
	Sub-Total cos	ts for parts =	4486.73	3156.75
Special Nett Items:				
Rear bumper clips	1 set	necessary	40.00	40.00
Tail gate sticker 8 pax	1	necessary	20.00	20.00
Tail gate sticker 70km/h	1	necessary	20.00	20.00
Tail gate windscreen sealant	1	necessary	50.00	50.00
Reverse sensor	1	malfunction	250.00	250.00
	Sub-Total cos	ts for parts	380.00	380.00

Subsidiaries of Impact Analysis Consultant:

Impact Analysis Consulting Pte Ltd
 Impact Analysis Academy Pte Ltd
 IA Racking Solutions Pte Ltd

 [■] IA Accounting & Consultancy Pte Ltd
 ■ Infoknights International Services (Philippines)
 ■ IABN Pte Ltd
 www.iaconsultingsg.com



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

0.00

0.00

Our reference

19-10-8596

Date

5/11/2019

Parts Repair

0.00 Sub- Total costs 0.00 Total costs for parts 4866.73 3536.75

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: **6385 1171**

Our reference

19-10-8596

Date

5/11/2019

Page

3

Section B: Labour Cost Calculation

To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.		ırly rate	Manhr. Req.	Total
		45.00	22	\$ 990.00
Putty & Spray painting to adjacent panels. Job allowance. Paint / material.		Sub-contract work.		\$ 600.00
Apply rust proofing on the adjacent panels.		Sub-contract work.		\$ 40.00
Wiring and bulb checking	\$	45.00	0.5	\$ 22.50
Remove and refix tailgate rear windscreen glass. (2-man job)	\$	45.00	3	\$ 135.00
Remove and replace rear bumper reverse sensor & conduct distance safety setting.	\$	45.00	1.7	\$ 76.50
Transfer of existing tailgate mechanism to new tailgate	\$	45.00	1.8	\$ 81.00
		Total la	bour cost	\$ 1,945.00

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.

 [●] Impact Analysis Consulting Pte Ltd
 ● Impact Analysis Academy Pte Ltd
 ● IA Racking Solutions Pte Ltd

 [■] IA Accounting & Consultancy Pte Ltd
 ■ Infoknights International Services (Philippines)
 ■ IABN Pte Ltd www.iaconsultingsg.com

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: **6385 1171**

Our reference 19-10-8596

Date 5/11/2019

Section C: Summary Table of Total Repair Cost

Descriptio	n	Cost	
Damaged Parts Assessment (See section A)		\$3,536.75	
Further discount 2	20%	\$707.35	
Recommended parts	cost of	\$2,829.40	(1)
Labour Cost Cald (See section		\$1,945.00	(2)
Total Repair (Round off to hu		\$4,700.00	(1) + (2)

We would recommend a sum of	\$4,700.00	and	7	working days for repair.
No further items will be approved w	ithout our expresse	ed written agreen	nent. Any signi	ificant additional
items will be subject to a supplemen	ntary report.			

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)

B.Eng. (Hons, NUS)

Diploma.Mechanical Engineering

NTC-2 Automovite Technology

Sr.MIES, Institution of Engineers, Singapore (#20100091)

MATAI, Maryland Association of Traffic Accident Investigators

IAARS, International Association of Accident Reconstruction Specialists

PMC of Singapore Business Advisors & Consultants Council

- Impact Analysis Consulting Pte Ltd
 Impact Analysis Academy Pte Ltd
 IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd
 Infoknights International Services (Philippines)
 IABN Pte Ltd
 www.iaconsultingsg.com



































































