



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2103221

36 ROBINSON ROAD  
#16-01 CITY HOUSE  
SINGAPORE 068877

INV Date 10/05/2021  
Reference CC4/FCI20012872/Kea3q2  
Code FCI2

### PROFESSIONAL SERVICE FEE

Vehicle No. SLP 6695D  
Insured Veh. SH 8738K  
Claim No. D20004759MFSH  
Policy No. D-20094922MFSH  
Accident Date 19/11/2020  
Inspection Date 23/11/2020

Description	Total
Third Party Express Settlement	350.00
<b>Subtotal</b>	<b>350.00</b>
<b>GST (7%)</b>	<b>24.50</b>
<b>Grand Total</b>	<b>374.50</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20012872/Kea3q2	
			Date: 10/05/2021	
			Code: FCI2	
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>				
Insured Veh.	SH 8738K	Veh. Inspected	SLP 6695D	
Policy No.	D-20094922MFSH	Coverage (\$)	0.00	
Claim No.	D20004759MFSH	Excess (\$)	0.00	
Assign From	VIC	Assign Date	23/11/2020	
<b>2. Vehicle Particulars &amp; Condition</b>				
Make & Model	TOYOTA AQUA (A)	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	NHP106599599	Colour	WHITE	
Odometer	194528 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre	195/55 R15	SUNWIDE	8 mm	
L/H Front Tyre	195/55 R15	SUNWIDE	8 mm	
R/H Rear Tyre	195/55 R15	SUNWIDE	3 mm	
L/H Rear Tyre	195/55 R15	SUNWIDE	3 mm	
<b>4. Description of Damages</b>				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION.  DAMAGES SEE DETAILS.				
<b>5. General Information</b>				
Accident Date	19/11/2020	Inspection Date	23/11/2020	
Survey held at	OPTIMA WERKZ PTE LTD 9A SERANGOON NORTH AVE 5 SINGAPORE 554500			
<b>5a. Remarks</b>				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
<b>5b. Estimate Days of Repair</b>				
ESTIMATED NORMAL PERIOD FOR REPAIR:			<b>5 Working Days</b>	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLP 6695D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT BUMPER	BUCKLED	936.50	936.50
1	FRONT BUMPER SIDE BRACKET LH	SERVICEABLE	57.60	-
1	FRONT BUMPER SIDE BRACKET RH	DISTORTED	57.60	57.60
1	FRONT BUMPER TOWING COVER	SERVICEABLE	35.80	-
1	FRONT BUMPER ABSORBER FOAM	CRACKED	105.30	105.30
1	FRONT BUMPER REINFORCEMENT	TO REPAIR SEE LABOUR	795.20	-
1	FRONT BUMPER GRILLE GARNISH COVER	SERVICEABLE	243.50	-
1	FRONT BUMPER EMBLEM	NECESSARY	56.80	56.80
1	REAR TAILGATE	BENT	1,131.90	1,131.90
1	REAR TAILGATE 'AQUA' EMBLEM	NECESSARY	78.20	78.20
1	REAR TAILGATE 'HYBRID' EMBLEM	NECESSARY	76.50	76.50
1	REAR TAILGATE LOGO EMBLEM	NECESSARY	68.80	68.80
1	REAR TAILGATE INNER LOCK	TO REPAIR SEE LABOUR	467.10	-
1	REAR BUMPER	BENT	848.70	848.70
1	REAR BUMPER SIDE BRACKET LH	DISTORTED	64.40	64.40
1	REAR BUMPER SIDE BRACKET RH	DISTORTED	64.40	64.40
1	REAR BUMPER UNDER COVER	SERVICEABLE	189.60	-
1	REAR BUMPER REINFORCEMENT	BUCKLED	590.60	590.60
1	REAR END PANEL UPPER COVERING	MTG CRACKED	284.50	284.50
1	REAR END PANEL (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRONT BONNET (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 25% DISCOUNT		-1,538.25	-1,091.05
			4,614.75	3,273.15
<b><u>SPECIAL NETT ITEMS</u></b>				
1	FRONT BUMPER CLIPS (SN)	NECESSARY	40.00	40.00
1	FRONT NUMBER PLATE WITH HOLDER (SN)	BENT	40.00	40.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	60.00	40.00
8	REAR BUMPER CLIPS (SN)	NECESSARY	40.00	40.00



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BUMPER REVERSE SENSOR (SN)	DENTED	300.00	200.00
1	REAR END PANEL JOINT SEALANT (SN)	NOT NECESSARY	30.00	-
1	REAR BUMPER DECAL STICKER (SN)	NECESSARY	30.00	30.00
			540.00	390.00
	<b>LABOUR</b>			
	LABOUR CHARGES TO REMOVE ,REPLACE ,REFIX ,REPAIR & READJUST FRONT & REAR ACCIDENT AREAS & ETC.INCLUSIVE OF THE REPAIR OF FRONT BUMPER REINFORCEMENT ,REAR TAILGATE INNER LOCK ,REAR END PANEL AND FRONT BONNET .		1,000.00	600.00
	LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT FRONT BUMPER ,FRONT BONNET ,REAR TAILGATE ,REAR BUMPER ,REAR END PANEL & ETC.		1,200.00	800.00
	LABOUR CHARGES TO REMOVE & REFIX REAR WINDSCREEN GLASS ,REAR WINDSCREEN SEALANT & ETC ,TO EFFECT REPLACE OF REAR TAILGATE.		150.00	120.00
	LABOUR CHARGES TO REMOVE & REINSTALLED REAR TAILGATE INNER MECHANISM & ETC TO EFFECT REPLACE OF REAR TAILGATE .		120.00	60.00
	LABOUR CHARGE TO REMOVE & REPLACE REAR BUMPER REVERSE SENSOR & ETC .TO EFFECT REPLACE OF REAR BUMPER .		100.00	50.00
	TO CHECK WIRING & ELECTRICAL SYSTEM & ETC.		80.00	30.00
			2,650.00	1,660.00
<b>GRAND TOTAL</b>			<b>7,804.75</b>	<b>5,323.15</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>4,250.00</b>

Report Ref No. CC4/FCI20012872/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SLP 6695D

### INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SLP 6695D

### RE-INSPECTION





## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. SLP 6695D

### RE-INSPECTION

