

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/III20012886/UQF3E2

Date: 02/12/2020

REFERENCE

| | |
|---|---|
| Handling Insurer: India International Insurance Pte Ltd | Policy No: MC0M0016 |
| Claimant Vehicle No : WQV3222 | Insured Vehicle No : SHB4324J |
| Date of Loss: 24/09/2016 | Nature of Claim: TP Claim No: MCT16091066 |

DESCRIPTION & IDENTIFICATION OF VEHICLE

| | | |
|-----------------------------|-----------------------------------|-------------------------------|
| Reg No: | WQV3222 | |
| Make & Model: | TOYOTA CAMRY, 2.0 (A) | Engine No: 1AZE070937 |
| Reg. Date: | 01/12/2007 (Man. Year: 2007) | Chassis No: MR053BK4107020630 |
| Colour: | Grey | Odometer: 379635 km |
| Engine Capacity: | 1998 cc | |
| Market Value/New Car Price: | N/A | |
| Sum Insured (S\$): | Market Value/New Car Price | |

CONDITION OF VEHICLE AT THE TIME OF SURVEY

| | | | | |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|
| General Condition: | Steering (Serviceable): | Yes | Footbrake (Serviceable): | Yes |
| Handbrake (Serviceable): | Yes | Engine Modification: | No | Pre-accident Condition: |

CONDITION OF TYRES

| | | | |
|-------------------|------------------|------------------|------------------|
| Front Tyre Size: | 225/50Z R18 | Rear Tyre Size: | 225/50Z R18 |
| Front Left Side: | Continental 6 mm | Rear Left Side: | Continental 6 mm |
| Front Right Side: | Continental 6 mm | Rear Right Side: | Continental 6 mm |

The above values represent the remaining tyre treads depth

| COST OF CLAIMS | Repairer's | Adjuster's | Difference | Diff % |
|--|-------------|-----------------|------------------|--------|
| Parts | 0.00 | 5,346.17 | -5,346.17 | |
| Miscellaneous Items | 0.00 | 0.00 | 0.00 | |
| Labour | 0.00 | 2,250.00 | -2,250.00 | |
| Paintwork Labour | 0.00 | 0.00 | 0.00 | |
| Towing | 0.00 | 0.00 | 0.00 | |
| Calculated Gross Total (S\$) | 0.00 | 7,596.17 | -7,596.17 | |
| Approved Total (Overridden) (S\$) | | 6,000.00 | | |
| (S\$) | 0.00 | 6,000.00 | -6,000.00 | |
| + GST 7.00/7.00% (S\$) | 0.00 | 420.00 | -420.00 | |
| Nett Amount (S\$) | 0.00 | 6,420.00 | -6,420.00 | |

INSPECTION

| | | |
|---------------------|------------|---|
| Date of Assignment: | 23/11/2020 | |
| Date Inspected: | 26/09/2016 | Inspected At: Fastech Auto Pte Ltd 1 Kaki Bukit Avenue 6 #01-46/48/50 Autobay Singapore 417883 |

Estimated Period of Repair: 5.0 days

Adjuster: MARCUS CHUA**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

NOTE : SUM INSURED RM60,000.00

REPAIR DETAILS

Reference

| | | |
|----------------------|--|--|
| Part Source: | MRM-SG | Version: 1.0 (Last Synchronised: 02 Dec 2020) |
| Parts: | 143 | TOYOTA CAMRY 2.0 (A) (Catalogue:Merimen Singapore 1.0) |
| Labour: | Repairer's | (Price-denominated Standard List) |
| Print Code: | (Unsubmitted, no print-code for WQV3222) | |
| Validity: | These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page | |
| Further Info: | Items/values not in reference catalogue are prefixed with an asterisk *. | |

Recommended Parts

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|-----|-----|----------|--|-------------------|------------|--------------|
| 1 | 1 | | *REAR BOOT LID | Bent / Buckled | - | *929.10 FL |
| 2 | 1 | | *REAR BOOT LOCK | Twisted | - | *429.10 FL |
| 3 | 1 | | *REAR BOOT LOCK CATCH | Not Necessary | - | - |
| 4 | 1 | | *REAR BOOT CENTRE GARNISH | Not Necessary | - | - |
| 5 | 1 | | *REAR BOOT CENTRE EMBLEM | Necessary | - | *48.50 FL |
| 6 | 2 | | *REAR BOOT ABSORBER | Not Necessary | - | - |
| 7 | 1 | | *REAR BOOT INNER GARNISH | Not Necessary | - | - |
| 8 | 1 | | *REAR BOOT EMBLEM (CAMRY) | Necessary | - | *58.50 FL |
| 9 | 1 | | *REAR BOOT EMBLEM (2.0) | Necessary | - | *48.20 FL |
| 10 | 1 | | *REAR BOOT G EMBLEM | Necessary | - | *42.10 FL |
| 11 | 2 | | *REAR BOOT REFLECTOR LAMP | Not Necessary | - | - |
| 12 | 2 | | *REAR BOOT HINGE | Not Necessary | - | - |
| 13 | 1 | | *REAR BOOT WEATHERSTRIP | Twisted | - | *207.30 FL |
| 14 | 2 | | *REAR BOOT NUMBER PLATE LAMP | Not Necessary | - | *- FL |
| 15 | 2 | | *REAR TAIL LAMP | Damaged / Cracked | - | *1,291.40 FL |
| 16 | 2 | | *REAR TAIL LAMP LOWER BRACKET | No such part | - | - |
| 17 | 1 | | *REAR END PANEL | Badly Dented | - | *895.60 FL |
| 18 | 1 | | *REAR END PANEL TOP GARNISH | Twisted | - | *421.30 FL |
| 19 | 1 | | *REAR BUMPER | Dented / Deformed | - | *525.10 FL |
| 20 | 2 | | *REAR BUMPER SIDE RETAINER | Not Necessary | - | - |
| 21 | 1 | | *REAR BUMPER TOWING COVER | Not Necessary | - | - |
| 22 | 1 | | *REAR BUMPER REINFORMENT | Dented | - | *399.20 FL |
| 23 | 1 | | *REAR EXHAUST SILENCER | Bent / Twisted | - | *981.30 FL |
| 24 | 2 | | *REAR EXHAUST RUBBER | Necessary | - | *121.60 FL |
| 25 | 2 | | *REAR FENDER | Repair | - | - |
| 26 | 2 | | *REAR FENDER INNER GARNISH | Not Necessary | - | - |
| 27 | 1 | | *REAR SPARE TYRE PANEL | Repair | - | - |
| 28 | 1 | | *REAR SPARE TYRE PANEL TOP COVER BOARD | Torn | - | *396.60 FL |
| 29 | 1 | | *REAR GLASS MLDG | Not Necessary | - | - |
| 30 | 4 | | *REAR TAIL LAMP CLIPS | Not Necessary | - | - |
| 31 | 12 | | *REAR FENDER INNER GARNISH CLIPS | Not Necessary | - | - |
| 32 | 12 | | *REAR BOOT INNER BOARD CLIPS | Not Necessary | - | - |
| 33 | 1 | | *REAR SPARE TYRE PANEL TOP INSULATOR | Not Necessary | - | - |
| 34 | 1 | | *REAR END PANEL SEALANT | Necessary | - | *50.00 FS |
| 35 | 1 | | *REAR NUMBER PLATE | Not Necessary | - | - |
| 36 | 1 | | *REAR GLASS SEALANT | Not Necessary | - | - |
| 37 | 1 | | *SET REAR BUMPER REVERSE SENSOR | Shorted | - | *200.00 FS |

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 0.00 7,044.90

- List Item Discount on L Items 0.00/25.00% (\$\$) 0.00 1,698.73

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|-----|-----|----------|-------------|-----------|--------------------------|----------------------|
| | | | | | Total Parts (S\$) | 0.00 5,346.17 |

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

| No | Particulars | Lab.Type | Repairer's | Amount |
|-------------------------------|--|----------|-------------|-----------------|
| <u>Labour Items</u> | | | | |
| 1 | TO CHECK WIRING | New | - | 20.00 |
| 2 | TUFF KOTE | New | - | 60.00 |
| 3 | TOWING | New | - | - |
| 4 | REMOVE AND REFIX UPHOLSTERY | New | - | 60.00 |
| 5 | REMOVE AND REPLACE EXHAUST PIPE | New | - | 60.00 |
| 6 | REMOVE AND REPLACE REVERSE SENSOR | New | - | 50.00 |
| 7 | REMOVE AND REFIX REAR GLASS | New | - | - |
| 8 | TO REMOVE AND REPLACE SPARE PART AND PANEL BEATING | New | - | 800.00 |
| 9 | TO SPRAY PAINTING AND ETC | New | - | 1,200.00 |
| Gross Labour Cost (\$) | | | 0.00 | 2,250.00 |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >