

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CTI20013113/USD3E2

Date: 12/01/2021

REFERENCE

Insured/Claimant: GLOBAL ADVANCE LEASING Policy No: DMHCSNA00006592000

Date of Loss: 23/11/2020

Nature of Claim: OD

Claim No: SNM20D204580/C01/TAYPH

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJN9695T	Engine No:	1NZD197695
Make & Model:	TOYOTA AXIO, 1.5 (A)	Chassis No:	NZE1416097549
Reg. Date:	06/03/2009 (Man. Year: 2008)	Odometer:	265795 km
Colour:	Silver		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	S\$15,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	185/70 R14	Rear Tyre Size:	185/70 R14
Front Left Side:	Bridgestone 4 mm	Rear Left Side:	Falken 4 mm
Front Right Side:	Bridgestone 4 mm	Rear Right Side:	Falken 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	6,743.90	4,107.10	2,636.80	39.10
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,810.00	3,460.00	2,350.00	40.45
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	12,553.90	7,567.10	4,986.80	39.72
Approved Total (Overridden) (S\$)		6,000.00		
- Excess (S\$)	500.00	500.00	0.00	0.00
(S\$)	12,053.90	5,500.00	6,553.90	54.37
+ GST 7.00/7.00% (S\$)	843.77	385.00	458.77	54.37
Nett Amount (S\$)	12,897.67	5,885.00	7,012.67	54.37

INSPECTION

Date of Assignment: 27/11/2020

Date Inspected: 27/11/2020 Inspected At:

Estimated Period of Repair: 10.0 days

Kt Garage Pte Ltd (HQ)
BLK 1 KAKI BUKIT AVENUE 6 #01-04, AUTO
BAY@KAKI BUKIT ENTRANCE A
Singapore 417883

Adjuster: MARCUS CHUA

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 12 Jan 2021)
Parts:	143	TOYOTA AXIO 1.5 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJN9695T)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Distorted	220.00 F	*220.00 F
2	10		*FRONT BUMPER CLIPS	Necessary	15.00 F	*15.00 F
3	1		*FRONT BUMPER FOG LAMP COVER	Not Necessary	30.00 F	*- F
4	1		*RH HEADLAMP	Broken	220.00 F	*220.00 F
5	1		*RH HEADLAMP PANEL	Repair	90.00 F	*- F
6	1		*RH FRONT FENDER	Distorted	230.00 F	*230.00 F
7	1		*RH FRONT FENDER INNER COWLING	Torn	70.00 F	*70.00 F
8	8		*RH FRONT FENDER INNER COWLING CLIPS	Necessary	12.00 F	*12.00 F
9	1		*WIPER TANK	Deformed	50.00 F	*50.00 F
10	1		*REAR BUMPER	Distorted	180.00 F	*180.00 F
11	10		*REAR BUMPER CLIPS	Necessary	15.00 F	*15.00 F
12	1		*RH REAR BUMPER SIDE RETAINER	O/S Cracked	76.00 F	*38.00 F
13	1		*SET REAR BUMPER REVERSE SENSOR	Not Insured	380.00 F	*- F
14	1		*END PANEL	Repair	170.00 F	*- F
15	1		*RH TAILLAMP	Broken	130.00 F	*130.00 F
16	1		*RH REAR FENDER	Badly Dented	320.00 F	*320.00 F
17	1		*RH REAR FENDER AIR VENT	Twisted	25.00 F	*25.00 F
18	1		*RH REAR FENDER INNER TRIM	Not Necessary	140.00 F	*- F
19	1		*REAR FLOOR PANEL	Repair	280.00 F	*- F
20	1		*REAR FLOOR BOARD	Warped	200.00 F	*200.00 F
21	1		*RH TOOLS COMPARTMENT POCKET	Deformed	45.00 F	*45.00 F
22	1		*REAR AXLES	Bent / Twisted	780.00 F	*780.00 F
23	1		*RH REAR ABSORBERS	Twisted	70.00 F	*70.00 F
24	1		*RH REAR WHEEL BEARING WITH HUP	Damaged	180.00 F	*180.00 F
25	1		*RH FRONT KNUCKLE ARM	Bent	140.00 F	*140.00 F
26	1		*RH FRONT WHEEL BEARING	Necessary	35.00 F	*35.00 F
27	1		*RH FRONT LOWER ARM	Not Necessary	75.00 F	*- F
28	1		*RH FRONT ABSORBER	Not Necessary	140.00 F	*- F
29	1		*RH FRONT ANTI ROLL BAR LINKAGE	Not Necessary	60.00 F	*- F
30	1		*EXHAUST BOX	Distorted	380.00 F	*380.00 F
31	1		*EXHAUST BOX MOUNTING (FRONT)	Torn	18.00 F	*18.00 F
32	1		*EXHAUST BOX MOUNTING (REAR)	Torn	18.00 F	*18.00 F
33	1		*EXHAUST BOX HEAT SHIELD	Cracked	100.00 F	*100.00 F
34	1		*EXHAUST PIPE (CENTRE)	Repair	650.00 F	*- F
35	1		*PETROL TANK HEAT SHIELD	Repair	220.00 F	*- F
36	1		*WINDSCREEN MOULDING	Necessary	60.00 F	*60.00 F
37	1		*FRONT BUMPER SIDE RETAINER RH	Bent / Cracked	25.00 F	*25.00 F
38	1		*RADIATOR SPARE TANK	Not Necessary	50.00 F	*- F
39	1		*FRONT BUMPER BEAM	Bent	80.00 F	*80.00 F
40	1		*REAR BUMPER BRACKET RH	Dented	25.00 F	*25.00 F
41	1		*RH TAILLAMP BRACKET RH	Not Necessary	35.00 F	*- F
42	1		*WHEEL CAP	Repair	30.00 F	*- F

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
43	1		*WINDSCREEN PRIMER	Necessary	18.00 FS	*18.00 FS
44	2		*WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS

F=Franchise part. S=SpcNett.

		Sub Total (S\$)	6,137.00	3,739.00
		+ Margin on L,N Items 10.00/10.00% (S\$)	606.90	368.10
		Total Parts (S\$)	6,743.90	4,107.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO PANEL BEAT, KNOCK AND STRAIGHTEN FRONT AND REAR DAMAGED PORTION, CUT & WELD DAMAGE PANEL. TO ADJUST AND REALIGN THE SAME	New	1,800.00	1,200.00
2	TO REMOVE AND REFIT REAR WINDSCREEN	New	150.00	120.00
3	TO INSTALL PARKING SENSOR	New	120.00	0.00
4	TO CHECK ALL LIGHTING & WIRING	New	120.00	30.00
5	TO RUST PROOF ALL AFFECTED AREAS	New	180.00	0.00
6	TO DROP REAR UNDERCARRIAGE	New	380.00	220.00
7	TO REMOVE UPHOLSTERY IN ORDER TO REPLACE RH REAR FENDER	New	180.00	80.00
8	TO PUTTY AND SPRAY PAINT ALL AFFECTED AREAS	New	2,100.00	1,500.00
9	TO DO WHEEL ALIGNMENT	New	80.00	60.00
10	TO REMOVE AND REPLACE REAR EXHAUST	New	120.00	50.00
11	LABOUR TO REPAIR REAR SEAT PANEL	New	180.00	0.00
12	LABOUR TO REMOVE UPHOLSTERY (SEAT) TO REPAIR SEAT PANEL	New	120.00	80.00
13	LABOUR TO DROP AND REPLACE FRONT UNDERCARRIAGE	New	280.00	120.00
Gross Labour Cost (\$\$)			5,810.00	3,460.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >