

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CS/AIG20013143/EQF3Q2

Date: 19/02/2021

REFERENCE

| | | | | |
|-------------------|--------------|------------------|------------|------------------------|
| Insured/Claimant: | LAI ZHEN NAN | Policy No: | 1900242766 | |
| Date of Loss: | 29/11/2020 | Nature of Claim: | OD | Claim No: 2110932730SG |

DESCRIPTION & IDENTIFICATION OF VEHICLE

| | | | | |
|-----------------------------|-----------------------------------|-------------|-------------------|--|
| Reg No: | SMQ2932D | | | |
| Make & Model: | KIA CERATO, 1.6 (A) | Engine No: | G4FGKH749533 | |
| Reg. Date: | 07/11/2019 (Man. Year: 2019) | Chassis No: | KNAF5416MK5052954 | |
| Colour: | Red | Odometer: | 21108 km | |
| Engine Capacity: | 1591 cc | | | |
| Market Value/New Car Price: | S\$84,000.00 | | | |
| Sum Insured (S\$): | Market Value/New Car Price | | | |

CONDITION OF VEHICLE AT THE TIME OF SURVEY

| | | | | |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|
| General Condition: | Steering (Serviceable): | Yes | Footbrake (Serviceable): | Yes |
| Handbrake (Serviceable): | Yes | Engine Modification: | No | Pre-accident Condition: |

CONDITION OF TYRES

| | | | |
|-------------------|---------------|------------------|---------------|
| Front Tyre Size: | 205/55R16 | Rear Tyre Size: | 205/55R16 |
| Front Left Side: | Michelin 5 mm | Rear Left Side: | Michelin 5 mm |
| Front Right Side: | Michelin 5 mm | Rear Right Side: | Michelin 5 mm |

The above values represent the remaining tyre treads depth

| COST OF CLAIMS | Repairer's | Adjuster's | Difference | Diff % |
|-------------------------------------|-------------------|-------------------|-------------------|---------------|
| Parts | 12,571.20 | 10,681.60 | 1,889.60 | 15.03 |
| Miscellaneous Items | 0.00 | 0.00 | 0.00 | |
| Labour | 8,450.00 | 7,210.00 | 1,240.00 | 14.67 |
| Paintwork Labour | 0.00 | 0.00 | 0.00 | |
| Towing | 0.00 | 0.00 | 0.00 | |
| Calculated Gross Total (S\$) | 21,021.20 | 17,891.60 | 3,129.60 | 14.89 |
| - Excess (S\$) | 600.00 | 600.00 | 0.00 | 0.00 |
| (S\$) | 20,421.20 | 17,291.60 | 3,129.60 | 15.33 |
| + GST 7.00/7.00% (S\$) | 1,429.48 | 1,210.41 | 219.07 | 15.33 |
| Nett Amount (S\$) | 21,850.68 | 18,502.01 | 3,348.67 | 15.33 |

INSPECTION

Date of Assignment: 30/11/2020

Date Inspected: 30/11/2020 Inspected At:

Cycle & Carriage KIA Pte Ltd (Pandan Gardens)
209 Pandan Gardens
Singapore 609339

Estimated Period of Repair: 17.0 days

Adjuster: CHEN TSUE YEE

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|-----|-----|----------|---------------------------------|---------------|-------------|--------------|
| 1 | 1 | | *LAMP ASSY-HEAD,LH | Broken | 2,210.00 FL | *2,210.00 FL |
| 2 | 1 | | *LAMP ASSY-HEAD,RH | Broken | 2,210.00 FL | *2,210.00 FL |
| 3 | 1 | | *RESERVOIR & PUMP ASSY-WASHER | Broken | 146.00 FL | *146.00 FL |
| 4 | 1 | | *COMPRESSOR ASSY | Not Necessary | 1,418.00 FL | *- FL |
| 5 | 1 | | *HORN ASSY-LOW PITCH | Not Necessary | 74.00 FL | *- FL |
| 6 | 1 | | *PANEL ASSY-HOOD | Dented | 1,502.00 FL | *1,502.00 FL |
| 7 | 1 | | *HINGE ASSY-HOOD,RH | Bent | 43.00 FL | *43.00 FL |
| 8 | 1 | | *HINGE ASSY-HOOD,LH | Bent | 43.00 FL | *43.00 FL |
| 9 | 1 | | *PANEL-FENDER,LH | Bent | 430.00 FL | *430.00 FL |
| 10 | 1 | | *PANEL-FENDER,RH | Dented | 430.00 FL | *430.00 FL |
| 11 | 1 | | *BEAM COMPLETE-FR BUMPER | Not Necessary | 497.00 FL | *- FL |
| 12 | 1 | | *PAD-HOOD INSULATING | Not Necessary | 156.00 FL | *- FL |
| 13 | 1 | | *LATCH ASSY- HOOD | Not Necessary | 103.00 FL | *- FL |
| 14 | 1 | | *COVER-FR BUMPER | Broken | 633.00 FL | *633.00 FL |
| 15 | 1 | | *GRILLE ASSY-RADIATOR | Broken | 328.00 FL | *328.00 FL |
| 16 | 1 | | *GRILLE-FRONT BUMPER | Broken | 485.00 FL | *485.00 FL |
| 17 | 1 | | *MOULDING-FRONT BUMPER,RH | Missing | 216.00 FL | *216.00 FL |
| 18 | 1 | | *LAMP ASSY-SIDE REPEATER,RH | Cut | 143.00 FL | *143.00 FL |
| 19 | 1 | | *ABSORBER-FRONT BUMPER ENERGY | Broken | 84.00 FL | *84.00 FL |
| 20 | 1 | | *AIR DUCT-FR BUMPER,RH | Broken | 14.00 FL | *14.00 FL |
| 21 | 1 | | *STIFFNER-FR BPR LWR | Not Necessary | 114.00 FL | *- FL |
| 22 | 1 | | *BRACKET-FR BUMPER UPR SIDE MTG | Broken | 22.00 FL | *22.00 FL |
| 23 | 1 | | *BRACKET-FR BUMPER UPR SIDE MTG | Broken | 22.00 FL | *22.00 FL |
| 24 | 1 | | *GUARD ASSY-FRONT WHEEL,RH | Crushed | 95.00 FL | *95.00 FL |
| 25 | 1 | | *ORNAMENT-KIA NO.115 | Necessary | 32.00 FL | *32.00 FL |
| 26 | 1 | | *COVER ASSY-COWL TOP | Broken | 247.00 FL | *247.00 FL |
| 27 | 2 | | *CLIP - HEAD LAMP MTG | Missing | 8.00 FL | *8.00 FL |
| | | | (Supplementary) | | | |
| 28 | 1 | | *LAMP ASSY - FRONT FOG, RH | Bent | 303.00 FL | *303.00 FL |
| | | | (Supplementary) | | | |
| 29 | 1 | | *COVER- FR BUMPER FOG LAMP, RH | Crushed | 15.00 FL | *15.00 FL |
| | | | (Supplementary) | | | |
| 30 | 1 | | *GARNISH -RADIATOR GRILLE | Broken | 38.00 FL | *38.00 FL |
| | | | (Supplementary) | | | |
| 31 | 1 | | *WIRING ASSY-BUMPER EXTENSION | Torn | 207.00 FL | *207.00 FL |
| | | | (Supplementary) | | | |
| 32 | 10 | | *CLIPS | Necessary | 20.00 FL | *20.00 FL |
| | | | (Supplementary) | | | |
| 33 | 1 | | *CARRIER ASSY-FRONT END MODULE | Broken | 675.00 FL | *675.00 FL |
| | | | (Supplementary) | | | |
| 34 | 1 | | *RADIATOR ASSY | Bent | 646.00 FL | *646.00 FL |
| | | | (Supplementary) | | | |
| 35 | 1 | | *CLEANER ASSY-AIR | Broken | 174.00 FL | *174.00 FL |
| | | | (Supplementary) | | | |
| 36 | 6 | | *RETAINER-COWL TOP COVER MTG | Necessary | 12.00 FL | *12.00 FL |
| | | | (Supplementary) | | | |
| 37 | 1 | | *COOLANT (4L) | Necessary | 26.00 FL | *26.00 FL |
| | | | (Supplementary) | | | |
| 38 | 1 | | *PANEL-UNDER COVER | Broken | 117.00 FL | *117.00 FL |
| | | | (Supplementary) | | | |
| 39 | 1 | | *CONDENSER ASSY - COOLER | Bent | 687.00 FL | *687.00 FL |
| | | | (Supplementary) | | | |
| 40 | 1 | | *TUBE ASSY-SUCTION & LIQUID | Bent | 668.00 FL | *668.00 FL |
| | | | (Supplementary) | | | |
| 41 | 1 | | *PULLEY-COOLANT PUMP | Bent | 32.00 FL | *32.00 FL |
| | | | (Supplementary) | | | |
| 42 | 1 | | *GASKET-WATER PUMP | Necessary | 7.00 FL | *7.00 FL |
| | | | (Supplementary) | | | |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|--|-----|----------|--|-----------|------------------|------------------|
| 43 | 1 | | *PUMP ASSY-COOLANT (Supplementary) | Bent | 174.00 FL | *174.00 FL |
| 44 | 1 | | *BRACKET ASSY-ENGINE MTG (Supplementary) | Cracked | 208.00 FL | *208.00 FL |
| F=Franchise part. L=ListItemDisc. | | | | | | |
| Sub Total (\$) | | | | | 15,714.00 | 13,352.00 |
| - List Item Discount on L Items 20.00/20.00% (\$) | | | | | 3,142.80 | 2,670.40 |
| Total Parts (\$) | | | | | 12,571.20 | 10,681.60 |

| |
|---|
| Report was unsubmitted during this print-out. |
|---|

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

| No | Particulars | Lab.Type | Repairer's | Amount |
|---------------------------------|--|----------|-----------------|-----------------|
| <u>Labour Items</u> | | | | |
| 1 | REPLACE FRT BUMPER,BONNET,BOTH FRT FENDER & AFFECTED AREA.REPAIR ON FRT LH DOOR | New | 2,400.00 | 1,600.00 |
| 2 | PAINT WORK ON FRT BUMPER,BONNET,BOTH FRT FENDER & FRT LH DOOR | New | 2,400.00 | 2,400.00 |
| 3 | PERFORM RUST PREVENTION | New | 80.00 | 40.00 |
| 4 | CHECK WIRING & CHASSIS ELECTRICAL SYSTEM | New | 30.00 | 30.00 |
| 5 | TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST | New | 120.00 | 120.00 |
| 6 | TO APPLY ZERTONA COATING ON AFFECTED AREA | New | 400.00 | 0.00 |
| 7 | REMOVE & INSTALL ENGINE ASSY (Supplementary) | New | 400.00 | 400.00 |
| 8 | REPAIR BOTH FRONT CHASSIS, BOTH WHEEL HOUSING AND REPLACE SUPPORT PANEL (Supplementary) | New | 1,600.00 | 1,600.00 |
| 9 | REPLACE AIRCON CONDENSER AND RADIATOR ASSY (Supplementary) | New | 120.00 | 120.00 |
| 10 | SPRAY PAINT BOTH FRONT CHASSIS & BOTH FRONT WHEEL HOUSING (Supplementary) | New | 700.00 | 700.00 |
| 11 | VACUUM & TOP UP AIRCON GAS (Supplementary) | New | 80.00 | 80.00 |
| 12 | TO CONDUCT COMPUTERIZE FULL WHEEL ALIGNMENT (Supplementary) | New | 120.00 | 120.00 |
| Gross Labour Cost (\$\$) | | | 8,450.00 | 7,210.00 |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >