

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG20013174/T1PS3Q2
Date: 18/05/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1800111564
Claimant Vehicle No :	SH8326R	Insured Vehicle No :	SME1812L
Date of Loss:	27/11/2020	Nature of Claim:	TP
		Claim No:	7198885311SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SH8326R	Engine No:	D4FDGU705595
Make & Model:	HYUNDAI I40, 1.7 D CRDI F/L ABS AIRBAG 4DR (A)	Chassis No:	KMHLB41UMHU098188
Reg. Date:	11/01/2017 (Man. Year: 2016)	Odometer:	669622 km
Colour:	Blue		
Engine Capacity:	1685 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	West Lake 6 mm	Rear Left Side:	West Lake 6 mm
Front Right Side:	West Lake 6 mm	Rear Right Side:	West Lake 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	952.40	952.40	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	680.00	510.00	170.00	25.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	1,632.40	1,462.40	170.00	10.41
Approved Total (Overridden) (S\$)		1,150.00		

(S\$)	1,632.40	1,150.00	482.40	29.55
+ GST 7.00/7.00% (S\$)	114.27	80.50	33.77	29.55
Nett Amount (S\$)	1,746.67	1,230.50	516.17	29.55
+ Loss of Use (4.5 x S\$50.00/day) (S\$)		225.00		
+ Car Rental (4.5 x S\$112.67/day) (S\$)		507.02		
+ Doc/Search Fee (S\$)		7.49		
Nett Liability (S\$)		1,970.01		
Global Sum Settlement (S\$)		1,900.00		

INSPECTION

Date of Assignment: 01/12/2020

Date Inspected: 01/12/2020

Inspected At:

ComfortDelGro Engineering Pte Ltd (Loyang)

59 Loyang Drive

Singapore 508969

Estimated Period of Repair: 2.0 days

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*COVER ASSY -RR BUMPE	Deformed	1,106.00 FL	*1,106.00 FL
2	10		*HYUNDAI BUMPER COVER CLIP	Necessary	22.00 FL	*22.00 FL
3	1		*PROTECTOR MAT	Necessary	50.00 FS	*50.00 FS
						F=Franchise part. S=SpcNett. L=ListItemDisc.
					Sub Total (\$\$)	1,178.00
					- List Item Discount on L Items 20.00/20.00% (\$\$)	225.60
					Total Parts (\$\$)	952.40

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PANEL BEATING	New	300.00	280.00
2	SPRAYPAINT CHARGE	New	300.00	200.00
3	REMOVE/REFIX REVERSE SENSOR	New	80.00	30.00
Gross Labour Cost (\$\$)			680.00	510.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >