

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CS/AIG20013218/EQF3E2

Date: 11/01/2021

REFERENCE

Insured/Claimant:	TAN TONG LING	Policy No:	1900002912		
Date of Loss:	01/12/2020	Nature of Claim:	OD	Claim No:	9361303863SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMH626Z		
Make & Model:	KIA CERATO, 1.6 (A)	Engine No:	G4FGJH713013
Reg. Date:	10/01/2019 (Man. Year: 2018)	Chassis No:	KNAF3416MK5023986
Colour:	Red	Odometer:	14481 km
Engine Capacity:	1591 cc		
Market Value/New Car Price:	S\$73,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Bridgestone 5 mm	Rear Left Side:	Bridgestone 5 mm
Front Right Side:	Bridgestone 5 mm	Rear Right Side:	Bridgestone 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,625.60	1,528.80	96.80	5.95
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,220.00	1,250.00	970.00	43.69
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	3,845.60	2,778.80	1,066.80	27.74
- Excess (S\$)	300.00	300.00	0.00	0.00
(S\$)	3,545.60	2,478.80	1,066.80	30.09
+ GST 7.00/7.00% (S\$)	248.19	173.52	74.67	30.09
Nett Amount (S\$)	3,793.79	2,652.32	1,141.47	30.09

INSPECTION

Date of Assignment:	02/12/2020		
Date Inspected:	01/12/2020	Inspected At:	Cycle & Carriage KIA Pte Ltd (Pandan Gardens) 209 Pandan Gardens Singapore 609339
Estimated Period of Repair:	3.0 days		

Adjuster: CHEN TSUE YEE

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*MIRROR ASSY - OUTSIDE RR VIEW, RH	Cut	559.00 FL	*559.00 FL
2	1		*PANEL ASSY - FRONT DOOR, RH	Dented	1,277.00 FL	*1,277.00 FL
3	1		*HINGE ASSY - FRONT DOOR UPP, RH	Not Necessary	30.00 FL	*- FL
4	1		*HINGE ASSY - FRONT DOOR LWR, RH	Not Necessary	27.00 FL	*- FL
5	1		*BLACK TAPE -FR DR RR, RH	Necessary	13.00 FL	*13.00 FL
6	1		*W/STRIP ASSY - FR DR BELT O/S RH	Not Necessary	64.00 FL	*- FL
7	1		*SUNDRIES	Necessary	20.00 FS	*20.00 FS
8	1		*MOLDING ASSY - FRT DR FRAME, RH	Bent	37.00 FL	*37.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	2,027.00	1,906.00
- List Item Discount on L Items 20.00/20.00% (\$)	401.40	377.20
Total Parts (\$)	1,625.60	1,528.80

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	RENEW FRT DOOR RH & WING MIRROR ASSY RH.	New	1,250.00	400.00
2	RESPRAY FRT DOOR RH & WING MIRROR RH.	New	700.00	580.00
3	REMOVE & REFIT RHF DOOR COMPONENTS.	New	120.00	120.00
4	CHECK WIRING ELECTRICAL SYSTEM.	New	30.00	30.00
5	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST.	New	120.00	120.00
Gross Labour Cost (\$\$)			2,220.00	1,250.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >