Page 1 of 3 Adjuster Report

### LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

#### VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG20013228/QVF3E2

Date: 04/12/2020

REFERENCE

No:

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100202569 Claimant Vehicle SJH6529S Insured Vehicle No: SGT3593Y

Date of Loss: 24/11/2020 Nature of Claim: TP Claim No: 9834188196SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

Reg No: SJH6529S

Make & Model: HONDA STREAM, 1.8 L (A) Engine No: R18A12804328

Reg. Date: 18/08/2008 (Man. Year: 2008) Chassis No: JHMRN68408S204330

Colour: Odometer: 166434 km **Black** 

**Engine Capacity:** 1799 cc Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Footbrake (Serviceable): Yes

Handbrake (Serviceable): **Engine Modification:** No Pre-accident Condition: Yes

**CONDITION OF TYRES** 

Front Tyre Size: 205/55 R16 Rear Tyre Size: 205/55 R16 Front Left Side: Rear Left Side: KAPSEN 6 mm KAPSEN 6 mm Rear Right Side: Front Right Side: KAPSEN 6 mm KAPSEN 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

**INSPECTION** 

Date of Assignment: 25/11/2020

Date Inspected: 25/11/2020 Inspected At: 160 Sin Ming Drive #05-17 Sin Ming

Autocity

Repairer: Hiap Lek Automobile Trading

Estimated Period of Repair: 4.0 days

OI SUN PIN Manager: VERON CHEN Adjuster:

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Adjuster Report Page 2 of 3

# **REPAIR DETAILS**

# **Recommended Parts**

No.	Qty Part No.	Particulars	Condition	Repairer's	Amount
1	1	*FRT BUMPER	Crumpled	0.00 F	*- F
2	1	*FRT BUMPER SIDE RETAINER	Broken	0.00 F	*- F
3	1	*FRT BUMPER CLIP	Necessary	0.00 F	*- F
4	1	*FRT LH FENDER	Crumpled	0.00 F	*- F
5	1	*FRT LH INNER LINNER	Cut	0.00 F	*- F
6	1	*FRT LH HEADLAMP	Crumpled	0.00 F	*- F
7	1	*FRT LH RIM	Crumpled	0.00 F	*- F
8	1	*FRT LH TYRE	Broken	0.00 F	*- F
F=Fra	anchise part.		_		
			Total Parts (S\$)	0.00	0.00
			_		

Report was unsubmitted during this print-out.

Adjuster Report Page 3 of 3

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

#### Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >