LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd. Our File No: CS/AIG20013289/ETF3E2 AIG Building, 78 Shenton Way #07-16

16/12/2020 Date: Singapore 079120

REFERENCE

Insured/Claimant: SURESH BABU LOGANATHAN Policy No: 1800136226

Nature of Claim: Date of Loss: 01/12/2020 OD Claim No: 9117453000SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SMF8254X

KIA CERATO, 1.6 (A) G4FGJH709779 Make & Model: Engine No:

Reg. Date: 27/11/2018 (Man. Year: 2018) Chassis No: KNAF3416MK5020664

Colour: Blue Odometer: 34504 km

1591 cc **Engine Capacity:** Market Value/New Car Price: S\$65,000.00

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Footbrake (Serviceable): Yes Yes

Handbrake (Serviceable): **Engine Modification:** Pre-accident Condition: Yes No

CONDITION OF TYRES

Rear Tyre Size: Front Tyre Size: 225/45 R17 225/45 R17 Front Left Side: Kumho 5 mm Rear Left Side: Kumho 5 mm Front Right Side: Kumho 5 mm Rear Right Side: Kumho 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,505.00	467.20	1,037.80	68.96
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,850.00	1,600.00	1,250.00	43.86
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	4,355.00	2,067.20	2,287.80	52.53
+ GST 7.00/7.00% (S\$)	304.85	144.70	160.15	52.53
Nett Amount (S\$)	4,659.85	2,211.90	2,447.95	52.53

INSPECTION

Date of Assignment: 03/12/2020

Cycle & Carriage KIA Pte Ltd (Pandan Gardens) Date Inspected: 04/12/2020 Inspected At:

209 Pandan Gardens

Singapore 609339

Estimated Period of Repair: 4.0 days

CHEN TSUE YEE DENISE TAY KWEE CHENG Adjuster: Manager:

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SUNDRY	Necessary	20.00 FS	*20.00 FS
2	1		*MIRROR ASSY-OUTSIDE RR VIEW, LH	Broken	559.00 F	*559.00 FL
3 F=Fra	1 anchise	part. S=SpcNe	*WHEEL ASSY-ALUMINIUM stt. L=ListItemDisc.	Not Necessary	926.00 F	*-FL
				Sub Total (S\$)	1,505.00	579.00
			- List Item Discount	on L Items 0.00/20.00% (S\$)	0.00	111.80
				Total Parts (S\$)	1,505.00	467.20
			Report was unsubmitted d	uring this print-out.		

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Lab	our Items			,
1	RENEW WINDMIRROR LH, REPAIR FRT BUMPER, FRT FENDER LH, A-PILLAR LH, FRT DOOR LH	New	800.00	400.00
2	SPRAY PAINT FOR FRT BUMPER, FRT FENDER LH, WINDMIRROR LH, A-PILLAR LH, FRT DOOR LH	New	1,750.00	1,050.00
3	TO CONDUCT COMPUTERIZE FULL WHEEL ALIGNMENT	New	120.00	0.00
4	TRANSFER RIM	New	30.00	0.00
5	CHECK WIRING & ELECTRICAL SYSTEM	New	30.00	30.00
6	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
	Gross Labour	Cost (S\$)	2,850.00	1,600.00
	Report was unsubmitted during this pr	int-out.		

< END OF ESTIMATES >