

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/AIG20013300/EBA3Q2

Date: 18/03/2021

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1900084136

Claimant
Vehicle No : SMQ3531X **Insured Vehicle No :** SMK3117R

Date of Loss: 02/12/2020 Nature of Claim: TP Claim No: 6905811827SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMQ3531X		
Make & Model:	KIA CERATO, 1.6 LX (A)	Engine No:	G4FGKH746509
Reg. Date:	12/11/2019 (Man. Year: 2019)	Chassis No:	KNAF1416MK5050973
Colour:	Red	Odometer:	22466 km
Engine Capacity:	1591 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Yokohama 5 mm	Rear Left Side:	Yokohama 5 mm
Front Right Side:	Yokohama 5 mm	Rear Right Side:	Yokohama 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	2,625.00	1,809.20	815.80	31.08
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,010.00	2,010.00	0.00	0.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	4,635.00	3,819.20	815.80	17.60
+ GST 7.00/7.00% (S\$)	324.45	267.34	57.11	17.60
Nett Amount (S\$)	4,959.45	4,086.54	872.91	17.60
+ Car Rental (5.0 x S\$100.00/day + 7.00% GST) (S\$)		535.00		
Nett Liability (S\$)		4,621.54		

INSPECTION

Date of Assignment: 03/12/2020

Date Inspected: 07/12/2020 Inspected At: Cycle & Carriage KIA Pte Ltd (Pandan Gardens)
209 Pandan Gardens
Singapore 609339

Estimated Period of Repair: 4.0 days

Adjuster: CHEN TSUE YEE

Manager: CHUA ZHEN LI

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SUNDRY	Necessary	20.00 FS	*10.00 FS
2	1		*COVER -RR BUMPER	Dented	651.00 FS	*520.80 FS
3	1		*COVER -RR BUMPER LWR	Cut	241.00 FS	*192.80 FS
4	1		*COVER -RR BUMPER FOG LAMP ,LH	Not Necessary	19.00 FS	*- FS
5	1		*COVER -RR BUMPER FOG LAMP ,RH	Not Necessary	19.00 FS	*- FS
6	1		*BEAM -RR BUMPER	Not Necessary	318.00 FS	*- FS
7	1		*PANEL ASSY -TRUNK LID	Dented	1,297.00 FS	*1,037.60 FS
8	1		*LOGO ASSY -KIA SUB	Necessary	32.00 FS	*25.60 FS
9	1		*EMBLEM -CERATO	Necessary	28.00 FS	*22.40 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$) 2,625.00 1,809.20

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	RENEW REAR BUMPER ,BOOTLID	New	800.00	800.00
2	SPRAY PAINT FOR REAR BUMPER ,BOOTLID	New	960.00	960.00
3	REMOVE & INSTALL PAKING SENSOR	New	60.00	60.00
4	C&C LOGO	New	40.00	40.00
5	CHECK WIRING & ELECTRICAL SYSTEM	New	30.00	30.00
6	TO CARRY OUT DIAGNOSTIC CHECK USING HI SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
Gross Labour Cost (\$\$)			2,010.00	2,010.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >