

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG20013426/R1QF3E2

Date: 11/12/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.	Policy No: 1900102434
Claimant Vehicle No : SCF926L	Insured Vehicle No : SML5937Y
Date of Loss: 02/12/2020	Nature of Claim: TP Claim No: 5355569326SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SCF926L		
Make & Model:	MITSUBISHI ATTRAGE, 1.2 (A)	Engine No:	3A92UHX7207
Reg. Date:	18/02/2020 (Man. Year: 2019)	Chassis No:	MMBSTA13AKH002575
Colour:	Maroon	Odometer:	10765 km
Engine Capacity:	1193 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	185/55 R15	Rear Tyre Size:	185/55 R15
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	07/12/2020	
Date Inspected:	07/12/2020 Inspected At:	V-Tech Auto Service (HQ) No.1 Soon Lee Street, #06-04 Pioneer Center Singapore 627605
Estimated Period of Repair:	5.0 days	

Adjuster: MOHD RASUL

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER	Deformed	0.00 F	*- F
2	1		*FRT BUMPER CLIPS	Necessary	0.00 F	*- F
3	1		*FRT BUMPER BRACKET	Necessary	0.00 F	*- F
4	1		*FRT BUMPER SIDE RETAINER	Necessary	0.00 F	*- F
5	1		*FRT BUMPER LOWER SPOILER	Cracked	0.00 F	*- F
6	1		*FRT LH BUMPER FOG LAMP COVER	Scratched	0.00 F	*- F
7	1		*FRT LH HEADLAMP ASSY	Cracked	0.00 F	*- F
8	1		*BONNET	Repair	0.00 F	*- F
9	1		*FRT LH FENDER	Bent	0.00 F	*- F
F=Franchise part.						
Total Parts (\$\$)					0.00	0.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >