



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKR 3665L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	REAR BUMPER	BUCKLED	1,438.00	860.40
1	REAR BUMPER BUZZER SENSOR	SERVICEABLE	198.00	-
1	SET REAR BUMPER CLIPS	NECESSARY	60.00	60.00
1	REAR BUMPER REFLECTOR-LH	SERVICEABLE	124.00	-
1	REAR BUMPER REFLECTOR-RH	SERVICEABLE	124.00	-
1	REAR BUMPER REINFORCEMENT	BENT	525.30	329.30
1	REAR BUMPER SIDE RETAINER-LH	SERVICEABLE	98.00	-
1	REAR BUMPER SIDE RETAINER-RH	SERVICEABLE	98.00	-
1	REAR BUMPER SPONGE	CRACKED	281.00	118.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	698.50	-
1	REAR EXHAUST MOUNTINGS	SERVICEABLE	82.10	-
1	REAR EXHAUST MUFFLER	TO REPAIR SEE LABOUR	980.00	-
1	REAR NUMBER PLATE	SERVICEABLE	60.00	-
1	REAR TAILGATE	TO REPAIR SEE LABOUR	1,821.00	-
1	REAR TAILGATE "LOGO"	NOT NECESSARY	81.00	-
	LESS 25% DISCOUNT		-	-341.93
			6,668.90	1,025.77
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	REVERSE SENSORS (SN)	CRACKED	350.00	200.00
			350.00	200.00
	<b><u>LABOUR</u></b>			
	TO DISMANTLE & REPLACE DAMAGED PARTS,PANEL BEAT WHERE NECESSARY.INCLUSIVE OF THE REPAIR OF REAR END PANEL,REAR EXHAUST MUFFLER AND REAR TAILGATE.		1,200.00	400.00
	TO PUTTY,APPLY PRIMER & SPRAY-PAINT ON THE AFFECTED PORTION.		1,200.00	420.00
	TO APPLY RUST-PROOFING ON REPAIRED,REPLACED PANEL.	NOT NECESSARY	200.00	-
	TO REMOVE/TRANSFER TAILGATE COMPONENTS.	NOT NECESSARY	120.00	-

Report Ref No. CS/AGI20013559/Kqd3q2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK WIRING FUNCTIONS.		100.00	10.00
	TO REMOVE/REFIT REAR WINDSCREEN LABOUR.	NOT NECESSARY	220.00	-
			3,040.00	830.00
GRAND TOTAL			10,058.90	2,055.77
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,650.00

Report Ref No. CS/AGI20013559/Kqd3q2

KONG SENG CHEONG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.