

Report No: 0153-20-TCA

22 October 2020

ACCIDENT VEHICLE SURVEY REPORT

Tan Hua Tong
Blk 257C Compassvale Road #09-55
Singapore 543257

VEHICLE INFORMATION:

Vehicle Reg No.:	SJF9982G	Odometer:	173693km
Make & Model:	Mitsubishi Lancer 1.5 GLS	Colour:	Black
Chassis number:	JMYSRCY2A8U008054	Date of accident:	03/01/2020
Year of Regn.:	18/06/2008	Date inspected:	09/01/2020
Repairer at:	Twincar Automotive Pte Ltd 2 Kaki Bukit Ave 2 #01-17 Kaki Bukit Auto Hub Singapore 417921	Date inspected (After Repair):	14/01/2020

STATIC CHECKS, where applicable:

Steering :	serviceable
Footbrake :	serviceable
Handbrake :	serviceable
Paintwork :	Good
General condition :	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
Front:	3mm/Michelin	3mm/Michelin	206/60R16
Rear:	5mm/Toyo	5mm/Toyo	206/60R16

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the rear RH portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

PAR Automotive Consultancy

Parts and Labour Assessment

PARTS

Description of part	Qty	Condition	Repairer's estimate	Our adjustment
REAR BUMPER LOWER SPOILER <i>Repair</i>	1	deformed	688.00	688.00 X.
	Subtotal before discount		S\$ 688.00	S\$ 688.00
Percentage discount 0% and 0%			S\$ 0.00	S\$ 0.00
	Sub-total 1		S\$ 688.00	S\$ 688.00
REAR BUMPER	1	fractured	815.00	815.00 ✓
REAR BUMPER SIDE RETAINER L/R <i>2H NE NW</i>	2	necessary	40.00	40.00 20 ✓
REAR RH BEARING HUB	1	dislodged	415.00	415.00 ✓
REAR RH DOOR	1	buckled	1,008.00	1,008.00 ✓
REAR RH DOOR FRAME BLACK STICKER	1	necessary	38.00	38.00 ✓
REAR RH DOOR INNER TRIM BOARD	1	fractured	618.00	618.00 ✓
REAR RH DOOR MECHANISM LOCK <i>NE NW</i>	1	bent	284.00	284.00 X
REAR RH DOOR WEATHERSTRIP <i>NE NW</i>	1	deformed	127.00	127.00 X
REAR RH FENDER <i>Repair</i>	1	buckled	898.00	898.00 X
REAR RH LOWER ARM	1	bent	135.00	135.00 ✓
REAR RH SHOCK ABSORBER <i>4682</i>	1	bent	194.00	194.00 ✓
REAR RH TORSION ARM	1	bent	65.00	65.00 ✓
REAR RH TRAILING ARM	1	bent	420.00	420.00 ✓
REAR RH UPPER ARM	1	bent	110.00	110.00 ✓
REAR WINDSCREEN GLASS SIDE MOULDING L/R <i>NE NW</i>	2	necessary	64.00	64.00 X
REAR WINDSCREEN GLASS TOP MOULDING <i>NE NW</i>	1	necessary	40.00	40.00 X
RH SIDE SKIRT GARNISH	1	grazed	844.00	844.00 ✓
	Subtotal before discount		S\$ 6,115.00	S\$ 6,115.00
Percentage discount 10% and 10%			S\$ 611.50	S\$ 611.50
	Sub-total 2		S\$ 5,503.50	S\$ 5,503.50
REAR BUMPER CLIPS - SET	1	necessary	50.00	50.00 30 ✓
REAR RH DOOR INNER TRIM BOARD CLIPS - SET	1	necessary	80.00	80.00 30 ✓
REAR RH SPORT RIM	1	abraded <i>590</i>	780.00	780.00 500 ✓
REAR RH TYRE <i>NE NW</i>	1	abraded	400.00	400.00 X
REAR WINDSCREEN GLASS SEALANT <i>NE NW</i>	1	necessary	100.00	100.00 X
RH SIDE SKIRT GARNISH CLIPS - SET	1	necessary	80.00	80.00 30 ✓
	Subtotal before discount		S\$ 1,490.00	S\$ 1,490.00
	Sub-total 3		S\$ 1,490.00	S\$ 1,490.00
	Parts-total		S\$ 7,681.50	S\$ 7,681.50

PAR Automotive Consultancy

LABOUR

To remove and refit rear windscreen(to FR)	150.00	120.00 X
To remove, change rear suspension parts, axle carriage, absorber, lower arm, top arm, trailing arm, knuckle arm, wheel bearing, bearing hub and etc.	300.00	280.00 220
To road test driving, check and resetting wheel alignments system.	150.00	120.00 80
To remove, reinstall roof top trim upholstery, cushion seat, trim garnish, trim liner carpet. (to FR)	150.00	120.00 80
To transfer door glass, regulator gear, motor, railing, channel, trim board, mechanism lock and handle.	100.00	80.00 80
To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	1,500.00	1,250.00 900
To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.	1,600.00	1,250.00 700
To apply anti-rust chemical on repaired and replaced panel.	100.00	90.00 60

2100

Labour Total	SS 4,050.00	SS 3,310.00
Parts & Labour Total	SS 11,731.50	SS 10,991.50

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on Lump Sum repairs is : SS 9,300.00 and the recommended number of working days for the repairs is within 9 day(s).

total: 6903.80

L/S: 5.5K

07 Days.

B J Loi (I Eng., MIMI, AIRTE)

Automotive Appraiser