

CVR Accident Photos

VEHICLE DETAIL

Vehicle No	YN 4220 K	Date Of accident	ACC-SMRT-20-06
Date Booked In		Date of Submission	

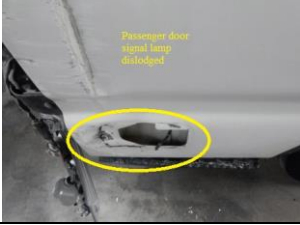
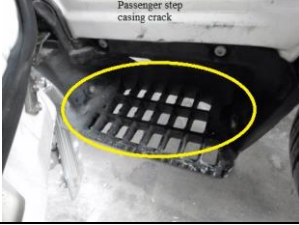
REPAIR DESCRIPTIONS

1. Remove & replace front dented bumper (pic 1)
2. Remove & replace front dented support (pic 2)
3. Remove & replace L/H fog lamp (pic 3)
4. Remove & replace front dented number plate (pic 4)
5. Remove & replace front passenger dented door shell (pic 5,6)
6. Transfer front passenger door inner panel, door handle & accessories to new door shell (pic 5,6)
7. Replace passenger door signal lamp (pic 7)
8. Remove & replace passenger door step casing (pic 8)
9. Remove & replace front L/H signal lamp (pic 9)
10. Remove & replace L/H head lamp (pic 10)
11. Remove & replace radiator grill (pic 11)
12. Replace L/H corner panel (pic 12)
13. Remove & replace L/H rear view mirror (pic 13)
14. Remove & replace wind screen (pic 14,15)
15. Replace wind screen moulding (pic 14,15)
16. Water seepage for wind screen (pic 14,15)
17. Panel beat & align dented passenger door panel (pic 16,17)
18. Align rear L/H dented door (pic 18,19)
19. Align dented driver door (pic 23)
20. Align tilted cabin (refer to photo 16-23)
21. Remove & replace front panel sticker (pic 24)
22. Putty & spray whole complete front cabin (pic 1-24)
23. Wiring for all replacement lighting (3,7,9,10)

PHOTOS OF DAMAGED PARTS

Front bumper dented (pic 1) 	Front bumper support dented (pic 2) 
L/H fog lamp crack (pic 3) 	Front number plate dented (pic 4) 
Passenger door dented (pic 5)	Passenger door dented (pic 6)

CVR Accident Photos

	
Passenger door signal lamp dislodged (pic 7)	Passenger door step casing crack (pic 8)
	
Front L/H signal lamp dislodged (pic 9)	L/H head lamp crack (pic 10)
	
Radiator grill crack (pic 11)	L/H corner panel dislodged (pic 12)
	
L/H rear view mirror crack (pic 13)	Wind screen crack (pic 14)
	
Wind screen crack (pic 15)	Passenger door panel dented (pic 16)
	
Passenger door panel dented (pic 17)	Rear L/H door misalign (pic 18)

CVR Accident Photos

Rear L/H door misalign (pic 19) 	Passenger door misalign (pic 19) 
Passenger door misalign (pic 21) 	Driver door misalign (pic 22) 
Cabin tilted to the right (pic 23) 	YN 4220 K (pic 24) 