

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CS/AIG20013810/EVD3E2

Date: 27/01/2021

REFERENCE

Insured/Claimant:	YEO TECK YEOH	Policy No:	1900022090		
Date of Loss:	13/12/2020	Nature of Claim:	OD	Claim No:	7895136632SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SDJ5569T		
Make & Model:	MITSUBISHI OUTLANDER, 2.0 (A)	Engine No:	4J11AC1944
Reg. Date:	27/03/2019 (Man. Year: 2018)	Chassis No:	GF7W0600544
Colour:	Red	Odometer:	29062 km
Engine Capacity:	1998 cc		
Market Value/New Car Price:	S\$93,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/55R18	Rear Tyre Size:	225/55R18
Front Left Side:	Toyo 4 mm	Rear Left Side:	Toyo 4 mm
Front Right Side:	Toyo 4 mm	Rear Right Side:	Toyo 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,390.97	12,061.26	4,329.71	26.42
Miscellaneous Items	0.00	0.00	0.00	
Labour	10,355.00	8,000.00	2,355.00	22.74
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	26,745.97	20,061.26	6,684.71	24.99
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	26,145.97	19,461.26	6,684.71	25.57
+ GST 7.00/7.00% (S\$)	1,830.22	1,362.29	467.93	25.57
Nett Amount (S\$)	27,976.19	20,823.55	7,152.64	25.57

INSPECTION

Date of Assignment: 15/12/2020

Date Inspected: 15/12/2020 Inspected At:

Cycle & Carriage Automotive Pte Ltd (Pandan Gardens)
209 Pandan Gardens
Singapore 609339

Estimated Period of Repair: 14.0 days

Adjuster: CHEN TSUE YEE

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but

any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FACE,FR BUMPER	Broken	859.00 FL	*859.00 FL
2	1		*BRACKET,FR BUMPER SIDE,RH	Broken	18.00 FL	*18.00 FL
3	1		*GARNISH,FR BUMPER,RH	Cut	48.00 FL	*48.00 FL
4	1		*GARNISH,FR BUMPER SIDE	Cut	220.00 FL	*220.00 FL
5	1		*GARNISH,FR BUMPER SIDE	Cut	112.00 FL	*112.00 FL
6	1		*GARNISH,FR BUMPER SIDE	Cut	48.00 FL	*48.00 FL
7	1		*BRKT,FR BUMPER SIDE,LWR RH	Not Necessary	6.00 FL	*- FL
8	1		*MOULDING,FR BUMPER,RH	Cut	116.00 FL	*116.00 FL
9	1		*MOULDING,FR WHEEL ARCH,RH	Cut	160.00 FL	*160.00 FL
10	1		*MOULDING,RR WHEEL ARCH,RH	Cut	160.00 FL	*160.00 FL
11	1		*MOULDING,RR BUMPER,RH	Cut	106.00 FL	*106.00 FL
12	1		*FENDER,FR RH	Dented	688.00 FL	*688.00 FL
13	1		*GLASS,QTR WINDOW,RH	Necessary	470.00 FL	*470.00 FL
14	1		*COVER,ENG ROOM UNDER,FR	Not Necessary	348.00 FL	*- FL
15	1		*SHIELD,FR WHEELHOUSE,RH	Torn	164.00 FL	*164.00 FL
16	1		*SHIELD,RR WHEEL,FR RH	Not Necessary	128.00 FL	*- FL
17	1		*SHIELD,RR WHEEL,RR RH	Not Necessary	22.00 FL	*- FL
18	1		*PANEL ASSY,FR DOOR,RH	Dented	977.00 FL	*977.00 FL
19	1		*HINGE,FR DOOR,LWR RH	Not Necessary	43.00 FL	*- FL
20	1		*HINGE,FR DOOR,LWR LH	Not Necessary	43.00 FL	*- FL
21	1		*MLDG,F/DR WDO BELT LINE,RH	Not Necessary	88.00 FL	*- FL
22	1		*W/STRIP,FR DR OPNG,OTR RH	Not Necessary	168.00 FL	*- FL
23	1		*PANEL ASSY,RR DOOR RH	Dented	937.00 FL	*937.00 FL
24	1		*HINGE,FR DOOR,LWR RH	Not Necessary	43.00 FL	*- FL
25	1		*HINGE,RR DOOR,UPR RH	Not Necessary	43.00 FL	*- FL
26	1		*MLDG,R/DR WDO BELT LINE,RH	Not Necessary	79.00 FL	*- FL
27	1		*W/STRIP,RR DOOR OPNG,FR RH	Not Necessary	130.00 FL	*- FL
28	1		*TAPE,FR DOOR SASH,RH	Necessary	42.00 FL	*42.00 FL
29	1		*TAPE,RR DOOR SASH	Necessary	42.00 FL	*42.00 FL
30	1		*TAPE,RR DOOR SASH	Necessary	42.00 FL	*42.00 FL
31	1		*GARNISH,FR DOOR,RH	Cut	190.00 FL	*190.00 FL
32	1		*GARNISH,RR DOOR,RH	Cut	164.00 FL	*164.00 FL
33	1		*AIR DAM,SIDE,RH	Cut	541.00 FL	*541.00 FL
34	1		*COVER,DOOR MIRROR,OTR RH	Repeated	138.00 FL	*- FL
35	1		*MIRROR ASSY,DOOR,RH	Missing	555.00 FL	*555.00 FL
36	1		*HEADLAMP ASSY,RH	Cut	1,938.00 FL	*1,938.00 FL
37	1		*LAMP ASSY,FOG,FR RH	Not Necessary	348.00 FL	*- FL
38	2		*WHEEL,DISC	Cut	1,948.00 FL	*1,948.00 FL
39	1		*SHAFT AS,FR AXLE DRIVE,RH	Not Necessary	1,285.00 FL	*- FL
40	1		*HUB ASSY,RR WHEEL	Jammed	432.00 FL	*432.00 FL
41	1		*ARM ASSY,FR SUSP,LWR RH	Not Necessary	323.00 FL	*- FL
42	1		*CROSSMEMBER,FR AXLE NO.1	Not Necessary	1,114.00 FL	*- FL
43	1		*STRUT,FR SUSP,RH	Bent	406.00 FL	*406.00 FL
44	1		*LINK,FR SUSP STABILIZER	Not Necessary	137.00 FL	*- FL
45	1		*BEARING,FR SUSP STRUT	Necessary	32.00 FL	*32.00 FL
46	1		*SHOCK ABSORBER,RR SUSP	Not Necessary	214.00 FL	*- FL
47	1		*INSUL,RR SHOCK ABSORBER	Not Necessary	57.00 FL	*- FL
48	1		*PAD,RR SUSP SPRING,LWR	Not Necessary	19.00 FL	*- FL
49	1		*ARM ASSY,RR SUSP,LWR	Not Necessary	151.00 FL	*- FL
50	1		*ARM ASSY,RR SUSP TRAIL,RH	Not Necessary	501.00 FL	*- FL
51	1		*LINK,RR SUSP ASSIST	Not Necessary	86.00 FL	*- FL

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
52	1		*ARM ASSY,RR SUSP,UPR	Not Necessary	109.00 FL	*- FL
53	1		*END ASSY,TIE ROD	Bent	62.00 FL	*62.00 FL
54	1		*GEAR & LINK ASSY,STEERING	Bent	1,399.00 FL	*1,399.00 FL
55	1		*SUNDRY	Necessary	20.00 FS	*20.00 FS
56	1		*KNUCKLE RH (Supplementary)	Bent	356.00 FL	*356.00 FL
57	1		*SNAP RING,FR WHEEL HUB (Supplementary)	Necessary	25.00 FL	*25.00 FL
58	1		*HUB ASSY,FR WHEEL (Supplementary)	Jammed	286.00 FL	*286.00 FL
59	1		*BEARING,FR WHEEL HUB (Supplementary)	Jammed	151.00 FL	*151.00 FL
60	1		*BRKT,R/BMPR FACE SIDE,RH (Supplementary)	Broken	12.00 FL	*12.00 FL
61	1		*FACE ,RR BUMPER (Supplementary)	Broken	807.00 FL	*807.00 FL
62	1		*PANEL, QTR, OTR RH (Supplementary)	Dented	1,125.00 FL	*1,125.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	21,281.00	15,658.00
- List Item Discount on L Items 23.00/23.00% (\$\$)	4,890.03	3,596.74
Total Parts (\$\$)	16,390.97	12,061.26

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	RENEW FRT BUMPER,FRT FENDER RH,FRT DOOR RH,SIDE SILL RH REAR DOOR RH,REAR FENDER RH,REAR BUMPER,REPAIR BONNET,FRT DOOR FRAME RH,CENTRE PILLAR RH	New	4,050.00	3,600.00
2	REMOVE & INSTALL FRT DOOR TRIMS AND GLASS	New	180.00	180.00
3	REMOVE & INSTALL REAR DOOR TRIMS AND GLASS	New	180.00	180.00
4	REMOVE & INSTALL PARKING SENSOR	New	60.00	60.00
5	SPRAY PAINT FOR FRT BUMPER,FRT FENDER RH,FRT DOOR RH,REAR DOOR RH,BONNET,DOOR PILLAR RH,CENTRE PILLAR RH,REAR FENDER RH,REAR BUMPER	New	3,150.00	2,450.00
6	TO CONDUCT COMPUTERIZE FULL WHEEL ALIGNMENT	New	120.00	120.00
7	TRANSFER FRT RIGHT AND REAR RIGHT RIMS	New	60.00	60.00
8	RENEW FRT UNDER CARRIAGE	New	450.00	450.00
9	RENEW REAR UNDER CARRIAGE	New	450.00	225.00
10	CHECK WIRING & ELECTRICAL SYSTEM	New	30.00	30.00
11	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
12	APPLY SEALANT FOR ACCIDENT PORTION	New	80.00	80.00
13	SUPPLY FRT TYRE	New	480.00	0.00
14	SUPPLY REAR TYRE	New	480.00	0.00
15	REMOVE & INSTALL REAR QUOTAR GLASS	New	180.00	160.00
16	APPLY SEALANT FOR QUOTAT GLASS	New	60.00	60.00
17	REMOVE & INSTALL REAR COMPARTMENT TRIMS REAR FENDER INNER TRIMS SEATS	New	225.00	225.00
Gross Labour Cost (\$\$)			10,355.00	8,000.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >