

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG20014073/GVF3E2
Date: 24/12/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No:
Claimant Vehicle No : FBC920E **Insured Vehicle No :** SLG2200Y
Date of Loss: 14/12/2020 Nature of Claim: TP Claim No: 5376640570SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **FBC920E**
Make & Model: YAMAHA T135, 135cc Engine No: LTA1301313
Reg. Date: 09/11/2007 (Man. Year: 2007) Chassis No: 5YP718567
Colour: White/Blue Odometer: 36430 km
Engine Capacity: 135 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 80/80-17 Rear Tyre Size: 80/90-17
Front Left Side: Timsun 4 mm Rear Left Side: Dunlop 4 mm
Front Right Side: 0 mm Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 17/12/2020
Date Inspected: 18/12/2020 Inspected At: Mcs Auto (HQ)
1100 Serangoon Rd
Singapore 328195
Estimated Period of Repair: 5.0 days

Adjuster: XING GUO QIANG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
1	1		*FRONT FENDER WHEEL GUARD	Broken	0.00 F	*- F	
2	1		*FRONT BRAKE DISC	Jammed	0.00 F	*- F	
3	1		*FRONT FORK ASSY	Bent	0.00 F	*- F	
4	1		*FRONT FORK OIL SEAL	Necessary	0.00 F	*- F	
5	1		*FRONT FORK OIL	Necessary	0.00 F	*- F	
6	1		*FRONT HEADLAMP FAIRING	Cut	0.00 F	*- F	
7	1		*FRONT RH SIGNAL LAMP	Cut	0.00 F	*- F	
8	1		*METER CASING	Cracked	0.00 F	*- F	
9	1		*ERP UNIT	Cut	0.00 F	*- F	
10	1		*STEERING STEM	Bent	0.00 F	*- F	
11	1		*STEERING CONE AND BEARING	Necessary	0.00 F	*- F	
12	1		*HANDLE BAR	Broken	0.00 F	*- F	
13	1		*HANDLE BAR GRIP	Cut	0.00 F	*- F	
14	1		*BRAKE RESERVOIR	Cut	0.00 F	*- F	
15	1		*CLUTCH LEVER	Cut	0.00 F	*- F	
16	1		*HAND BRAKE LEVER	Cut	0.00 F	*- F	
17	2		*SIDE FAIRING	Distorted	0.00 F	*- F	
18	1		*SIDE FAIRNG TOP GARNISH	Deformed	0.00 F	*- F	
19	2		*SIDE FAIRING INNER GARNISH	Distorted	0.00 F	*- F	
20	2		*FAIRING SHIELD	Deformed	0.00 F	*- F	
21	1		*CENTER FAIRING	Cracked	0.00 F	*- F	
22	1		*REAR FAIRING	Cut	0.00 F	*- F	
23	1		*RADIATOR	Cut	0.00 F	*- F	
24	1		*FOOT BRAKE	Cut	0.00 F	*- F	
25	2		*FRONT FOOT REST	Cut	0.00 F	*- F	
26	1		*FOOT GEAR SHIFTER	Bent	0.00 F	*- F	
27	1		*REAR FOOT REST	Cut	0.00 F	*- F	
28	1		*EXHAUST MUFFLER ASSY	Bent	0.00 F	*- F	
29	1		*REAR BOX	Cut	0.00 F	*- F	
					Total Parts (\$\$)	0.00	0.00

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >