



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLW 2745H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET (WCP)	BENT	380.00	300.00
2	BONNET HINGE @\$22.00 (WCP)	BENT / DISTORTED	44.00	44.00
1	BONNET INSULATOR (WCP)	DEFORMED	65.00	65.00
2	BONNET RUBBER (OUTER) @\$15.00 (WCP)	DISTORTED / CUT	30.00	30.00
2	BONNET RUBBER (INNER) @\$15.00 (WCP)	DISTORTED / CUT	30.00	30.00
1	BONNET LOCK (WCP)	BENT	65.00	65.00
1	RH FRONT FENDER (WCP)	BUCKLED	130.00	130.00
1	RH FRONT FENDER SHIELD (WCP)	SERVICEABLE	60.00	-
2	HEADLAMP @\$1000.00 (WCP)	MTG CRACKED	2,000.00	2,000.00
2	HEADLAMP RETAINER @\$32.00 (WCP)	DISTORTED	64.00	64.00
1	RADIATOR GRILLE BASE (WCP)	CRACKED	185.00	185.00
1	RADIATOR GRILLE LOGO (WCP)	NECESSARY	16.00	16.00
1	RADIATOR GRILLE LOGO BASE (WCP)	CRACKED	18.00	18.00
2	RADIATOR GRILLE CHROME MOULDING @\$15.00 (WCP)	CRACKED	30.00	30.00
1	FRONT BUMPER (WCP)	BENT	340.00	340.00
2	FRONT BUMPER SIDE RETAINER @\$6.00 (WCP)	DISTORTED	12.00	12.00
1	RADIATOR GRILLE CHROME GARNISH (WCP)	DENTED	100.00	100.00
1	FRONT BUMPER TOW COVER (WCP)	DENTED / CUT	11.00	11.00
1	FRONT BUMPER LOWER GRILLE (WCP)	CRACKED	150.00	150.00
1	FRONT BUMPER LOWER SPOILER (WCP)	SERVICEABLE	240.00	-
1	FRONT BUMPER REINFORCEMENT (WCP)	BENT	190.00	190.00
1	FRONT SUPPORT PANEL (WCP)	BENT	260.00	260.00
2	AIR GUIDE @\$12.00 (WCP)	CRACKED	24.00	24.00
1	AIR CON CONDENSER (WCP)	PUNCTURE	280.00	280.00
1	AIR CON LIQUID PIPE (WCP)	SERVICEABLE	95.00	-
1	AIR CON DISCHARGE HOSE (WCP)	SERVICEABLE	110.00	-
1	AIR CON SUCTION HOSE (WCP)	SERVICEABLE	110.00	-
1	AIR CON FAN COWLING (WCP)	CRACKED	65.00	65.00
1	AIR CON FAN BLADE (WCP)	SERVICEABLE	35.00	-
1	AIR CON FAN MOTOR (WCP)	SERVICEABLE	180.00	-
1	RADIATOR (WCP)	PUNCTURE	780.00	780.00

Report Ref No. CS/LPC20014074/Kqd3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RADIATOR FAN COWLING (WCP)	CRACKED	50.00	50.00
1	RADIATOR FAN BLADE (WCP)	SERVICEABLE	35.00	-
1	RADIATOR FAN MOTOR (WCP)	SERVICEABLE	160.00	-
1	COOLANT SPARE TANK (WCP)	SERVICEABLE	20.00	-
1	AIR DUCT (WCP)	DENTED	35.00	35.00
1	WIPER WASHER TANK (WCP)	DENTED	90.00	40.00
1	WIPER WASHER TANK NECK (WCP)	SERVICEABLE	12.00	-
1	FRONT BUMPER CENTER GARNISH (WCP)	CRACKED	25.00	25.00
2	FRONT FOG LAMP GARNISH @\$42.00 (WCP)	DENTED / CUT	84.00	84.00
2	FRONT FOG LAMP GARNISH CHROME @\$50.00 (WCP)	SERVICEABLE	100.00	-
1	FRONT NUMBER PLATE GARNISH (WCP)	DENTED	35.00	35.00
1	RADIATOR GRILLE TOP COVER (WCP)	DISTORTED	15.00	15.00
1	FRONT GRILLE STAY (WCP) (ADDITIONAL)	BENT	10.00	10.00
	COST PLUS 15%		1,015.50	822.45
			7,785.50	6,305.45
	<u>SPECIAL NETT ITEMS</u>			
10	BONNET INSULATOR CLIP @\$4.00 (SN)	NECESSARY	40.00	40.00
8	RH FRONT FENDER SHIELD CLIP @\$5.00 (SN)	NOT NECESSARY	40.00	-
10	FRONT BUMPER CLIP @\$4.00 (SN)	NECESSARY	40.00	40.00
1	FRONT NUMBER PLATE (SN)	BENT	45.00	45.00
1	BOTTLE COOLANT (SN)	NECESSARY	40.00	30.00
			205.00	155.00
	<u>LABOUR</u>			
	TO FOCUS HEADLAMP.		50.00	20.00
	TO REMOVE / REFIX AIR CON CONDENSER, PIPE VACUUM AND TOP UP AIR CON GAS.		120.00	100.00
	TO STRAIGHTEN LH / RH FRONT CHASSIS, LH FRONT FENDER, RH FRONT DOOR. CUT / REWELD FRONT SUPPORT PANEL AND REPLACEMENT OF PARTS.		1,000.00	700.00

Report Ref No. CS/LPC20014074/Kqd3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY PAINT ON BONNET, FRONT BUMPER, FRONT BUMPER REINFORCEMENT, FRONT SUPPORT PANEL, LH / RH FRONT CHASSIS, LH / RH FRONT FENDER, RH FRONT DOOR.		1,680.00	1,000.00
			2,850.00	1,820.00
GRAND TOTAL			10,840.50	8,280.45
RECOMMENDED COST OF REPAIRS				8,280.45

Report Ref No. CS/LPC20014074/Kqd3e2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.