



KM AUTO ASSESSORS PTE. LTD.
Insurance Loss Assessors / Adjusters
.....
28 Casuarina Walk
Singapore 574086

T 6448 8208
F 6552 7277
E kmautoassessors@gmail.com
Regn. No. 200907340Z

**AUTOMOBILE
INSPECTION REPORT
NO. 20/3/TP004**

To: ROGER DENG SHEEN HWA
BLK 319A ANCHORVALE DRIVE #04-84 S'PORE 541319

General Condition: ~~Poor~~/Fair/Good/Excellent

Reg. No.	SFA 833 L	Make/Model	HONDA HRV 1.5 DX CVT AUTO	Year	2016
Engine No.	L15B4530371	Chassis No.	JHMRU1810GX200370	Colour	White
Condition of Tyres			Speedometer Reading - Km 039679		
Front N/S	DUNLOP 215/60R16	worn	30 %	Front O/S	DUNLOP 215/60R16 worn 30 %
Rear N/S	DUNLOP 215/60R16	worn	30 %	Rear O/S	DUNLOP 215/60R16 worn 30 %
As Requested By		YOURSELF		On	11-Mar-20 The Above Vehicle

Was Inspected At (11-Mar-20) CHOON HOCK MTR TRDG CO BLK 176 SIN MING DRIVE #05-03 S'PORE 575721

And The Undermentioned Damage Was Noted:-

Tailgate dented and bent, inner frame bent, lock assy. bent and jammed, rubber twisted, kinked, deformed, rear panel dented and bent, bumper assy. grazed, dented, kinked and deformed, fastener torn, fenders bent and distorted, boot floor panel bent.

Photographs:-	83 Copies	were taken at time of inspection and are attached .
The Repairers estimate was for a total amount of	\$	8,151.10
After adjustment the estimate was revised and agreed at	\$	5,749.04

SPECIAL REMARKS

The Repairers were **NOT AUTHORISED** to proceed with the repairs.

Survey was carried out without prejudice.

The above were due to impact to the rear portion of the vehicle.

Alternatively, we recommend that repairs be carried out on a Lump Sum basis instead, @\$4,600/- Nett.

MICHAEL EE Dip.A.Eng., AMIRTE., AMSAE., AMSOE., AMIMI., MSAAA.

Date 27-Mar-20



APPENDIX 'A'
TO REPORT NO: 20/3/TP004
REGN. NO: SFA 833 L

Nature of Work and Materials	Repairers Estimate \$	Remarks	Amount Revised \$
1 pce tailgate	1,150.50	dented & bent	1,150.50
1 pce tailgate inner lock assy.	107.30	bent & jammed	107.30
1 pce tailgate inner lock catch	15.80	necessary	15.80
1 pce tailgate emblem	54.60	not necessary	-
1 pce tailgate "HR-V" plate	39.50	necessary	39.50
1 pce tailgate "i-VTEC" plate	36.10	necessary	36.10
1 pce tailgate glass moulding	87.80	necessary	87.80
1 pce rear panel	450.10	dented & bent	450.10
1 pce rear panel inner garnish	86.50	fasteners snapped	86.50
1 pce rear bumper fascia	532.10	grazed, dented, bent, fastener torn	532.10
2 pcs rear bumper reflectors	311.20	not necessary	-
2 pcs reverse sensors	575.60	grazed, distorted, s/circuited	575.60
			3,081.30
		less 20%	616.26
	3,447.10		2,465.04
S.NETT			
1 pce tailgate glass primer	60.00	necessary	60.00
1 pce tailgate glass sealant	50.00	necessary	50.00
1 set tailgate inner trimcover clips	42.00	necessary	42.00
1 pce tailgate rubber	110.00	twisted, kinked, deformed - necessary	110.00
1 pce rear panel sealant	60.00	necessary	60.00
1 set rear panel inner garnish clips	14.00	necessary	14.00
1 set rear bumper clips	28.00	necessary	28.00
Transfer tailgate glass assy. to new tailgate assy. and refit.	200.00		120.00
Remove tailgate fittings, check, renew damaged fittings, transfer all fittings to new tailgate assy. and refit.	180.00		100.00
Remove necessary interior upholsterys and fittings to enable necessary repairs, check and refit same.	200.00		120.00
Remove lamps, necessary wirings and electrical fittings to enable necessary repairs, check, replace damaged parts, refit same, test electrical-circuit.	60.00		30.00
c/f	4,451.10		3,199.04
Total Amount Revised		\$	
Lump Sum Repairs Amount		\$	
It is estimated that the repairs will take		days to complete.	



TO REPORT NO: 20/3/TP004
REGN. NO: SFA 833 L

2









































