



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2101433

INV Date 30/03/2021

Reference CC4/FCI20014099/Ars3q2

Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SJC 280Z
Insured Veh. SHA2937J
Claim No. D20005089MFSH
Policy No. D-20094922MFSH
Accident Date 14/12/2020
Inspection Date 18/12/2020

Description	Total
Survey Inspection	341.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	341.00
GST (7%)	23.87
Grand Total	364.87

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Ref: CC4/FCI20014099/Ars3q2 Date: 30/03/2021 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SHA2937J	Veh. Inspected	SJC 280Z
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20005089MFSH	Excess (\$)	0.00
Assign From	CHRIS LIM	Assign Date	18/12/2020
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA C-HR	c.c	1797
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	ZYX102013996	Colour	BLACK
Odometer	199324 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	225/50 R18	KAPSEN	6 mm
L/H Front Tyre	225/50 R18	KAPSEN	6 mm
R/H Rear Tyre	225/50 R18	KAPSEN	6 mm
L/H Rear Tyre	225/50 R18	KAPSEN	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	14/12/2020	Inspection Date	18/12/2020
Survey held at	TRIDENT AUTO SERVICE CENTRE PTE LTD 8 KAKI BUKIT AVENUE 4, #02-42, PREMIER @ KAKI BUKIT, SINGAPORE 415875		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJC 280Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT FENDER LH	DENTED	921.60	795.00
1	FRONT FENDER 'HYBRID' EMBLEM LH	NECESSARY	105.90	105.90
1	FRONT FENDER QUARTER GARNISH LH	NOT NECESSARY	132.70	-
1	FRONT DOOR LH	DENTED	1,453.30	1,295.00
1	FRONT DOOR OUTER HANDLE LH	CUT	253.80	253.80
1	FRONT DOOR OUTER HANDLE COVER LH	TO REPAIR SEE LABOUR	111.40	-
1	FRONT DOOR OUTER HANDLE GASKET LH	NECESSARY	58.90	58.90
1	FRONT DOOR OUTER HANDLE COVER GASKET LH	NOT NECESSARY	47.90	-
1	FRONT DOOR TOP HINGE LH	BENT	167.50	97.00
1	FRONT DOOR BOTTOM HINGE LH	NOT NECESSARY	167.50	-
1	FRONT DOOR LOCK LH	NOT NECESSARY	458.20	-
1	FRONT DOOR W/STRIP LH	NOT NECESSARY	229.70	-
1	FRONT DOOR GLASS REGULATOR LH	DAMAGED	456.90	255.00
1	FRONT DOOR GLASS REGULATOR MOTOR LH	DAMAGED	627.90	485.00
1	FRONT DOOR GLASS OUTER MOULDING LH	NECESSARY	313.80	313.80
1	FRONT DOOR GLASS CHANNEL LH	NOT NECESSARY	204.90	-
1	FRONT DOOR GLASS RUN LH	NOT NECESSARY	199.80	-
1	FRONT DOOR OUTER GARNISH LH	NECESSARY	289.60	289.60
1	FRONT DOOR QUARTER GLASS LH	NOT NECESSARY	454.90	-
1	FRONT DOOR QUARTER GLASS MOULDING LH	NOT NECESSARY	122.30	-
1	FRONT DOOR INNER TRIM BOARD LH	CRACKED	998.40	685.00
1	WING MIRROR LH	DAMAGED	984.80	984.80
1	WING MIRROR COVER LH	CRACKED	101.20	101.20
1	WING MIRROR CHROME GARNISH LH	CUT	95.20	95.20
1	REAR DOOR LH	DENTED	1,384.50	1,279.00
1	REAR DOOR W/STRIPE LH	NOT NECESSARY	201.80	-
1	REAR DOOR OUTER GARNISH LH	NECESSARY	251.80	251.80
1	REAR DOOR QUARTER GLASS LH	NOT NECESSARY	374.20	-
1	REAR DOOR QUARTER GLASS MOULDING LH	NOT NECESSARY	99.90	-
1	FRONT FENDER INNER GARNISH	CRACKED	128.00	128.00

Report Ref No. CC4/FCI20014099/Ars3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-2,849.58	-1,868.50
			8,548.72	5,605.50
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT FENDER ARCH GARNISH CLIPS LH (SN)	NECESSARY	50.00	20.00
1	SET FRONT FENDER INNER SHIELD CLIPS LH (SN)	NECESSARY	50.00	20.00
1	SET FRONT DOOR INNER TRIM BOARD CLIPS LH (SN)	NECESSARY	100.00	30.00
1	SET FRONT DOOR PROTECTOR CLIPS LH (SN)	NECESSARY	50.00	30.00
1	SET REAR DOOR INNER TRIM BOARD CLIPS LH (SN)	NOT NECESSARY	100.00	-
1	SET REAR DOOR PROTECTOR CLIPS LH (SN)	NECESSARY	50.00	20.00
1	SET REAR FENDER ARCH GARNISH CLIPS LH (SN)	NECESSARY	50.00	20.00
1	SET REAR FENDER INNER SHIELD CLIPS LH (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIPS (SN)	NOT NECESSARY	100.00	-
			600.00	140.00
	<u>LABOUR</u>			
	TO REPAIR "A" PILLAR LH,REPAIR REAR FENDER LH,REPLACE FRONT FENDER LH AND BOTH LH DORS PLUS RE-ALIGN ON ALL ACCIDENT AFFECTED AREAS.		1,000.00	800.00
	TO PUTTY AND RESPRAY ON LH ACCIDENT PORTION.		1,500.00	1,100.00
	TO CHECK LH LIGHTING AND WIRING.		100.00	80.00
	TO APPLY ANTI-RUST CORROSION ON AFFECTED AREAS.		200.00	30.00
	TO TRANSFER FRONT DOOR LH MECHANISM TO NEW DOOR.		300.00	80.00
	TO TRANSFER REAR DOOR LH MECHANISM TO NEW DOOR.		300.00	80.00
	TO REMOVE AND REFIT UPHOLSTERY,LINING,GARNISH ETC TO ASSIST REPAIR.		300.00	80.00
			3,700.00	2,250.00
	GRAND TOTAL		12,848.72	7,995.50



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,400.00
---	--	--	-----------------

Report Ref No. CC4/FCI20014099/Ars3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJC 280Z

INSPECTION

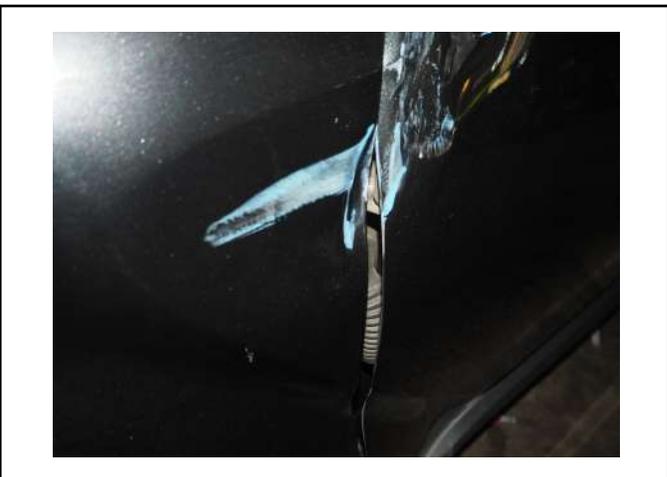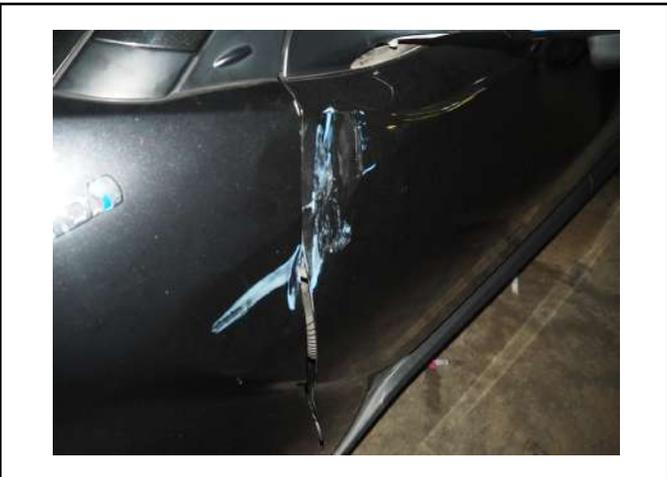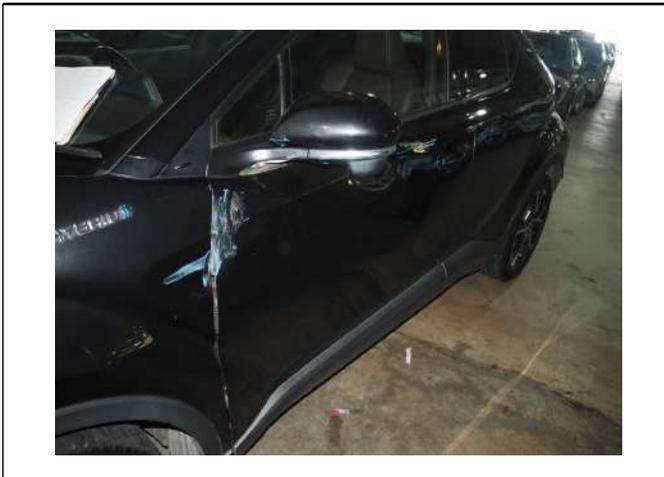



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

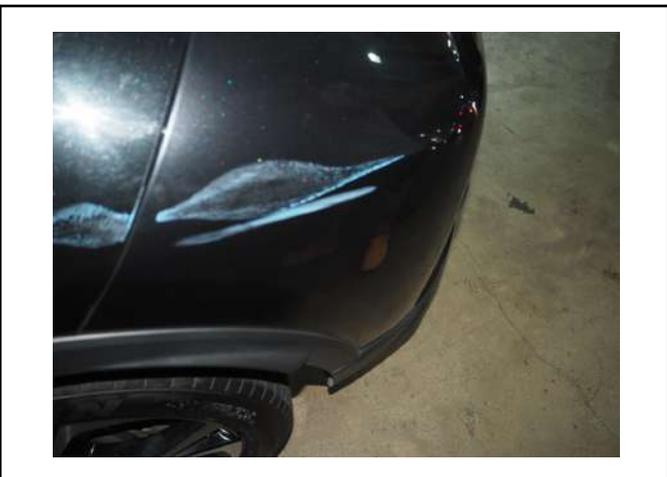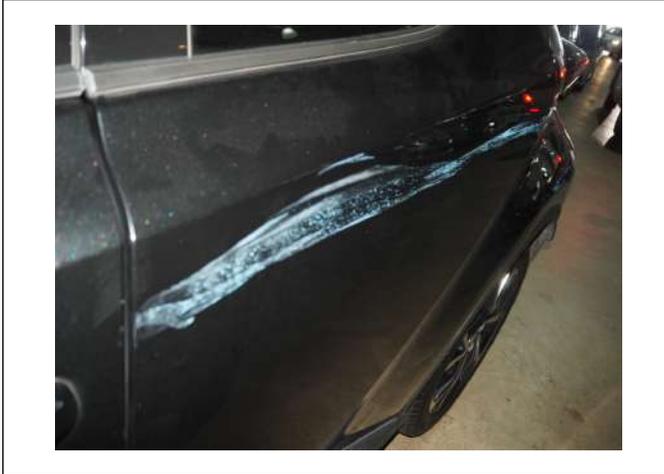



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJC 280Z

RE-INSPECTION

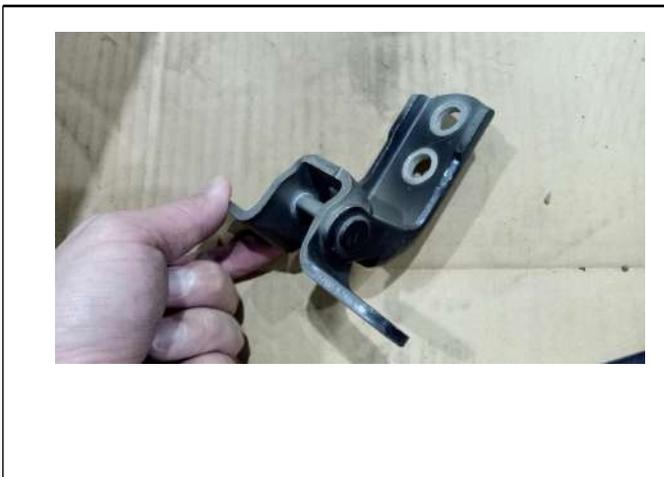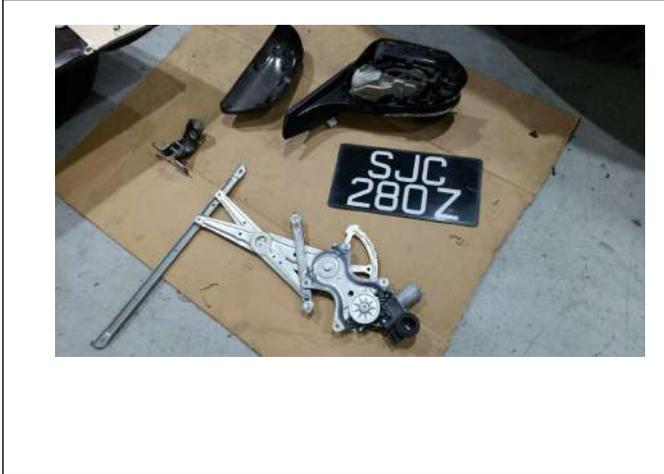



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

