

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG20014234/T1EA3Q2
Date: 15/09/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1700014771
Claimant Vehicle No :	SMD6148T	Insured Vehicle No :	SLN9613G
Date of Loss:	18/12/2020	Nature of Claim:	TP
		Claim No:	2690125253SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMD6148T	Engine No:	G4FGJU232930
Make & Model:	HYUNDAI ELANTRA, 1.6 AD GLS (A)	Chassis No:	KMHD841CMJU726142
Reg. Date:	29/08/2018 (Man. Year: 2018)	Odometer:	63558 km
Colour:	Red		
Engine Capacity:	1591 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Yokohama 6 mm	Rear Left Side:	Yokohama 6 mm
Front Right Side:	Yokohama 6 mm	Rear Right Side:	Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	23,643.23	12,837.09	10,806.14	45.71
Miscellaneous Items	0.00	0.00	0.00	
Labour	9,300.00	3,220.00	6,080.00	65.38
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	32,943.23	16,057.09	16,886.14	51.26
Approved Total (Overridden) (S\$)		12,850.00		

(S\$)	32,943.23	12,850.00	20,093.23	60.99
+ GST 7.00/7.00% (S\$)	2,306.03	899.50	1,406.53	60.99
Nett Amount (S\$)	35,249.26	13,749.50	21,499.76	60.99
+ Car Rental (14.0 x S\$100.00/day + 7.00% GST) (S\$)		1,498.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		15,254.95		
Global Sum Settlement (S\$)		15,250.00		

INSPECTION

Date of Assignment: 21/12/2020

Date Inspected: 23/12/2020

Estimated Period of Repair: 10.0 days

Inspected At:

AP Automotive Services Pte Ltd (HQ)
 Blk 9006 Tampines Street 93, #01-202
 Singapore 528840

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Not Necessary	1,925.46 FL	*- FL
2	2		*BONNET HINGE L+R	Not Necessary	137.40 FL	*- FL
3	1		*BONNET LOCK	Not Necessary	141.29 FL	*- FL
4	1		*BONNET LOCK CATCH	Not Necessary	74.12 FL	*- FL
5	2		*HEADLAMP L+R	Cracked	3,527.70 FL	*3,527.70 FL
6	2		*HEADLAMP BRACKET L+R	Not Necessary	71.50 FL	*- FL
7	1		*FRONT BUMPER	Cracked	491.65 FL	*491.65 FL
8	1		*FRONT BUMPER TOP SEAL	Not Necessary	101.23 FL	*- FL
9	1		*FRONT BUMPER LOGO-HYUNDAI	Necessary	62.50 FL	*62.50 FL
10	1		*SET FRONT BUMPER GRILLE COMPLETE	Cracked	1,091.62 FL	*1,091.62 FL
11	1		*FRONT BUMPER FOG LAMP L+R	N/S Not Necessary / O/SCracked	556.80 FL	*278.40 FL
12	2		*FRONT BUMPER FOG LAMP GARNISH L+R	Cracked	160.60 FL	*160.60 FL
13	1		*FRONT BUMPER LOWER LIP	Deformed	271.45 FL	*271.45 FL
14	1		*FRONT BUMPER RETAINER L+R	N/S Not Necessary /O/SDeformed	130.20 FL	*65.10 FL
15	1		*FRONT BUMPER REINFORCEMENT BAR	Bent	695.89 FL	*695.89 FL
16	1		*FRONT BUMPER BEAM	Cracked	471.45 FL	*471.45 FL
17	1		*FRONT BUMPER SPONGE	Cracked	121.75 FL	*121.75 FL
18	1		*FRONT BUMPER UNDERCOVER	Torn	289.74 FL	*289.74 FL
19	2		*FRONT FENDER COWLING L+R	Torn	351.30 FL	*351.30 FL
20	1		*FRONT SUPPORT PANEL	Not Necessary	967.12 FL	*- FL
21	1		*FRONT SUPPORT PANEL TOP GARNISH	Not Necessary	86.25 FL	*- FL
22	1		*AIRCON CONDENSOR	Bent	761.90 FL	*761.90 FL
23	2		*AIRCON CONDENSOR AIRGUIDE L+R	Deformed	180.40 FL	*180.40 FL
24	1		*RADIATOR	Not Necessary	545.79 FL	*- FL
25	1		*RADIATOR COWLING	Not Necessary	154.62 FL	*- FL
26	1		*RADIATOR FAN BLADE	Not Necessary	201.70 FL	*- FL
27	1		*RADIATOR SPARE TANK	Not Necessary	115.32 FL	*- FL
28	2		*FRONT HORN	Not Necessary	153.10 FL	*- FL
29	1		*WIPER WASHER TANK	Not Necessary	151.87 FL	*- FL
30	1		*BOOTLID	Bent	1,791.35 FL	*1,791.35 FL
31	1		*BOOTLID LOGO-HYUNDAI	Necessary	51.00 FL	*51.00 FL
32	1		*BOOTLID EMBLEM -ELANTRA	Necessary	74.50 FL	*74.50 FL
33	1		*BOOTLID EMBLEM -ELITE	Necessary	72.61 FL	*72.61 FL
34	1		*BOOTLID LAMP L+R	N/S Not Necessary / O/SCracked	1,344.60 FL	*672.30 FL
35	1		*BOOTLID SWITCH	Not Necessary	279.40 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
36	2		*BOOTLID NUMBER PLATE LAMP L+R	Not Necessary	131.00 FL	*- FL
37	1		*BOOTLID LOCK	Bent	135.15 FL	*135.15 FL
38	1		*BOOTLID LOCK CATCH	Not Necessary	74.50 FL	*- FL
39	1		*BOOTLID INNER TRIM	Not Necessary	291.70 FL	*- FL
40	2		*BOOTLID HINGE L+R	Not Necessary	160.40 FL	*- FL
41	1		*BOOTLID WEATHERSTRIP	Cut	101.73 FL	*101.73 FL
42	1		*TAIL LAMP L+R	N/S Not Necessary / O/SCracked	1,753.90 FL	*876.95 FL
43	2		*TAIL LAMP PANEL L+R	Not Necessary	537.82 FL	*- FL
44	1		*REAR BUMPER	Cracked	467.50 FL	*467.50 FL
45	2		*SET REAR BUMPER REVERSE SENSOR	Not Working	341.30 FL	*341.30 FL
46	1		*REAR BUMPER REFLECTOR L+R	N/S Not Necessary / O/S Cut	174.20 FL	*87.10 FL
47	1		*REAR BUMPER LOWER	Cut	257.60 FL	*257.60 FL
48	2		*REAR BUMPER RETAINER L+R	Necessary	145.90 FL	*145.90 FL
49	1		*REAR BUMPER REINFORCEMENT BAR	Bent	367.41 FL	*367.41 FL
50	1		*REAR BUMPER SPONGE	Not Necessary	135.45 FL	*- FL
51	1		*REAR BUMPER UNDERCOVER	Not Necessary	286.80 FL	*- FL
52	1		*REAR FENDER INNER TRIM L+R	N/S Not Necessary / O/S Torn	512.62 FL	*256.31 FL
53	2		*REAR FENDER COWLING L+R	Not Necessary	351.30 FL	*- FL
54	2		*REAR FENDER AIRVENT L+R	Not Necessary	158.90 FL	*- FL
55	1		*END PANEL	Bent	477.10 FL	*477.10 FL
56	1		*END PANEL TOP GARNISH	Deformed	112.20 FL	*112.20 FL
57	1		*SPAREWHEEL PANEL	Repair	663.70 FL	*- FL
58	1		*SPAREWHEEL PANEL TOP BOARD	Deformed	511.90 FL	*511.90 FL
59	1		*EXHAUST PIPE	Not Necessary	693.61 FL	*- FL
60	2		*EXHAUST MOUNTING	Not Necessary	123.40 FL	*- FL
61	1		*EXHAUST HEAT SHIELD	Not Necessary	156.77 FL	*- FL
62	10		*FRONT BUMPER CLIPS	Necessary	100.00 FS	*30.00 FS
63	1		*FRONT NUMBER PLATE	Bent	80.00 FS	*45.00 FS
64	20		*FRONT FENDER COWLING CLIPS	Not Necessary	200.00 FS	*- FS
65	10		*FRONT SUPPORT PANEL TOP GARNISH CLIPS	Not Necessary	100.00 FS	*- FS
66	1		*RADIATOR COOLANT	Not Necessary	100.00 FS	*- FS
67	1		*BOOTLID SPOILER SEALANT	Necessary	120.00 FS	*40.00 FS
68	10		*BOOTLID INNER TRIM CLIPS	Not Necessary	100.00 FS	*- FS
69	4		*TAIL LAMP CLIPS	Not Necessary	40.00 FS	*- FS
70	2		*TAIL LAMP PANEL SEALANT	Not Necessary	240.00 FS	*- FS
71	1		*REAR NUMBER PLATE	Bent	80.00 FS	*45.00 FS
72	10		*REAR BUMPER CLIPS	Necessary	100.00 FS	*30.00 FS
73	20		*REAR FENDER INNER TRIM CLIPS	Necessary	200.00 FS	*40.00 FS
74	20		*REAR FENDER COWLING CLIPS	Necessary	200.00 FS	*40.00 FS
75	1		*END PANEL SEALANT	Necessary	200.00 FS	*60.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
76	10		*END PANEL TOP GARNISH CLIPS	Necessary	100.00 FS	*10.00 FS
77	1		*SPAREWHEEL PANEL SEALANT	Not Necessary	300.00 FS	*- FS
F=Franchise part. S=SpcNett. L=ListItemDisc.						
					Sub Total (\$)	28,989.04
					- List Item Discount on L Items 20.00/20.00% (\$)	5,345.81
					Total Parts (\$)	23,643.23

15,961.36**3,124.27****12,837.09**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	SPRAY PAINT ON AFFECTED AREAS	New	2,600.00	1,400.00
2	PANEL BEATING ON AFFECTED AREAS	New	2,600.00	1,400.00
3	TO RNR REAR EXHAUST	New	250.00	0.00
4	TO CHECK WIRING AND HEADLAMP FOCUS	New	150.00	0.00
5	TO CHECK WIRING AND FOGLAMP FUNCTION	New	150.00	0.00
6	TO CHECK WIRING AND TAIL LAMP FUNCTION }	New	150.00	30.00
7	TO CHECK WIRING AND TAILGATE LAMP FUNCTION }	New	150.00	0.00
8	TO RNR REAR INNER TRIM AND UPHOLSTERY	New	600.00	60.00
9	TO CHECK WATER LEAK	New	150.00	0.00
10	TO RNR FRONT AIR CON CONDENSOR AND TOP UP GAS	New	300.00	100.00
11	TO RNR FRONT RADIATOR	New	250.00	0.00
12	TO RNR FUEL TANK	New	250.00	0.00
13	TO PERFORM DIAGNOSTIC AND CLEAR FAULTS	New	600.00	100.00
14	TO RNR REAR BOOTLID MECHANISM	New	350.00	60.00
15	TO RNR REAR REVERSE SENSOR AND CHECK FUNCTION	New	150.00	30.00
16	TO PERFORM RUST PROOFING	New	600.00	40.00
Gross Labour Cost (\$\$)			9,300.00	3,220.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >