

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933  
Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/AIG20014291/GQD3E2  
**Date:** 04/01/2021

### REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1900251504		
<b>Claimant Vehicle No</b>	SJQ9251A	<b>Insured Vehicle No :</b>	SMQ7318U		
Date of Loss:	20/12/2020	Nature of Claim:	TP	Claim No:	5848503154SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJQ9251A	Engine No:	G4FC9U656155
Make & Model:	HYUNDAI AVANTE, 1.6 (A)	Chassis No:	KMHU41BR9U762765
Reg. Date:	30/05/2009 (Man. Year: 2009)	Odometer:	148818 km
Colour:	Grey		
Engine Capacity:	1591 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	185/65 R18	Rear Tyre Size:	185/65 R18
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment:	21/12/2020	
Date Inspected:	23/12/2020	Inspected At: Bluwel Automotive Service Pte Ltd (HQ) 1 Kaki Bukit Avenue 6, #01-28/37/53/55/56 Autobay@Kaki Bukit Singapore 417883
Estimated Period of Repair:	4.0 days	

**Adjuster:** XING GUO QIANG

**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER	Deformed	0.00 F	*- F
2	1		*FRT BUMPER CLIPS	Necessary	0.00 F	*- F
3	1		*FRT BUMPER SIDE RETAINER	Deformed	0.00 F	*- F
4	1		*FRT BUMPER REINFORCEMENT	* Check	0.00 F	*- F
5	1		*FRT BUMPER SPONGE	* Check	0.00 F	*- F
6	1		*FRT SUPPORT PANEL	* Check	0.00 F	*- F
7	1		*FRT RH HEADLAMP ASSY	Cut	0.00 F	*- F
8	1		*BONNET	Repair	0.00 F	*- F
9	1		*FRT RH FENDER	Buckled	0.00 F	*- F
					<b>Total Parts (S\$)</b>	<b>0.00</b>
						<b>0.00</b>

F=Franchise part.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.
---

< END OF ESTIMATES >