

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933  
Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/AIG20014341/T1VD3E2  
**Date:** 05/01/2021

### REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100476926		
<b>Claimant Vehicle No</b>	SGP8249E	<b>Insured Vehicle No :</b>	SGQ808P		
Date of Loss:	19/12/2020	Nature of Claim:	TP	Claim No:	9769101238SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SGP8249E	Engine No:	1ZZ2748096
Make & Model:	TOYOTA WISH, 1.8 (A)	Chassis No:	ZNE100336619
Reg. Date:	27/12/2006 (Man. Year: 2006)	Odometer:	349617 km
Colour:	Silver		
Engine Capacity:	1794 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	185/65 R15	Rear Tyre Size:	185/65 R15
Front Left Side:	Yokohama 6 mm	Rear Left Side:	Yokohama 6 mm
Front Right Side:	Yokohama 6 mm	Rear Right Side:	Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment:	22/12/2020		
Date Inspected:	23/12/2020	Inspected At:	A-Tec Automotive Pte Ltd (Kaki Bukit) 8 Kaki Bukit Ave 4, #04-20 Premier Singapore 415875
Estimated Period of Repair:	8.0 days		

**Adjuster:** MOHD TAUFIKH BIN HAMID

**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT LH DOOR	Bent	0.00 F	*- F
2	1		*FRT LH DOOR STICKER	Necessary	0.00 F	*- F
3	1		*FRT LH DOOR WEATHERSTRIP	Necessary	0.00 F	*- F
4	1		*FRT LH DOOR OUTER HANDLE	Distorted	0.00 F	*- F
5	1		*FRT LH DOOR WINDOW LIFTER	Bent	0.00 F	*- F
6	1		*FRT LH DOOR INNER TRIM BOARD	* Check	0.00 F	*- F
7	1		*FRT LH DOOR INNER LOCK	* Check	0.00 F	*- F
8	1		*FRT LH DOOR OUTER MOULDING	Deformed	0.00 F	*- F
9	1		*FRT LH WING MIRROR	Cracked	0.00 F	*- F
10	1		*FRT LH FENDER	Bent	0.00 F	*- F
11	1		*FRT LH FENDER SIGNAL LAMP	Missing	0.00 F	*- F
12	1		*FRT LH FENDER INNER SHIELD	Deformed	0.00 F	*- F
13	1		*FRT LH WHEEL RIM	Cut	0.00 F	*- F
14	1		*FRT LH LOWER ARM	* Check	0.00 F	*- F
15	1		*FRT LH KNUCKLE ARM	* Check	0.00 F	*- F
16	1		*FRT LH KNUCKLE ARM BEARING	* Check	0.00 F	*- F
17	1		*FRT LH SHOCK ABSORBER	* Check	0.00 F	*- F
18	1		*REAR LH DOOR	Dented	0.00 F	*- F
19	1		*ROCKER PANEL LH	Bent	0.00 F	*- F
F=Franchise part.						
					<b>Total Parts (\$\$)</b>	<b>0.00 0.00</b>

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.
---

< END OF ESTIMATES >