

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:**

CC4/AIG20014621/AGA3Q2

**Date:**

18/05/2021

**REFERENCE**

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

**Claimant Vehicle No :** SJX5462Y

Date of Loss: 25/12/2020

Policy No:

**Insured Vehicle No :**

SLW7378B

Nature of Claim:

TP

Claim No:

7963168997SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE**Reg No: **SJX5462Y**

Make &amp; Model: PROTON PERSONA, 1.6 (M)

Reg. Date: 24/06/2010 (Man. Year: 2010)

Colour: White

Engine Capacity: 1597 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

Engine No: S4PHQH3616

Chassis No: PL1CM6SNRAG260622

Odometer: 198272 km

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

|                          |     |                         |     |                          |     |
|--------------------------|-----|-------------------------|-----|--------------------------|-----|
| General Condition:       |     | Steering (Serviceable): | Yes | Footbrake (Serviceable): | Yes |
| Handbrake (Serviceable): | Yes | Engine Modification:    | No  | Pre-accident Condition:  |     |

**CONDITION OF TYRES**

|                   |               |                  |               |
|-------------------|---------------|------------------|---------------|
| Front Tyre Size:  | 205/50 R16    | Rear Tyre Size:  | 205/50 R16    |
| Front Left Side:  | Tourador 6 mm | Rear Left Side:  | Tourador 6 mm |
| Front Right Side: | Tourador 6 mm | Rear Right Side: | Tourador 6 mm |

*The above values represent the remaining tyre treads depth*

| <b>COST OF CLAIMS</b>                    | <b>Repairer's</b> | <b>Adjuster's</b> | <b>Difference</b> | <b>Diff %</b> |
|------------------------------------------|-------------------|-------------------|-------------------|---------------|
| Parts                                    | 4,753.10          | 2,452.50          | 2,300.60          | 48.40         |
| Miscellaneous Items                      | 0.00              | 0.00              | 0.00              |               |
| Labour                                   | 4,000.00          | 1,880.00          | 2,120.00          | 53.00         |
| Paintwork Labour                         | 0.00              | 0.00              | 0.00              |               |
| Towing                                   | 0.00              | 0.00              | 0.00              |               |
| <b>Calculated Gross Total (S\$)</b>      | <b>8,753.10</b>   | <b>4,332.50</b>   | <b>4,420.60</b>   | <b>50.50</b>  |
| <b>Approved Total (Overridden) (S\$)</b> |                   | <b>3,400.00</b>   |                   |               |

|                                                 |                 |                 |                 |              |
|-------------------------------------------------|-----------------|-----------------|-----------------|--------------|
| <b>Nett Amount (S\$)</b>                        | <b>8,753.10</b> | <b>3,400.00</b> | <b>5,353.10</b> | <b>61.16</b> |
| <b>+ Loss of Use (6.0 x S\$50.00/day) (S\$)</b> |                 | 300.00          |                 |              |
| <b>+ Doc/Search Fee (S\$)</b>                   |                 | 7.45            |                 |              |
| <b>Nett Liability (S\$)</b>                     |                 | <b>3,707.45</b> |                 |              |

INSPECTION

Date of Assignment: 28/12/2020

Date Inspected: 29/12/2020

Inspected At:

Ishare Auto Pte. Ltd. (HQ)  
 8 KAKI BUKIT AVENUE 4 #08-09 PREMIER @ KAKI BUKIT  
 Singapore 415875

Estimated Period of Repair: 6.0 days

**Adjuster:** ADRIAN LING**Manager:** Chong Pui Lin

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

| No. | Qty | Part No. | Particulars                                     | Condition     | Repairer's | Amount     |
|-----|-----|----------|-------------------------------------------------|---------------|------------|------------|
| 1   | 1   |          | *REAR BUMPER                                    | Deformed      | 460.00 FL  | *460.00 FL |
| 2   | 2   |          | *REAR BUMPER REFLECTOR                          | Not Necessary | 170.00 FL  | *- FL      |
| 3   | 2   |          | *REAR BUMPER SIDE RETAINER                      | Necessary     | 90.00 FL   | *90.00 FL  |
| 4   | 1   |          | *REAR BUMPER REINFORCEMENT                      | Dented        | 370.00 FL  | *280.00 FL |
| 5   | 2   |          | *REAR NUMBER PLATE LAMP                         | Not Necessary | 90.00 FL   | *- FL      |
| 6   | 1   |          | *REAR NUMBER PLATE LAMP HOLDER GARNISH          | Not Necessary | 79.00 FL   | *- FL      |
| 7   | 1   |          | *BOOTLID                                        | Buckled       | 890.00 FL  | *890.00 FL |
| 8   | 1   |          | *BOOTLID EMBLEM PERSONA                         | Necessary     | 50.00 FL   | *50.00 FL  |
| 9   | 1   |          | *BOOTLID EMBLEM 1.6                             | Necessary     | 35.00 FL   | *35.00 FL  |
| 10  | 1   |          | *BOOTLID HINGE                                  | Not Necessary | 95.00 FL   | *- FL      |
| 11  | 1   |          | *BOOTLID TOP LOCK                               | Not Necessary | 120.00 FL  | *- FL      |
| 12  | 1   |          | *BOOTLID LOWER LOCK                             | Not Necessary | 35.00 FL   | *- FL      |
| 13  | 1   |          | *BOOTLID WEATHERSTRIP                           | Not Necessary | 130.00 FL  | *- FL      |
| 14  | 2   |          | *TAILLAMP                                       | Not Necessary | 640.00 FL  | *- FL      |
| 15  | 2   |          | *REAR FENDER INNER COWLING                      | Not Necessary | 190.00 FL  | *- FL      |
| 16  | 1   |          | *REAR END PANEL                                 | Dented        | 395.00 FL  | *395.00 FL |
| 17  | 1   |          | *REAR END PANEL TOP GARNISH                     | Deformed      | 125.00 FL  | *125.00 FL |
| 18  | 1   |          | *REAR FLOOR PANEL TOP BOARD                     | Not Necessary | 195.00 FL  | *- FL      |
| 19  | 1   |          | *REAR NUMBER PLATE                              | Dented        | 80.00 FS   | *50.00 FS  |
| 20  | 1   |          | *SET REAR BUMPER CLIP                           | Necessary     | 80.00 FS   | *30.00 FS  |
| 21  | 1   |          | *SET REAR NUMBER PLATE LAMP HOLDER GARNISH CLIP | Not Necessary | 60.00 FS   | *- FS      |
| 22  | 1   |          | *BOOTLID SEALANT                                | Not Necessary | 150.00 FS  | *- FS      |
| 23  | 1   |          | *SET BOOTLID MOULDING CLIP                      | Not Necessary | 60.00 FS   | *- FS      |
| 24  | 1   |          | *SET TAILLAMP CLIP                              | Not Necessary | 40.00 FS   | *- FS      |
| 25  | 1   |          | *SET REAR FENDER COWLING CLIP                   | Not Necessary | 80.00 FS   | *- FS      |
| 26  | 1   |          | *SET REAR FENDER INNER TRIM CLIP                | Not Necessary | 80.00 FS   | *- FS      |
| 27  | 1   |          | *SET REAR END PANEL TOP GARNISH CLIP            | Necessary     | 40.00 FS   | *20.00 FS  |
| 28  | 1   |          | *REAR END PANEL INSULATION SEAL                 | Necessary     | 120.00 FS  | *60.00 FS  |
| 29  | 1   |          | *SET REVERSE SENSOER                            | Damaged       | 220.00 FS  | *200.00 FS |

F=Franchise part. S=SpcNett. L=ListItemDisc.

|                                                            |                 |                 |
|------------------------------------------------------------|-----------------|-----------------|
| <b>Sub Total (\$\$)</b>                                    | <b>5,169.00</b> | <b>2,685.00</b> |
| <b>- List Item Discount on L Items 10.00/10.00% (\$\$)</b> | 415.90          | 232.50          |
| <b>Total Parts (\$\$)</b>                                  | <b>4,753.10</b> | <b>2,452.50</b> |

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

| No                              | Particulars                                                                                    | Lab.Type | Repairer's      | Amount          |
|---------------------------------|------------------------------------------------------------------------------------------------|----------|-----------------|-----------------|
| <b><u>Labour Items</u></b>      |                                                                                                |          |                 |                 |
| 1                               | PANEL BEATING ,REMOVAL AND REPLACING PARTS                                                     | New      | 1,400.00        | 800.00          |
| 2                               | TO SPRAY PAINT AFFECTED AREA                                                                   | New      | 1,400.00        | 800.00          |
| 3                               | TUFF COAT                                                                                      | New      | 250.00          | 60.00           |
| 4                               | WIRING CHECK                                                                                   | New      | 150.00          | 30.00           |
| 5                               | REMOVE AND REFIX CUSHION SEAT /UPHOLSTERY AND ROOF LINING TO FACILITATE REPAIR                 | New      | 250.00          | 60.00           |
| 6                               | REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING                                           | New      | 80.00           | 50.00           |
| 7                               | TRANFER BOOTLID MECHANISM                                                                      | New      | 60.00           | 0.00            |
| 8                               | CONDUCT WATER LEAKAGE TEST                                                                     | New      | 80.00           | 0.00            |
| 9                               | REMOVE AND REFIX REAR BUMPER PLATE AND RESEAL                                                  | New      | 150.00          | 80.00           |
| 10                              | TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC | New      | 180.00          | 0.00            |
| <b>Gross Labour Cost (\$\$)</b> |                                                                                                |          | <b>4,000.00</b> | <b>1,880.00</b> |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >