



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2102152

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 01/04/2021
Reference CC4/FCI20014671/T1ea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SMW 2414B
Insured Veh. SHA 968H
Claim No. D21000020MFSH/1
Policy No. D-20094921MFSH
Accident Date 22/12/2020
Inspection Date 04/01/2021

Description	Total
Survey Inspection	524.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	524.00
GST (7%)	36.68
Grand Total	560.68

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20014671/T1ea3q2 Date: 01/04/2021 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHA 968H	Veh. Inspected	SMW 2414B	
Policy No.	D-20094921MFSH	Coverage (\$)	0.00	
Claim No.	D21000020MFSH/1	Excess (\$)	0.00	
Assign From	ERIC	Assign Date	29/12/2020	
2. Vehicle Particulars & Condition				
Make & Model	OPEL GRANDLAND	c.c	1199	
Engine No.	HIDDEN	Year of Reg.	2020	
Chassis No.	W0VZRHNS4L6024671	Colour	RED	
Odometer	2754 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/65 R17	MICHELIN	7 mm	
L/H Front Tyre	215/65 R17	MICHELIN	7 mm	
R/H Rear Tyre	215/65 R17	MICHELIN	7 mm	
L/H Rear Tyre	215/65 R17	MICHELIN	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	22/12/2020	Inspection Date	04/01/2021	
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMW 2414B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRT DOOR RH	NOT NECESSARY	2,331.00	-
1	RR DOOR RH	BENT	2,505.00	2,505.00
1	RR DOOR OUTER HANDLE RH	NOT NECESSARY	154.00	-
1	RR DOOR OUTER HANDLE KNOB RH	NOT NECESSARY	86.00	-
1	RR DOOR BLACK STICKER RH	NECESSARY	138.00	138.00
1	RR DOOR PROTECTOR RH	CUT	253.00	253.00
1	RR DOOR GLASS OUTER MOULDING RH	* CHECK	134.00	-
1	RR DOOR RUBBER BEADING RH	CUT	134.00	134.00
1	RR DOOR LOCK RH	NOT NECESSARY	327.00	-
1	RR DOOR STRIKER RH	NOT NECESSARY	120.00	-
1	RR FENDER RH	NOT NECESSARY	2,698.00	-
1	RR FENDER WHEELARCH GARNISH RH	CUT	280.00	280.00
1	RR FENDER INNERSHIELD RH	* CHECK	180.00	-
1	RR FENDER OUTER QUARTER GARNISH RH -CHROME	NOT NECESSARY	412.00	-
1	RR FENDER OUTER QUARTER GLASS RH	NOT NECESSARY	516.00	-
1	RR BUMPER	CUT	1,309.00	1,309.00
1	RR BUMPER RH	DEFORMED	634.00	634.00
1	RR BUMPER LOW GARNISH (SILVER)	NOT NECESSARY	438.00	-
1	RR BUMPER MLDG LOW RH	NOT NECESSARY	139.00	-
1	RR BUMPER SIDE RETAINER RH (INNER) -BRACKET	NECESSARY	120.00	120.00
1	RR BUMPER SIDE RETAINER RH (OUTER) -GUIDE	NECESSARY	256.00	256.00
1	RR BUMPER CENTER RETAINER -ENERGY ABSORBER	NOT NECESSARY	158.00	-
1	RR BUMPER REVERSE SENSOR	NOT NECESSARY	184.00	-
1	RR BUMPER REVERSE SENSOR WIRE HARNESS	NOT NECESSARY	268.00	-
1	RR RIM RH -7.5J X 19	CUT	1,095.00	1,095.00
1	RR WHEEL BEARING RH-WITH HUB	* CHECK	451.00	-
1	RR SHOCK ABSORBER RH	* CHECK	274.00	-
1	RR AXLE BEAM ASSY	NOT NECESSARY	2,592.00	-
	LESS 10% DISCOUNT		-1,818.60	-672.40
			16,367.40	6,051.60

Report Ref No. CC4/FCI20014671/T1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
10	FENDER INNERSHIELD CLIP (SN)	NECESSARY	40.00	10.00
10	RR BUMPER CLIP (SN)	NECESSARY	40.00	30.00
1	RR TYRE RH (90%) (SN)	CUT	400.00	360.00
10	RR FENDER WHEELARCH CLIP (SN)	NECESSARY	40.00	10.00
1	RR QUARTER GLASS SEALANT (SN)	NOT NECESSARY	65.00	-
1	RR QUARTER GLASS INNER SEAL (SN)	NOT NECESSARY	45.00	-
1	RR QUARTER GLASS SOLER FILM (SN)	NOT NECESSARY	180.00	-
			810.00	410.00
	<u>LABOUR</u>			
	TO DISMANTLE /RENEW THE ACCIDENT DAMAGED PORTION ,TO PANEL BEATING ,RESHAPE ,STRAIGHTEN ,ORIENTATE AND ALIGN REPAIR /REPLACEMENT PARTS.		1,200.00	600.00
	CARRY OUT SPRAY PAINTING ON AFFECTED AREA ,FRT DOOR RH ,RR DOOR RH,RR FENDER RH ,RR BUMPER ,RH ROCKER PANEL.		1,200.00	600.00
	TO DISCONNECT FRONT WIRE HARNESS OF ELECTRICAL COMPONENT TO FACILITATE REPAIRS ,RECONNECT AND CHECK ELECTRICAL FUNCTION AFTER.		120.00	60.00
	REMOVE AND REFIX SEAT CUSHION /UPHOLSTERY & ROOF LINING TO FACILITATE REPAIRS.		200.00	60.00
	TO REMOVE AND REFIX REVERSE SENSOR AND CONDUCT TEST .		120.00	30.00
	TO CONDUCT WATER LEAKAGE TEST AFTER REPAIRS OF VEHICLE .	NOT NECESSARY	80.00	-
	TO CONDUCT ANTI RUST OF UNDER CARRIAGE TUFF COAT.	* CHECK	80.00	-
	TRANSFER OF INTERNAL MECHANISM FROM OLD DOOR PANEL TO NEW DOOR PANEL.		200.00	60.00
	TO APPLY DOOR SEALANT TO DOOR .		80.00	40.00
	REMOVE AND REPLACE RHR UNDER CARRIAGE PARTS.	* CHECK	400.00	-
	TO CONDUCT 4 WHEEL ALIGNMENT.		180.00	80.00
	TO REMOVE AND REFIT FUEL TANK TO FACILITATE ACCIDENT REPAIR .	NOT NECESSARY	200.00	-
	TO REMOVE AND REFIX REAR QUARTER GLASS .	NOT NECESSARY	180.00	-
	TO CONDUCT RESET OF ABS LIGHT ON .	NOT NECESSARY	350.00	-

Report Ref No. CC4/FCI20014671/T1ea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PERFORM ENGINE DIAGNOSIS RESET FAULT CODE.	* CHECK	350.00	-
			4,940.00	1,530.00
GRAND TOTAL			22,117.40	7,991.60
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (REPAIR COST NOT CONCLUDE) (EXCLUDE CHECK ITEMS S\$1,315.10 NETT)				6,400.00

Report Ref No. CC4/FCI20014671/T1ea3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMW 2414B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

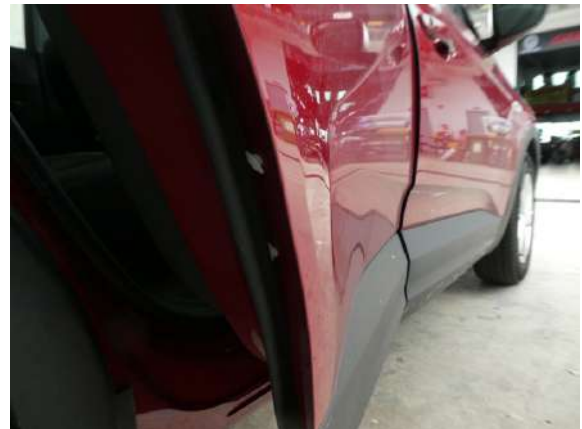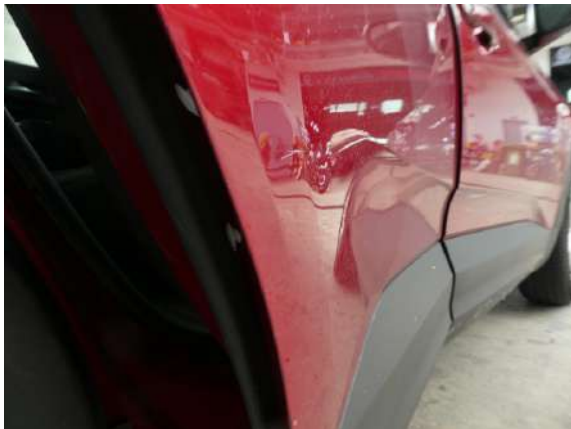



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMW 2414B

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

