LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No:

CS/TMI20014763/R1QD3E2

Claim No:

Date:

08/01/2021

REFERENCE

Handling Insurer:

Tokio Marine Insurance Singapore Ltd

Policy No:

MJ001442

Claimant Vehicle No

SHA9565C

Insured Vehicle No:

SLU9852X

M2006464

Date of Loss: 30/12/2020

Nature of Claim:

ΤP

Engine No:

Chassis No:

Odometer:

KMHLB41UMHU097793

D4FDGU673770

515052 km

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:

SHA9565C Make & Model: HYUNDAI 140, 1.7 D CRDi (A)

Reg. Date: 22/12/2016 (Man. Year: 2016)

Colour: Yellow

Engine Capacity: Market Value/New Car Price:

1685 cc N/A

Sum Insured (S\$):

Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Handbrake (Serviceable): Good

Steering (Serviceable): **Engine Modification:** Yes

Yes No

Footbrake (Serviceable): Pre-accident Condition:

Yes Average

CONDITION OF TYRES

Front Tyre Size: Front Left Side: Front Right Side: 205/60R16 Hankook 5 mm Hankook 5 mm

Rear Tyre Size: Rear Left Side: Rear Right Side: 205/60R16 Hankook 5 mm

Hankook 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,254.00	0.00	1,254.00	100.00
Miscellaneous Items	11.00	11.00	0.00	0.00
Labour	680.00	480.00	200.00	29.41
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	1,945.00	491.00	1,454.00	74.76
+ GST 7.00/7.00% (S\$)	136.15	34.37	101.78	74.76
Nett Amount (S\$)	2,081.15	525.37	1,555.78	74.76

INSPECTION

Adjuster:

Date of Assignment:

30/12/2020

Present Location:

ComfortDelGro Engineering Pte Ltd (Loyang) ComfortDelGro Engineering Pte Ltd (Loyang)

Date Inspected:

30/12/2020

Inspected At:

59 Loyang Drive Singapore 508969

Estimated Period of Repair:

MOHD RASUL

2.0 days

Manager:

SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 07 Jan 2021)

Parts: 143 HYUNDAI I40 1.7 D CRDi (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SHA9565C)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF

ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Reference	Amount
1	1		*REAR BUMPER ASSY	Repair	1,106.00 FL	-	*- FL
2	10		*REAR BUMPER CLIPS	Not Necessary	22.00 FL	-	*- FL
3	1		*REAR BUMPER SPONGE	Not Necessary	119.50 FL	-	*- FL
4	1		*REAR BUMPER REFLECTOR LH	Not Necessary	32.00 FL	-	*- FL
5	1		*REAR BUMPER UNDER COVER	Not Necessary	288.00 FL	-	*- FL
F=Fra	anchise	part. L=ListIte	mDisc.	-			
				Sub Total (S\$)	1,567.50	0.00	
			- List Item Discount or	n L Items 20.00/20.00% (S\$)	313.50	0.00	
				Total Parts (S\$)	1,254.00		0.00
			Report was unsubmitte	d during this print-out.			

Recommended Miscellaneous Items

No Qty Particulars			Repairer's	Amount		
Miscellaneous Items						
1	1	OD/TP Case (Insurer)		11.00	11.00	
			Sub Total (S\$)	11.00	11.00	

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount			
Lab	Labour Items						
1	PANEL BEATING	New	300.00	280.00			
2	SPRAYPAINT	New	300.00	200.00			
3	REMOVE/REFIX REVERSE SENSOR	New	80.00	0.00			
		Gross Labour Cost (S\$)	680.00	480.00			
	Report was unsubmitted during this print-out.						

< END OF ESTIMATES >