

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/AIG20014765/UVD3Q2

Date: 18/01/2021

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No:

Claimant
Vehicle No : SJJ6969U **Insured Vehicle No :** SLW5634A

Date of Loss: 23/12/2020 **Nature of Claim:** TP **Claim No:** 7201444317SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJJ6969U		
Make & Model:	AUDI A5, 2.0 SB TFSI S TRONIC (DESIGN) (A)	Engine No:	CVK050829
Reg. Date:	02/02/2018 (Man. Year: 2017)	Chassis No:	WAUZZZF56JA050012
Colour:	Red/Black	Odometer:	57680 km
Engine Capacity:	1984 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	265/35ZR19	Rear Tyre Size:	265/35ZR19
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,750.75	4,850.02	11,900.73	71.05
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,200.00	1,910.00	4,290.00	69.19
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	22,950.75	6,760.02	16,190.73	70.55
Approved Total (Overridden) (\$\$)		5,400.00		
(\$\$)	22,950.75	5,400.00	17,550.75	76.47
+ GST 7.00/7.00% (\$\$)	1,606.55	378.00	1,228.55	76.47
Nett Amount (\$\$)	24,557.30	5,778.00	18,779.30	76.47

INSPECTION

Date of Assignment: 29/12/2020

Date Inspected: 05/01/2021 Inspected At:

Kaizen Motors Pte Ltd (HQ)
68 KAKI BUKIT AVE 6, #02-12 ARK
@ KAKI BUKIT
Singapore 417896

Estimated Period of Repair: 5.0 days

Adjuster: MARCUS CHUA

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Deformed/Torn	2,343.00 F	*2,322.00 FL
2	1		*REAR BUMPER TOW COVER	Not Necessary	46.00 F	*- FL
3	1		*REAR BUMPER RETAINER	Cracked	186.12 F	*186.12 FL
4	2		*REAR BUMPER REFLECTOR	Not Necessary	126.00 F	*- FL
5	1		*REAR BUMPER CHROME SIDE GARNISH	N/s Cracked	795.50 F	*397.75 FL
6	1		*REAR BUMPER CHROME CENTER GARNISH	Twisted	455.35 F	*455.35 FL
7	1		*REAR BUMPER DIFFUSER	Twisted/Cracked	983.50 F	*983.50 FL
8	1		*REAR REINFORCEMENT BEAM	Bent	655.30 F	*655.30 FL
9	1		*REAR BOOT	Not Necessary	1,983.50 F	*- FL
10	1		*REAR BOOT TRIMMING	Not Necessary	253.86 F	*- FL
11	1		*REAR END PANEL	Repair	867.32 F	*- FL
12	1		*REAR END PANEL TRIMMING	Not Necessary	559.30 F	*- FL
13	1		*REAR SPARE TIRE WHEEL COMPARTMENT	Not Necessary	986.00 F	*- FL
14	2		*REAR TAIL LAMP OUTER	Not Necessary	1,786.00 F	*- FL
15	2		*REAR TAIL LAMP INNER	Not Necessary	1,724.00 F	*- FL
16	1		*REAR EXHAUST	Repair	2,650.00 F	*- FL
17	1		*SET REAR BUMPER CLIPS	Necessary	200.00 FS	*50.00 FS
18	10		*REAR TAIL LAMP CLIPS	Not Necessary	50.00 FS	*- FS
19	1		*SET REAR BUMPER DIFFUSER CLIPS	Necessary	50.00 FS	*50.00 FS
20	10		*REAR BOOT TRIMMING CLIPS	Not Necessary	50.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	16,750.75	5,100.02
- List Item Discount on L Items 0.00/5.00% (S\$)	0.00	250.00
Total Parts (S\$)	16,750.75	4,850.02

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	LABOUR FOR CHECKING ON WIRING	New	250.00	50.00
2	LABOUR FOR DISMANTLING & REPLACING OF ACCIDENT DAMAGED PARTS,INCLUDING WELDING,KNOCKING,REPAIRING,STRAIGHTENING,RESHAPE & ADJUSTMENT OF REAR END ASSY & PARTS	New	2,800.00	800.00
3	SPRAYPAINTING & PUTTY OF REAR BUMPER,REAR BOOT,REAR DIFFUSER	New	1,800.00	600.00
4	LABOUR FOR DIAGNOS & ERASE FAULT MEMORIES	New	550.00	100.00
5	WRAPPING OF REAR BUMPER & DIFFUSER	New	800.00	360.00
Gross Labour Cost (S\$)			6,200.00	1,910.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >