

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG21000114/KEA3Q2
Date: 11/10/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100466465
Claimant Vehicle No :	ER828A	Insured Vehicle No :	SLC5529B
Date of Loss:	20/12/2020	Nature of Claim:	TP
		Claim No:	2202398518SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	ER828A	Engine No:	2AZF985915
Make & Model:	TOYOTA ALPHARD, 2.4 Welcab AX (A)	Chassis No:	ANH208246551
Reg. Date:	18/10/2012 (Man. Year: 2012)	Odometer:	92426 km
Colour:	Metallic Silver		
Engine Capacity:	2362 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	235/50 R18	Rear Tyre Size:	235/50 R18
Front Left Side:	Bridgestone 8 mm	Rear Left Side:	Bridgestone 8 mm
Front Right Side:	Bridgestone 8 mm	Rear Right Side:	Bridgestone 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	280.00	260.00	20.00	7.14
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	280.00	260.00	20.00	7.14
+ Loss of Use (1.0 x S\$100.00/day) (S\$)		100.00		

(S\$)	360.00
Liable Amount (20.00%) (S\$)	72.00

INSPECTION

Date of Assignment: 04/01/2021

Date Inspected: 05/01/2021

Estimated Period of Repair: 1.0 days

Inspected At:

Yap Motor Repair Service (HQ)
19 Block 7 Sin Ming Industrial Estate Sector C #01-82
Singapore 575642

Adjuster: KENNETH KONG**Manager:** Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	KNOCK }	New	280.00	260.00
2	SPRAYPAINTING }	New	0.00	0.00
Gross Labour Cost (S\$)			280.00	260.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >