# LKK Auto Consultants #01-25 Paya Ubi Industrial Park, 51 Ubi Avenue 1 408933

Insurer Reference: SLD2093E Repairer Reference: A0167

Date calculated: 06/01/2021 10:07 AM

Full Report Registration: SLD2093E Printed: 06/01/2021 10:07 AM

### **Summary Information**

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

Hire Car End:

(Singapore) Pte Ltd

Printed by: KK LAU Claim Reference: SLD2093E

Estimated Repair Time: Actual Repair Days:

Currency: SGD
Date of Incident: 21/12/20
Hire Car Start:

**Vehicle Details** 

Vehicle

Manufacturer: MITSUBISHI

Model: LANCER (CY,CX,CZ)

Sub Model: EX

Model Sheet Number: 32 39 57 Registration: SLD2093E

VIN number: JMYSRCY1AGU004550

Odometer:

**Model Specs** 

FROM 03/2016 AIR CONDITIONING FOG LAMPS 1.6 LTR 85/86/91KW

4-DOOR SALOON TWO COAT METALLIC PREPARE OFF VEHICLE


#### **Vehicle Condition**

#### **Vehicle Status**

Pre-Accident Damage: Date of Inspection:

#### **Damage Areas**

All ✓ Underbody

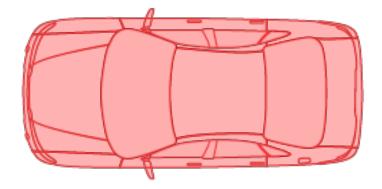

### Labour

Time Base 10 WU/h		Time Base 10 WU/h Price = 42.00		
Code	Description	WU	Price SGD	
NO NUMBER	PREPARATION TIME	2.0	8.40	
514110 00	R + R FRONT BUMPER	8.0	33.60	
NO NUMBER	RENEW FRONT BUMPER (REMOVED) INCLUDES: R + R FOG LAMPS AND NECESSARY ATTACHED PARTS	12.0	50.40	
422022 10)	R + R L/F WING INCLUDES: R + R HEADLAMP AND WHEELARCH TRIM	9.0	37.80	
NO NUMBER	ADJUST HEADLAMPS	2.0	8.40	
1019	L/F PANEL REPAIR	10.0*	42.00	
1167	L/F UP W-HOUSE REINF REPAIR	10.0*	42.00	
0340	FRT BUMPER REINF CHECK			
0637	L/F FOG LAMP CPL CHECK			
	Labour Cost Panel / Mechanical Labour	Hrs WU 5.30 53.0	222.60	
	Total of Labour		222.60	

## **Paint**

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRT BUMPER REINF SURFACE PAINT	4.0
	L/F WING NEW PART PAINTING	10.0
	FRONT BUMPER COVER NEW PART PAINT K1R	13.0
	L/F PANEL SURFACE PAINT	4.0
	L/F UP W-HOUSE REINF SURFACE PAINT	4.0
	LEFT FRONT DOOR SURFACE PAINT	8.0

### **Paint Material Per Part**

Code	Description	Price SGD
0340	FRT BUMPER REINF SURFACE PAINT	2.49
0741	L/F WING NEW PART PAINTING	21.16
0283	FRONT BUMPER COVER NEW PART PAINT K1R	64.94
1019	L/F PANEL SURFACE PAINT	0.50
1167	L/F UP W-HOUSE REINF SURFACE PAINT	1.49
1481	LEFT FRONT DOOR SURFACE PAINT	22.16

Labour Cost - Paint		Hrs	wu	<b>Price SGD</b>
Factor	42.00 SGD/h			
Time Paint			43.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total	10 WU/h	7.30	73.0	306.60

Material Cost - Paint	Price SGD
New Part Painting	21.16
New Part Painting - Plastic K1R	64.94
Surface-/Blend Paint	26.64
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	150.34

# **Spare Parts**

Code	Description	Part Number	Part Source	prices as at 2015-06-01 Price SGD
0283 0410 0355 0741 0575	FRONT BUMPER COVER GRILLE L/F BUMPER BRACKET L/F WING LEFT HEADLAMP ASSY	6400H438 7450A780 6400F549 5220G043 8301C373	Original Original Original Original Original	390.00 290.00 18.00 210.00 410.00
f: OEM Parts n: Non-OEM Parts u: Used parts	Savings Subtotal Fixed Sundry Parts Total	Price		0.00 1,318.00 100.00 1,418.00

### **Final Calculation**

	SGD	SGD
Parts	1,318.00	
Fixed Sundry Parts Price	100.00	
Total Parts		1,418.00
Labour Time Base 10 WU/h		
Total 53.0 WU X 42.00 SGD/h	222.60	
Total of Labour		222.60
Paint Work Time Base 10 WU/h		
Labour Cost 73.0 WU X 42.00 SGD/h	306.60	
Material Cost	150.34	
Total Paint Including Material		456.94
Repair Cost Excludes GST		2,097.54
GST (+7.0%)		146.83
Repair Cost Included GST		2,244.37

#### Comments

\* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

#### **Assessment Note**

No assessment notes entered.