



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKE 8317C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR BOOT	BENT	971.50	971.50
1	REAR BOOT EMBLEM "JAZZ"	NECESSARY	68.20	68.20
1	REAR BOOT LOCK	SERVICEABLE	289.50	-
1	REAR BOOT RUBBER	NECESSARY	129.30	129.30
8	REAR BOOT TRIM CLIPS @\$3.90	NECESSARY	31.20	31.20
1	TAILLAMP LH	CRACKED	299.20	299.20
1	REAR PANEL	TO REPAIR SEE LABOUR	376.50	-
1	REAR PANEL TRIM	CRACKED	90.80	90.80
1	REAR BUMPER	DEFORMED	597.50	597.50
10	REAR BUMPER CLIPS @\$3.90	NECESSARY	39.00	39.00
2	REAR BUMPER RETAINER L+R @\$26.50	SERVICEABLE	53.00	-
1	SET REAR WINDSCREEN MOULDING	NECESSARY	313.20	313.20
	LESS 20% DISCOUNT		-651.78	-507.98
			2,607.12	2,031.92
<b><u>SPECIAL NETT ITEMS</u></b>				
1	REAR BUMPER SENSOR (SN)	NOT WORKING	220.00	200.00
1	REAR NUMBER PLATE (SN)	SERVICEABLE	35.00	-
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	60.00
			335.00	260.00
<b><u>LABOUR</u></b>				
	TO CUT & WELD REAR END PANEL TO REPAIR REAR FLOOR PANEL,REAR FENDER L+R,REAR CHASSIS MEMBER,TO REMOVE & REFIX DAMAGED PARTS STRAIGHTEN & REALIGN AFFECTED AREAS.INCLUSIVE OF THE REPAIR OF REAR PANEL.		650.00	500.00
	TO SPRAY AFFECTED AREAS.		750.00	600.00
	TO REMOVE & REFIX REAR WINDSCREEN GLASS.		180.00	120.00
	TO REMOVE & REFIX REAR BOOT MECHANISM CHECK & TEST UP WIPER MOTOR & CENTRE LOCKING SYSTEM.	NOT NECESSARY	80.00	-
	TO REMOVE & REFIX REAR LAGGAGE COMPARTMENT SIDE COVER,SIDE GARNISH & OTHER ATTACHMENT PARTS.		80.00	60.00

Report Ref No. CS/SMO21000146/R1Uqd3q2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO INSTALL REVERSE SENSOR & CHECK WATER SEEPAGE.		40.00	40.00
	TO RUST PROOF AFFECTED AREAS.		60.00	40.00
			1,840.00	1,360.00
GRAND TOTAL			4,782.12	3,651.92
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,900.00

Report Ref No. CS/SMO21000146/R1Uqd3q2

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.