

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/CTI21000231/GQD3E2

Date: 29/01/2021

REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNA00029462000
Claimant Vehicle No: GY4711R Insured Vehicle No: GBA3109Y
Date of Loss: 02/01/2021 Nature of Claim: TP Claim No: SNM21D200054C02/IRENE

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: GY4711R
Make & Model: TOYOTA HIACE, 2.5 (A) Engine No: 2KD1250355
Reg. Date: 18/04/2005 (Man. Year: 2005) Chassis No: JTFHS02P500013874
Colour: Silver Odometer: 383389 km
Engine Capacity: 2494 cc
Market Value/New Car Price: N/A
Sum Insured (\$\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195 R15 Rear Tyre Size: 195 R15
Front Left Side: Yokohama 5 mm Rear Left Side: Yokohama 5 mm
Front Right Side: Yokohama 5 mm Rear Right Side: Yokohama 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 19/01/2021
Date Inspected: 06/01/2021 Inspected At: 8 Kaki Bukit Avenue 4 Premier @ Kaki Bukit #01-51
Estimated Period of Repair: 10.0 days Repairer : 1st Auto Pro Pte Ltd (HQ)

Adjuster: XING GUO QIANG

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

A)THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$8,000.00 -\$10,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 29 Jan 2021)	
Parts:	N/A	TOYOTA HIACE 2.5 (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GY4711R)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >