

## LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

### VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building, 78 Shenton Way, #09-16  
Singapore 079120

**Our File No:** CS/AIG21000446/EQF3Q2

**Date:** 19/02/2021

#### REFERENCE

Insured/Claimant:	NG WEE WEE,SOPHIA	Policy No:	2070153495
Date of Loss:	11/01/2021	Nature of Claim:	OD
		Claim No:	3125356525SG

#### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>SMV9916D</b>	Engine No:	G4FGKH755599
Make & Model:	KIA CERATO, 1.6 (A)	Chassis No:	KNAF3416ML5069507
Reg. Date:	29/10/2020 (Man. Year: 2019)	Odometer:	3895 km
Colour:	Grey		
Engine Capacity:	1591 cc		
Market Value/New Car Price:	S\$86,000.00		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

#### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

#### CONDITION OF TYRES

Front Tyre Size:	205/55R16	Rear Tyre Size:	205/55R16
Front Left Side:	Kumho 4 mm	Rear Left Side:	Kumho 4 mm
Front Right Side:	Kumho 4 mm	Rear Right Side:	Kumho 4 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	4,972.40	4,039.20	933.20	18.77
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,725.00	4,805.00	1,920.00	28.55
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (S\$)</b>	<b>11,697.40</b>	<b>8,844.20</b>	<b>2,853.20</b>	<b>24.39</b>
<b>+ GST 7.00/7.00% (S\$)</b>	<b>818.82</b>	<b>619.09</b>	<b>199.73</b>	<b>24.39</b>
<b>Nett Amount (S\$)</b>	<b>12,516.22</b>	<b>9,463.29</b>	<b>3,052.93</b>	<b>24.39</b>

#### INSPECTION

Date of Assignment:	11/01/2021	
Date Inspected:	11/01/2021	Inspected At: Cycle & Carriage KIA Pte Ltd (Pandan Gardens) 209 Pandan Gardens Singapore 609339
Estimated Period of Repair:	7.0 days	

**Adjuster:** CHEN TSUE YEE

**Manager:** SHIAU CHAN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*PANEL ASSY-BACK	Dented	324.00 FL	*324.00 FL
2	1		*W/STRIP-TRUNK LID OPNG	Crushed	100.00 FL	*100.00 FL
3	1		*LATCH ASSY-TRUNK LID	Cut	112.00 FL	*112.00 FL
4	1		*STRIKER ASSY-TRUNK LID	Not Necessary	40.00 FL	*- FL
5	1		*PANEL ASSY-TRUNK LID	Dented	1,297.00 FL	*1,297.00 FL
6	1		*HINGE ASSY-TRUNK LID,LH	Not Necessary	97.00 FL	*- FL
7	1		*HINGE ASSY-TRUNK LID,RH	Not Necessary	97.00 FL	*- FL
8	1		*LOGO ASSY-KIA SUB	Necessary	32.00 FL	*32.00 FL
9	1		*EMBLEM-CERATO	Necessary	28.00 FL	*28.00 FL
10	1		*BRACKET ASSY-RR BPR SIDE UPR,L	Not Necessary	25.00 FL	*- FL
11	1		*BRACKET ASSY-RR BPR SIDE UPR,R	Not Necessary	31.00 FL	*- FL
12	1		*COVER-RR BUMPER UNDER,RH	Not Necessary	33.00 FL	*- FL
13	1		*STAY-RR BUMPER LH	Bent	65.00 FL	*65.00 FL
14	1		*STAY-RR BUMPER RH	Bent	65.00 FL	*65.00 FL
15	1		*ANTENNA ASSY-SMARTKEY	Not Necessary	46.00 FL	*- FL
16	1		*BEAM-RR BUMPER	Broken	318.00 FL	*318.00 FL
17	1		*BRACKET-RR BEAM UPR MTG,LH	Not Necessary	9.00 FL	*- FL
18	1		*BRACKET-RR BEAM UPR MTG,LH	Not Necessary	9.00 FL	*- FL
19	1		*BRACKET-RR BEAM LWR,CTR	Broken	6.00 FL	*6.00 FL
20	2		*BRACKET-RR BEAM LWR MTG	Not Necessary	12.00 FL	*- FL
21	1		*EXTN WIRING ASSY-BWS	Broken	207.00 FL	*207.00 FL
22	1		*LAMP ASSY-SIDE T/SIGNAL,LH	Not Necessary	181.00 FL	*- FL
23	1		*LAMP ASSY-SIDE T/SIGNAL,RH	Not Necessary	181.00 FL	*- FL
24	1		*COVER-RR BUMPER FOG LAMP,LH	Not Necessary	19.00 FL	*- FL
25	1		*COVER-RR BUMPER FOG LAMP,RH	Cut	19.00 FL	*19.00 FL
26	2		*GROMMET ASSY-SCREW	Necessary	4.00 FL	*4.00 FL
27	10		*CLIP BUMPER	Necessary	10.00 FL	*10.00 FL
28	1		*COVER-RR BUMPER	Broken	651.00 FL	*651.00 FL
29	1		*COVER-RR BUMPER LWR	Broken	241.00 FL	*241.00 FL
30	1		*COVER-RR BUMPER UNDER,LH	Not Necessary	33.00 FL	*- FL
31	10		*CLIP	Necessary	10.00 FL	*10.00 FL
32	1		*TRIM ASSY-RR TRANSVERSE	Not Necessary	41.00 FL	*- FL
33	1		*SUNDRIES	Necessary	50.00 FS	*20.00 FS
34	1		*C&C LOGO	Necessary	40.00 FS	*40.00 FS
35	1		*REAR PARKING SENSOR	Not Necessary	220.00 FS	*- FS
36	1		*NEW K3 2020 BODY KITS	Broken	1,188.00 FS	*1,188.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (S\$)</b>	<b>5,841.00</b>	<b>4,737.00</b>
<b>- List Item Discount on L Items 20.00/20.00% (S\$)</b>	868.60	697.80
<b>Total Parts (S\$)</b>	<b>4,972.40</b>	<b>4,039.20</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
<b>Miscellaneous Items</b>				
1	1	*OD/TP Case (Insurer)	-	0.00
<b>Sub Total (\$\$)</b>			<b>0.00</b>	<b>0.00</b>

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	RENEW ACCIDENT DAMAGED PARTS ON REAR BOOT LID,REAR BUMPER,REAR BODY KITS,CUT/WELD REAR END PANEL,REPAIR BOTH REAR FENDER	New	2,000.00	1,600.00
2	REMOVE AND INSTALL PARKING ASSISTANCE	New	60.00	60.00
3	REMOVE AND INSTALL REAR CABIN TO FACILITATE REPAIR WORK	New	120.00	120.00
4	REMOVE AND REPLACE REAR BODY KITS	New	80.00	80.00
5	PAINT WORK SPRAY REAR FLOOR PANEL,REAR END PANEL,REAR BOOT LID,REAR BUMPER,REAR BODY KITS,RH REAR FENDER,LH REAR FENDER AND AFFECTED PORTION	New	2,800.00	1,400.00
6	APPLY BODY SEALANT	New	120.00	80.00
7	CHECK WIRING AND CHASSIS ELECTRICAL SYSTEM	New	30.00	30.00
8	PERFORM RUST PREVENTION	New	120.00	120.00
9	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	40.00
10	REPAIR RH TAIL LAMP HOUSING, RH REAR FENDER, AND REAR FLOOR PANEL (Supplementary)	New	400.00	400.00
11	RESPRAY RH TAIL LAMP HOUSING, RH REAR FENDER, & REAR FLOOR PANEL (Supplementary)	New	875.00	875.00
<b>Gross Labour Cost (\$\$)</b>			<b>6,725.00</b>	<b>4,805.00</b>

Report was unsubmitted during this print-out.

**< END OF ESTIMATES >**