

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CS/AIG21000497/EQD3E2

Date: 15/02/2021

REFERENCE

Insured/Claimant: CHANG SENG KEONG Policy No:
Date of Loss: 08/01/2021 Nature of Claim: OD Claim No: 6556128009SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SME8137G**
Make & Model: MITSUBISHI ATTRAGE, 1.2 (A) Engine No: 3A92UHH5714
Reg. Date: 18/10/2018 (Man. Year: 2018) Chassis No: MMBSTA13AJH003678
Colour: Red Odometer: 35532 km
Engine Capacity: 1193 cc
Market Value/New Car Price: S\$54,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 185/55 R15 Rear Tyre Size: 185/55 R15
Front Left Side: Bridgestone 4 mm Rear Left Side: Bridgestone 4 mm
Front Right Side: Bridgestone 4 mm Rear Right Side: Bridgestone 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	6,511.13	4,653.15	1,857.98	28.54
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,700.00	4,760.00	940.00	16.49
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	12,211.13	9,413.15	2,797.98	22.91
- Excess (S\$)	500.00	500.00	0.00	0.00
(S\$)	11,711.13	8,913.15	2,797.98	23.89
+ GST 7.00/7.00% (S\$)	819.78	623.92	195.86	23.89
Nett Amount (S\$)	12,530.91	9,537.07	2,993.84	23.89

INSPECTION

Date of Assignment: 12/01/2021

Date Inspected: 11/01/2021 Inspected At:

Cycle & Carriage Automotive Pte Ltd (Pandan Gardens)
209 Pandan Gardens
Singapore 609339

Estimated Period of Repair: 8.0 days

Adjuster: CHEN TSUE YEE

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but

any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SUNDRIES	Necessary	50.00 FS	*20.00 FS
2	1		*HEADLAMP ASSY, RH	Broken	660.00 FL	*660.00 FL
3	1		*LAMP ASSY, FOG, FR LH	Not Necessary	303.00 FL	*- FL
4	1		*FACE, FR BUMPER	Broken	703.00 FL	*703.00 FL
5	1		*COVER, HEADLAMP SUPT PANEL	Not Necessary	62.00 FL	*- FL
6	1		*GRILLE, FR UNDER	Not Necessary	165.00 FL	*- FL
7	1		*AIR DAM, SIDE, FR RH	Missing	18.00 FL	*18.00 FL
8	1		*GARNISH, FR BUMPER, RH	Cut	127.00 FL	*127.00 FL
9	1		*BRACKET, FR BUMPER, RH	Not Necessary	13.00 FL	*- FL
10	1		*GRILLE, RADIATOR	Broken	554.00 FL	*554.00 FL
11	1		*HOOD	Dented	734.00 FL	*734.00 FL
12	1		*HINGE, HOOD, RH	Not Necessary	56.00 FL	*- FL
13	1		*LATCH, HOOD	Not Necessary	69.00 FL	*- FL
14	1		*DAM, HOOD	Not Necessary	20.00 FL	*- FL
15	1		*FENDER, FR RH	Dented	497.00 FL	*497.00 FL
16	1		*REINFORCEMENT, FR BUMPER	Dented	466.00 FL	*466.00 FL
17	1		*COVER, ENG ROOM UNDER, FR	Not Necessary	99.00 FL	*- FL
18	1		*SHIELD, FR WHEELHOUSE, RH	Torn	98.00 FL	*98.00 FL
19	1		*PANEL ASSY, FR DOOR, RH	Repair	996.00 FL	*- FL
20	1		*RUNCHAN, FDR WDO GLA, RR RH	Not Necessary	20.00 FL	*- FL
21	1		*GLASS, FR DOOR WINDOW, RH	Not Necessary	233.00 FL	*- FL
22	1		*MLDG, F/DR WDO BELT LINE, RH	Not Necessary	75.00 FL	*- FL
23	1		*TAPE, FR DOOR SASH, RH	Not Necessary	29.00 FL	*- FL
24	1		*GARNISH, FR FENDER	Not Necessary	65.00 FL	*- FL
25	1		*TANK ASSY, RADIATOR COND	Not Necessary	42.00 FL	*- FL
26	1		*TANK, WINDSHIELD WASHER	Crushed	74.00 FL	*74.00 FL
27	1		*CAP, WASHER TANK FILLER	Not Necessary	7.00 FL	*- FL
28	1		*RUNCHANNEL, F/DR WDO GLA, RH	Not Necessary	120.00 FL	*- FL
29	1		*CROSSMEMBER, FR AXLE, NO.1	Bent	864.00 FL	*864.00 FL
30	1		*LINK KIT, F/SUSP STABILIZER	Bent	27.00 FL	*27.00 FL
31	1		*ARM ASSY, FR SUSP, LWR RH	Bent	278.00 FL	*278.00 FL
32	1		*STRUT, FR SUSP	Bent	452.00 FL	*452.00 FL
33	1		*BEARING, FR SUSP STRUT	Necessary	9.00 FL	*9.00 FL
34	1		*STOPPER, FR SUSP STRUT	Necessary	27.00 FL	*27.00 FL
35	1		*INSULATOR, HOOD	Bent	177.00 FL	*177.00 FL
36	1		*ROD, HOOD SUPPORT	Bent	37.00 FL	*37.00 FL
37	1		*MOTOR, WINDSHIELD WASHER	Broken	30.00 FL	*30.00 FL
38	1		*GROMMET, FR BUMPER	Necessary	4.00 FL	*4.00 FL
39	6		*RIVET, FR BUMPER	Necessary	30.00 FL	*30.00 FL
40	1		*GARNISH, FR PILLAR, RH	Necessary	30.00 FL	*30.00 FL
41	10		*CLIPS	Necessary	30.00 FL	*30.00 FL
42	1		*MARK, THREE-DIA	Necessary	69.00 FL	*69.00 FL
43	1		*EMBLEM ECO	Necessary	17.00 FS	*17.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	8,436.00	6,032.00
- List Item Discount on L Items 23.00/23.00% (\$)	1,924.87	1,378.85
Total Parts (\$)	6,511.13	4,653.15

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REPLACE FRT BUMPER, BONNET, FRT RH FENDER, FRT RH DOOR & AFFECTED AREA. REPAIR ON FRT RH WHEEL HOUSING, FRT RH A-PILLAR	New	2,700.00	2,250.00
2	PAINT WORK ON FRT BUMPER, BONNET, FRT RH FENDER, FRT RH DOOR & FRT RH WHEEL HOUSING	New	1,750.00	1,750.00
3	PERFORM RUST PREVENTION	New	80.00	40.00
4	CHECK WIRING & CHASSIS ELECTRICAL SYSTEM	New	30.00	30.00
5	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN TEST USING HI-SCAN PRO TEST	New	120.00	120.00
6	TO REPLACE ENGINE ATTACHMENTS	New	450.00	0.00
7	TO CONDUCT COMPUTERISE FULL WHEEL ALIGNMENT	New	120.00	120.00
8	REMOVE & REPLACE RH FRONT UNDERCARRIAGE PARTS	New	450.00	450.00
Gross Labour Cost (\$\$)			5,700.00	4,760.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >